DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: ____
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

4727-81-3324

OWNER: FOY - WHITE PARTNERSHIP APPLICANT: MICHAEL WHITE
ADDRESS: P.O. 5671, STATESVILLE, 28687 APPLICATION DATE: 3-22-02 DATE EVALUATED: 4-27-02
PROPOSED FACILITY: 3BR H w/ cs PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 0.433 ACRE
LOCATION OF SITE: NORTH CROSSING II #26 PROPERTY RECORDED: ____
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other ____
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	N 14%	0-4	SBK GRAVELLY CLAY	FR SS/P SE/P					PS 0.25
		4-18	ABK C	FRS-SS/P SE/P					
		18-28	ABK C	FR SS/SP SE/P	BLACK MOTTLES				
		28-48	E/ABK SC	FR SS/SP SE/P	YELLOW & BLACK MOTTLES				
2	N 10%	0-4	SBK GRAVELLY CLAY	FR SS/SP SE/P					PS 0.25
		4-20	ABK C	FR S/P SE/P					
		20-30	ABK C	FR SS/SP SE/P	BLACK MOTTLES				
		30-48	ABK C	FR SS/SP SE/P	YELLOW & BLACK MOTTLES				
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II	IV
Site LTAR	0.25	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: ____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

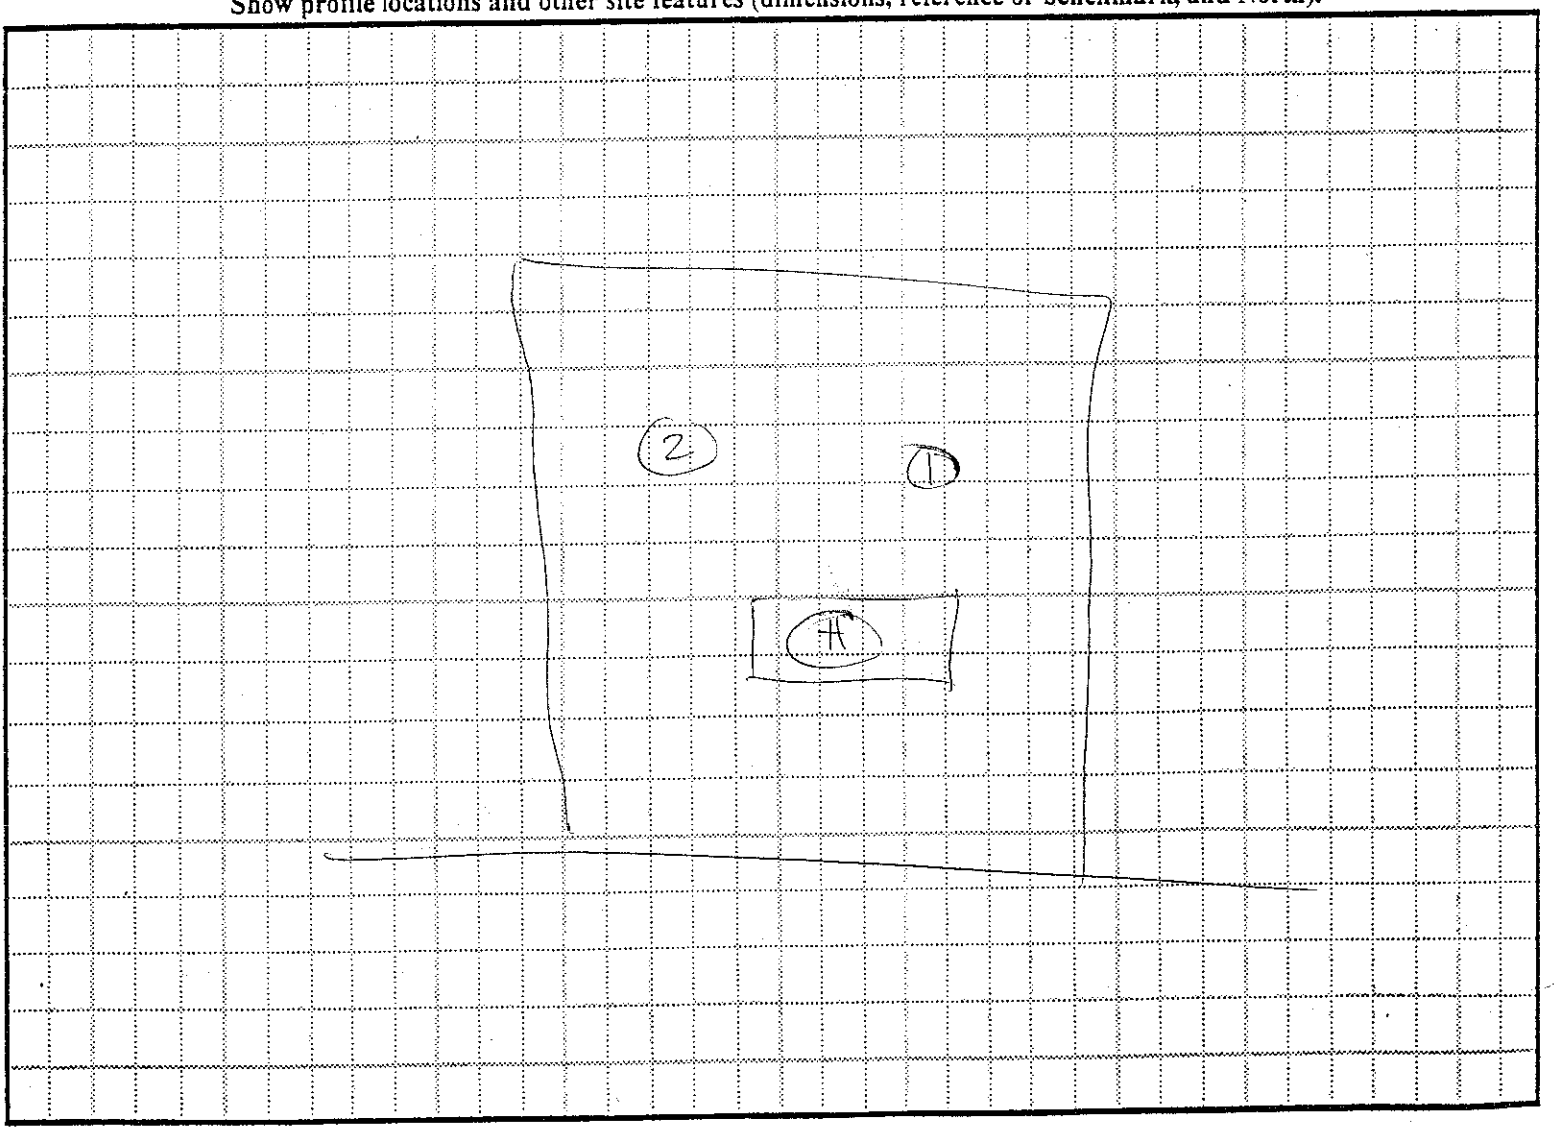

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: IREDELL

4727-81-2294

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CUSTOM HOMES BY LISA, INC — APPLICATION DATE:
ADDRESS: 220 CROSS COUNTRY RD, STATESVILLE 28625 — DATE EVALUATED: 9-14-06
PROPOSED FACILITY: 3BR HOUSE — PROPOSED DESIGN FLOW (.1949): 360 — PROPERTY SIZE: .91 ACRES
LOCATION OF SITE: NORTH CROSSING #26 (REPUTED) — PROPERTY RECORDED:
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut — TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 62	0-4	SBK - channery C	FR SS/P SEP					PS 0.25 gpd/ft²
		4-18	ABK - C	FR SS/P SEP					
		18-30	ABK C	FR SS/SP SEP	BLACK MOTTLES ②	18"+			
		30-48	WSBK SC	FR SS/SP SEP	YELLOW MOTTLES ③	28"+			
2									
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II	IV
Site LTAR	0.25	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: LISA WILLIAMS

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05
		O (Organic)	None	None

MINERALOGY/ CONSISTENCE
NEXP (Non-expansive)
SEXP (Slightly Expansive)
EXP (Expansive)

STRUCTURE
G (Single Grain)
M (Massive)
CR (Crumb)
GR (Granular)
SBK (Subangular Blocky)
ABK (Angular Blocky)
PL (Platy)
PR (Prismatic)

MOIST
VFR (Very Friable)
FR (Friable)
FI (Firm)
VFI (Very Firm v. Very Sticky)
EFI (Extremely Firm)

WET
NS (Non-sticky)
SS (Slightly Sticky)
S (Sticky)
VS (Very Sticky)
NP (Non-plastic)
SP (Slightly Plastic)
P (Plastic)
VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

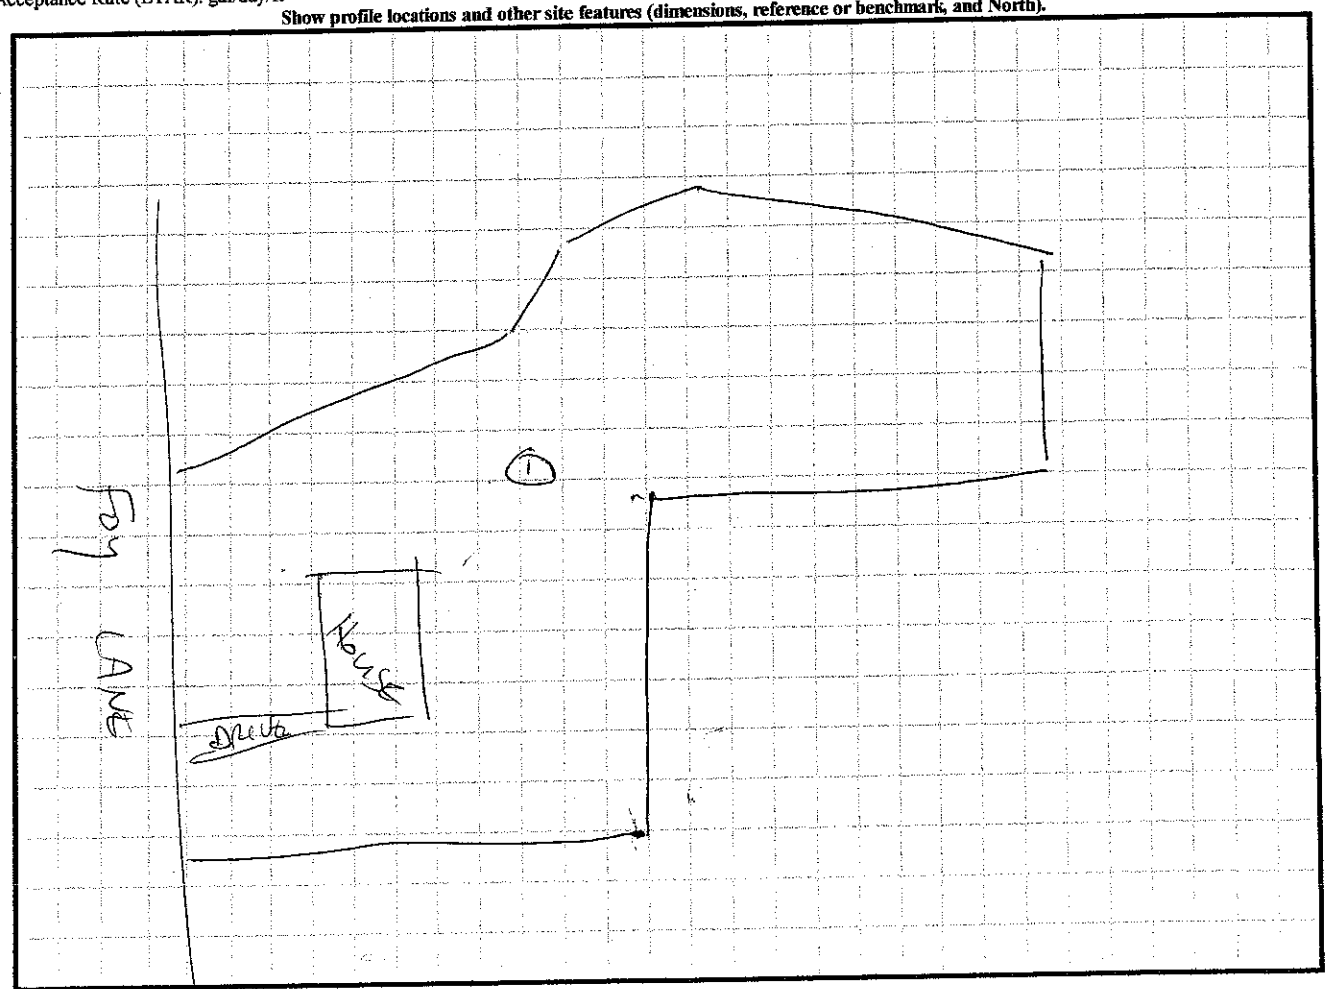

DENR (######)
Review (#####)