DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

4728-12-1558

Sheet 1 of 1
PROPERTY ID #:
COUNTY:

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Benjamin T. Hyde APPLICATION DATE 4-5-04
ADDRESS: 1020 4th Creek Landing Dr. Statesville NC 28677 DATE EVALUATED: 5-10-04
PROPOSED FACILITY: 3 br PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 1.64
LOCATION OF SITE: 115 N @ Pisgah @ Treebark end of road PROPERTY RECORDED: yes
WATER SUPPLY: ☑ Private ☐ Public ☐ Well ☐ Spring ☐ Other third lot from end
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 8%	0-30	wk sbk scl	vfr ss/sp sexp	—	>48	—	—	PS .3
		30-48	mo sbk c	fr s/p sexp					
2	L 10%	0-13	wk sbk scl		—	>48	—	—	PS .3
		13-38	mo sbk c	fr s/p sexp					
		38-48	mo sbk C+Sap	fr s/p sexp					
3	L 6%	0-12	wk sbk scl		—	>48	—	—	PS .3
		12-48	mo sbk sc	fr s/p sexp					
4	L 6%	0-14	wk sbk scl		—	>48	—	—	PS .3
		14-48	mo sbk sc	fr s/p sexp					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Con. gravity	same
Site LTAR	.3 gpd/ft²	.3 gpd/ft²

OTHER FACTORS (.1946): none
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: CS
OTHER(S) PRESENT: Ben Hyde

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SCL (Sandy Clay Loam)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiL (Silt Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SiCL (Silty Clay Loam)			MOIST	WET
S (Shoulder Slope)		Si (Silt)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(uitable) or U(nsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

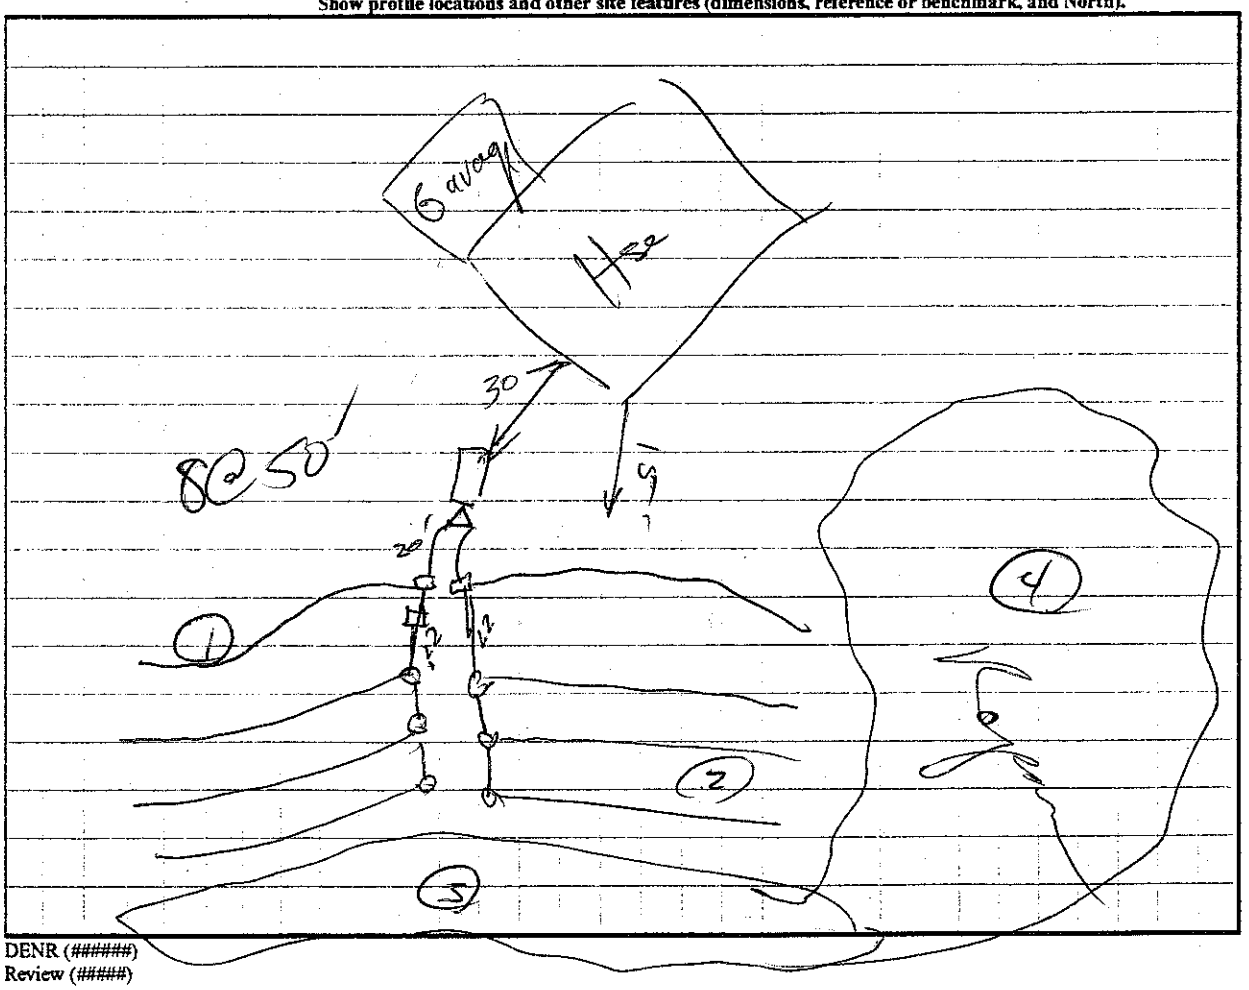

DENR (######)
Review (#####)