IREDELL COUNTY HEALTH DEPARTMENT

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION
(Ground Absorption Sewage Disposal System -- G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR WESLEY MILLER DATE 10-28-83 PERMIT NO.

PHONE: Business Home

LOCATION Perth Church Rd. go on past State Park Rd. about 3/4 mi. on (L) - Turn into dev (Perthwood Estates) - 1/4 mi. on (L).

SUBDIVISION NAME PERTHWOOD S. R. No.

LOT NO. 26 SECTION OR BLOCK NO.


House (✓) Mobile Home ( ) Business ( ) Other

No. Bedrooms 3 No. Bathrooms 2

Garbage Disposal Unit	Yes ( )	No (✓)	
Auto. Dishwasher	Yes (✓)	No ( )	
Auto. Wash. Machine	Yes (✓)	No ( )	
Site Suitable	Yes (✓)	No ( )	

Lot Area Ample

Character & Porosity of Soil Red clay
Percolation Rate 6 gal/sq. ft.
Topography 2-6%
Depth to Water Table 10'+
Rock or other impervious formations none observed.

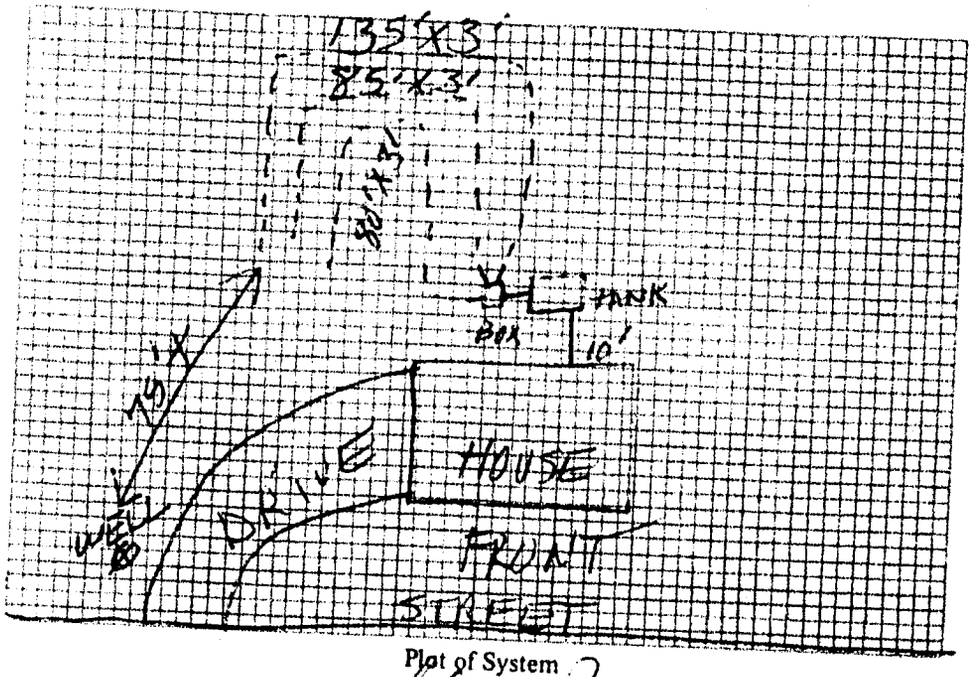

Plat of System

Size of Tank 1000 Gals.
Nitrification Field:
No. of Lines 3
Sq. Ft. 900 Linear Ft. 300
Depth of Stone in Lines 12"
Water Supply: Individual (✓)
Public ( )

Installed by Donald Lackey

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed:

IMPROVEMENTS PERMIT BY Steve Brown

COMMENTS: 3 stepdowns in longest line, 2 in middle line + 1 stepdown in shortest line. Landscape over drain lines for surface water control.

CERTIFICATE OF COMPLETION BY Steve Brown

EXISTING SYSTEM CHECKED BY: DATE 10-28-83

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.
Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold