DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

PIT 3 0-12 scl wk sbk f ss ps
12-45 cl mdsbk f ss ps
45-65 cl wk sbk f ss ps
PS .3

OWNER: DC STUTTS
ADDRESS: 104 STATELY PINES Dr Thurmon NC 28166
PROPOSED FACILITY: 4BR Resort
PROPOSED DESIGN FLOW (.1949): 480
LOCATION OF SITE: WOOTTEN Drive on LEFT
APPLICATION DATE: 1-31-08
DATE EVALUATED: 2-4-08
PROPERTY SIZE: 2.27
PROPERTY RECORDED: YES

WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	1,3% 2 AWC/W	0-3	scl wk sbk	f ss ps	PI 5				
		3-36"	cl mdsbk	f ss ps	sp inclusions	30-36"			
		36"	rock		24" > 5R 6/8				
2	1,5% 2 AWC/W	0-3	scl wk sbk	f ss ps	PI 5				
		3-18	cl mdsbk	f ss ps	34" - 12 - 6.5 = 15.5"				
		18-34	sap						
3	PIT 1	0-18	scl wk sbk	f ss ps		30"			PS .35
		18-30	wk cl mdsbk	f ss ps	sp inclusions				
		30-63"	SL sap wk sbk	f ss ps	cl mdsbk mixed in				
4	PIT 2	0-9	scl wk sbk	f ss ps		30"			PS .35
		9-30	cl mdsbk	f ss ps					
		30-52	l sap wk sbk	f ss ps	7.5YR inclusions				
		52-65	SL sap wk sbk	f ss ps					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	CRAW 25	PUMP UP COM
Site LTAR	135	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. COOK
OTHER(S) PRESENT: OWNER

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

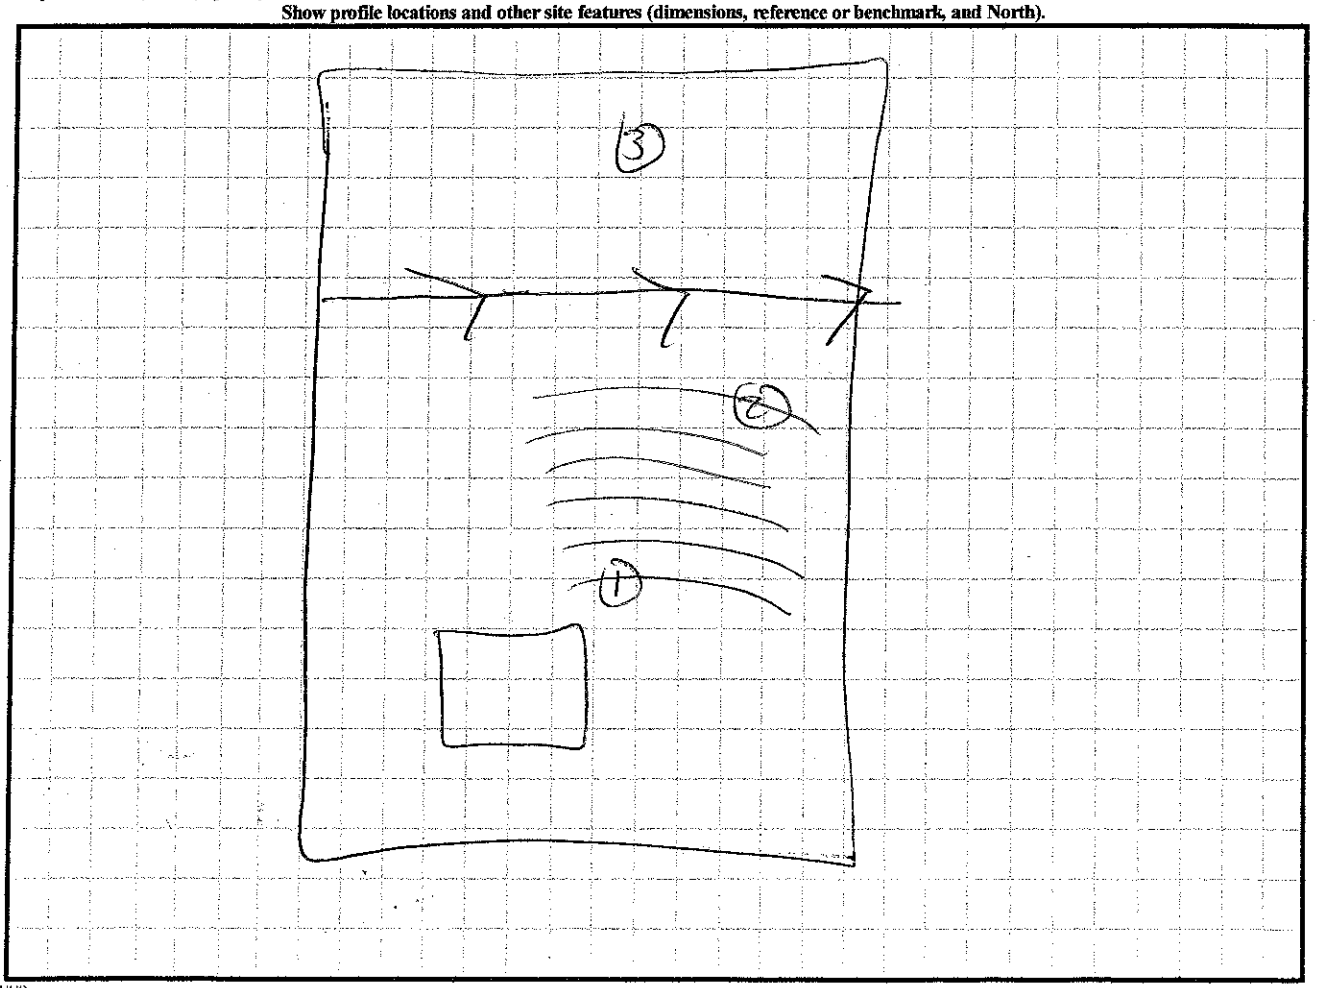

DENR (######)
Review (#####)