DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ____ of
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Applicant
~~OWNER~~: David Meehan APPLICANT: owner M. B Cline
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 9/8/03
PROPOSED FACILITY: 4BR Manuf/Mod Home PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: 5.36 Ac
LOCATION OF SITE: Lot 124 Meadow Oaks S/D PROPERTY RECORDED: Yes
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	Linear 5%	0-12	scl BRN	fr ss np SPL					PS .25
		12-37	cl	fi ss sp SPL					
		37-44	cl/sap micaceous	fr ss sp SPL					
2	Linear 6%	0-8	sce BRN	fi ss np SPL					PS .25
		8-29	cl SBK	fi ss sp SPL					
		29-44	cl/sap micaceous	fr ss sp SPL					
		44-57	sap s cl some cl lenses	Fi NPL					
3	Linear	0-12	sce BRN	fr ss np SPL					PS .25
		12-32	cl SBK	fi ss sp SPL					
		32-43	cl/sap micaceous	fr/fi ss sp SPL					
		43-68	sap s (cl)	Fr NPL					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Pump 25% Red	Pump 40%
Site LTAR	.25	.25

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: Bill Johnson
OTHER(S) PRESENT: David Meehan, Jr and Helen

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

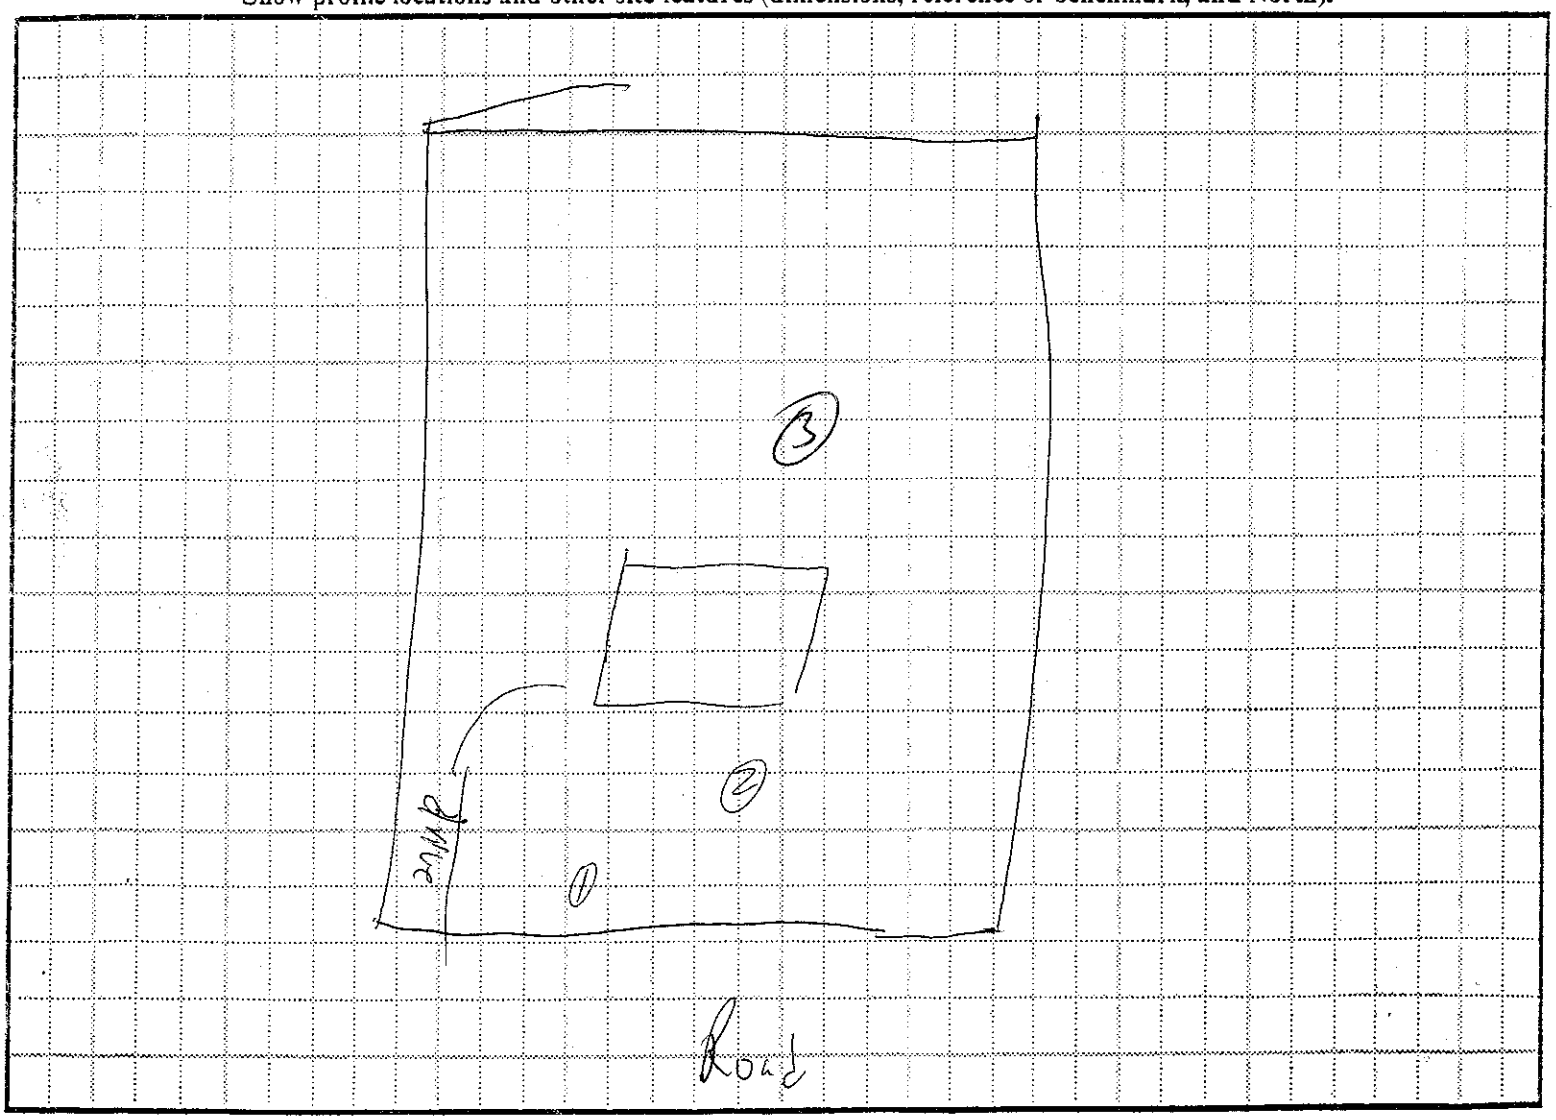

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ____ of
PROPERTY ID #: ____
COUNTY: ____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

- waiting on pits

OWNER: David Meehan Inc 902-0286 APPLICANT: Same
ADDRESS: ____ APPLICATION DATE: ____ DATE EVALUATED: 8/14
PROPOSED FACILITY: 3BR House (Crawl) PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: ~5.26
LOCATION OF SITE: ____ PROPERTY RECORDED: Yes
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other ____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	6% Linear	0-13	MR BRW SCL		Needs Pits				PS
		13-29	CL						
		29-33	CL SP mix						
		33-48	SAP (Wet pits)						
2									
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): ____
SITE CLASSIFICATION (.1948): ____
EVALUATED BY: Bill Johnson
OTHER(S) PRESENT: ____