DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

4741-88-7244

OWNER: WILLIAM BREWSTER CO, INC
ADDRESS: P.O. BOX 99 DAVIDSON, NC 28036
PROPOSED FACILITY: 5 BR HOUSE
PROPOSED DESIGN FLOW (.1949): 600
LOCATION OF SITE: MARIA'S VINEYARD #52
APPLICATION DATE 2-5-07
DATE EVALUATED: 2-5-07
PROPERTY SIZE: 1.427 ACRES
PROPERTY RECORDED:
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	SLIGHT N 8%	0-34	C	FI S/SP SOF					PS 0.25
		34-48	MICACEOUS CL	FR SOFP					
2	SLIGHT N 10%	0-36	C	FI S/SP SOF					PS 0.25
		36-48	MICACEOUS CL	FR SOFP					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	IV	IV
Site LTAR	0.25	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: LARRY ZINK

COMMENTS: SEE PREVIOUS BY BRADY FREEMAN

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

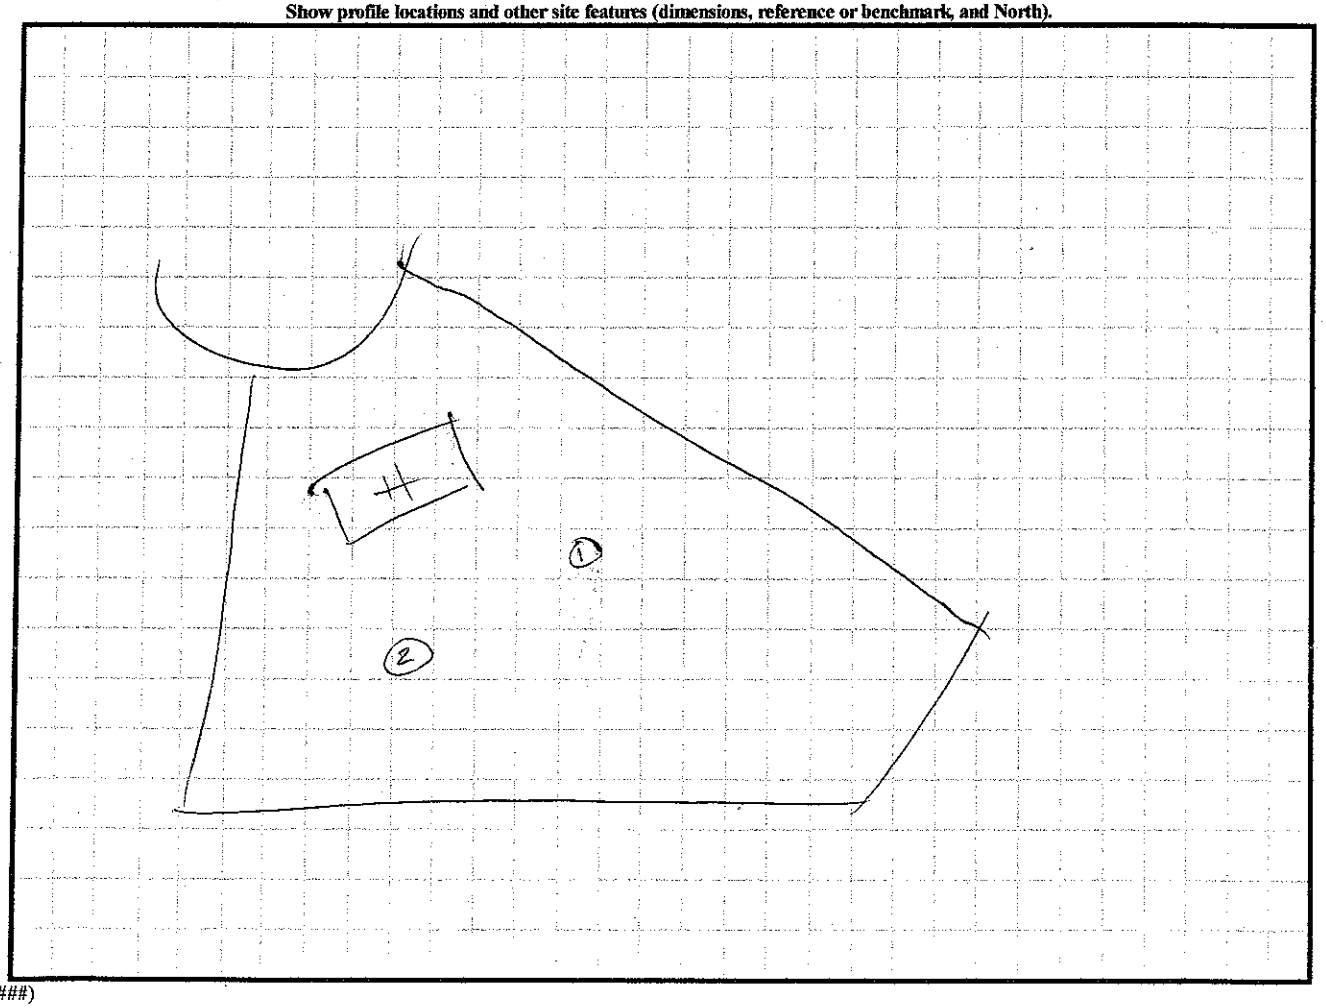

DENR (######)
Review (#####)

VISION OF ENVIRONMENTAL HEALTH
N-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: _____ APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: lot 52 Martha's Vineyard PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
	0-27	LC NFS SL/SiL FR	SSSP	FewSAP				I/S
	27-44	LFSL/L-SiL	VFSM FR	SSSP Common SAP				3
	0-30	LC SL/SiL FR	SO					I/S
	30-56	LC VFSM	FR	SSSP Common SAP				3

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Suitable Space (.1945)		
System Type(s)		
LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____
OTHER(S) PRESENT: _____

use the following standard abbreviations.

DSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL 1955 LTAR	EPP 1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
rainage Way)					EXP (Expansive)	CR (Crumb)
Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
lood Plain)		L (Loam)				SBK (Subangular Blocky)
oot Slope)						ABK (Angular Blocky)
ad Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
near Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
ge Slope)		CL (Clay Loam)				
dge)		SCL (Sandy Clay Loam)			MOIST	WET
ulder Slope)		SLC (Silt Loam Clay)				
race)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

E
ION DEPTH — In inches below natural soil surface
H OF FILL — In inches from land surface
UCTIVE HORIZON — Thickness and depth from land surface
LITE — S(suitable) or U(unsuitable)
PETNESS — Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
IFICATION — S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

tion of saprolite shall be by pits.
rm Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

