DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: 12515
COUNTY: 4747-04-8332

# SOIL/SITE EVALUATION
## *for* ON-SITE WASTEWATER SYSTEM

OWNER: BOBBY KNOW
ADDRESS: 1911 S KNOXWOOD DR HUNTSVILLE NC 28078
PROPOSED FACILITY: CWMH 3BR PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: 360 IN BRAN RD OFF ROAD BEHIND BARN
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other EXISTING
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

APPLICATION DATE: 10-28-04
DATE EVALUATED: 11-12-04
PROPERTY SIZE: 57.64
PROPERTY RECORDED: YES

| PROFILE # | .1940 LANDSCAPE POSITION/ SLOPE % | HORIZON DEPTH (IN.) | SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE | .1941 CONSISTENCE/ MINERALOGY | OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR | .1943 SOIL DEPTH | .1956 SAPRO CLASS | .1944 RESTR HORIZ | PROFILE CLASS & LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | 8% L | 0-6" | sl/wk sg | frs sp non | | >48" | 36" TB | | PS .35 |
| | | 6-30" | c mod sbk | fi s p sm | | | | | |
| | | 30-48" | sc wk sg | frs sp sm | | | | | |
| 2 | 10% L | 0-6" | sl/wk sg | frs sp non | | >48" | 36" TB | | PS .35 |
| | | 6-30 | c mod sbk | fi s p sm | | | | | |
| | | 30-48" | sc wk sg | frs sp sm | | | | | |
| 3 | 15% L | 0-6" | sl/wk sg | frs sp non | | >48" | 36" TB | | PS .35 |
| | | 6-28" | c mod sbk | fi s p sm | | | | | |
| | | 28-48" | sc wk sg | frs sp sm | | | | | |
| 4 | | | | | | | | | |

| DESCRIPTION | INITIAL SYSTEM | REPAIR SYSTEM |
|---|---|---|
| Available Space (.1945) | YES | YES |
| System Type(s) | LOW PRESS | SAME |
| Site LTAR | .35 | .35 |

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. LOCK
OTHER(S) PRESENT: BOBBY & ANDREW KNOWLES BROTHERS

COMMENTS: ___

# LEGEND

***use the following standard abbreviations***

| LANDSCAPE POSITION | GROUP | SOIL TEXTURE | CONVENTIONAL .1955 LTAR* | LPP .1957 LTAR* | MINERALOGY/ CONSISTENCE | STRUCTURE |
|---|---|---|---|---|---|---|
| CC (Concave Slope)<br>CV (Convex Slope)<br>D (Drainage Way)<br>DS (Debris Slump)<br>FP (Flood Plain)<br>FS (Foot Slope)<br>H (Head Slope)<br>L (Linear Slope)<br>N (Nose Slope)<br>R (Ridge)<br>S (Shoulder Slope)<br>T (Terrace) | I | S (Sand)<br>LS (Loamy Sand) | 1.2 - 0.8 | 0.6 - 0.4 | NEXP (Non-expansive)<br>SEXP (Slightly Expansive)<br>EXP (Expansive) | G (Single Grain)<br>M (Massive)<br>CR (Crumb)<br>GR (Granular)<br>SBK (Subangular Blocky)<br>ABK (Angular Blocky)<br>PL (Platy)<br>PR (Prismatic) |
| | II | SL (Sandy Loam)<br>L (Loam) | 0.8 - 0.6 | 0.4 - 0.3 | | |
| | III | Si (Silt)<br>SiCL (Silty Clay Loam)<br>CL (Clay Loam)<br>SCL (Sandy Clay Loam)<br>SiL (Silt Loam) | 0.6 - 0.3 | 0.3 - 0.15 | | |
| | IV | SC (Sandy Clay)<br>SiC (Silty Clay)<br>C (Clay) | 0.4 - 0.1 | 0.2 - 0.05 | MOIST<br>VFR (Very Friable)<br>FR (Friable)<br>FI (Firm)<br>VFI (Very Firm v. Very Sticky) | WET<br>NS (Non-sticky)<br>SS (Slightly Sticky)<br>S (Sticky)<br>VS (Very Sticky) |
| | | O (Organic) | None | None | EFI (Extremely Firm) | NP (Non-plastic)<br>SP (Slightly Plastic)<br>P (Plastic)<br>VP (Very Plastic) |

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


***NOTES***

| | |
|---|---|
| *HORIZON DEPTH* | In inches below natural soil surface |
| *DEPTH OF FILL* | In inches from land surface |
| *RESTRICTIVE HORIZON* | Thickness and depth from land surface |
| *SAPROLITE* | S(suitable) or U(unsuitable) |
| *SOIL WETNESS* | Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation |
| *CLASSIFICATION* | S (Suitable), PS (Provisionally Suitable), or U (Unsuitable) |

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft$^2$

**Show profile locations and other site features (dimensions, reference or benchmark, and North).**

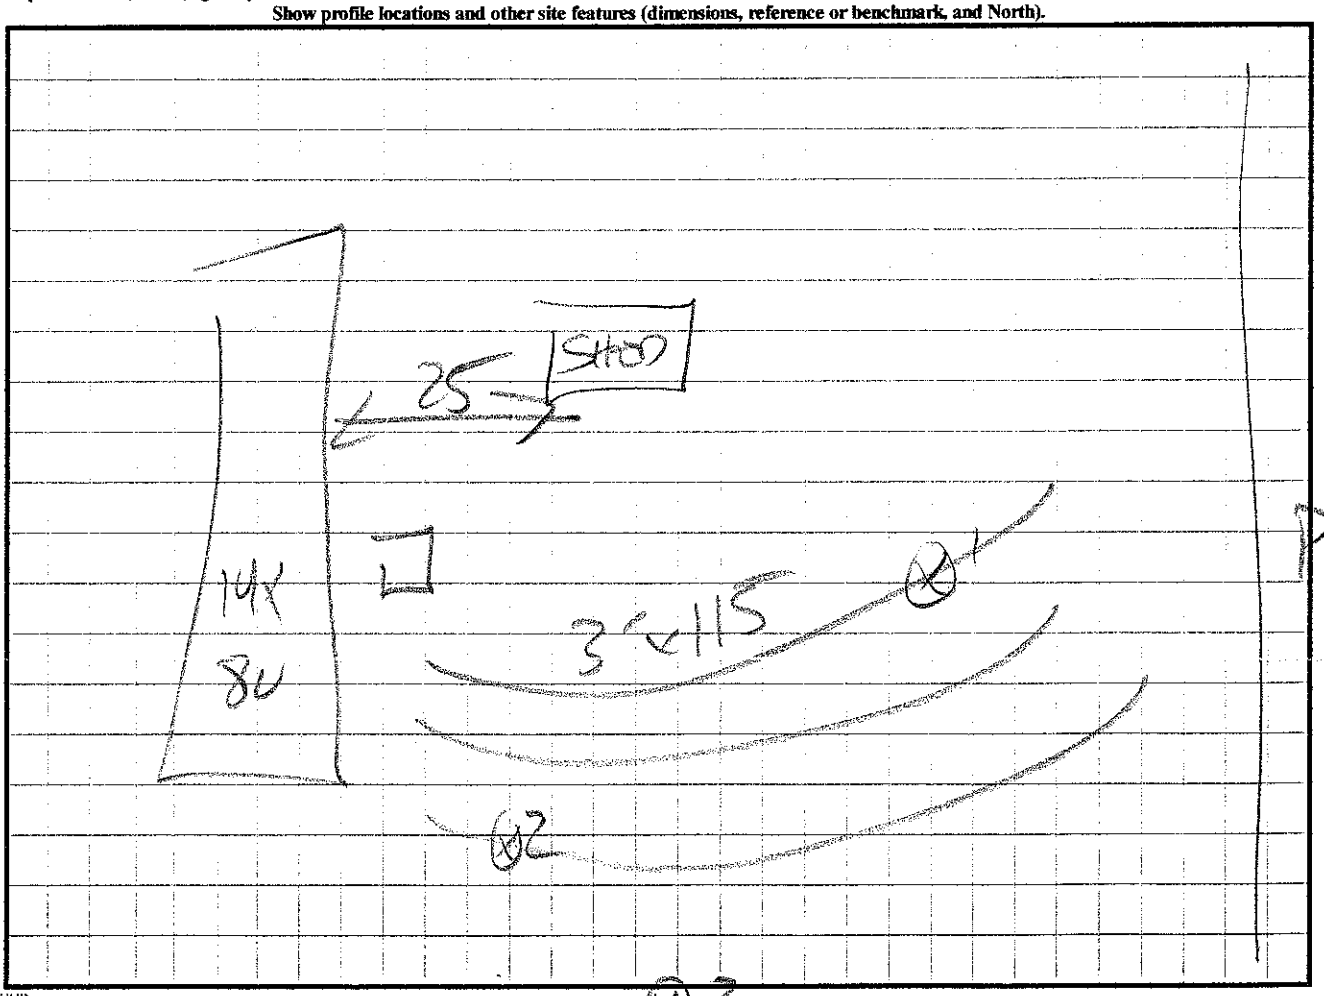


DENR (######)
Review (#####)