DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4747745539
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: JAMES DEHART
ADDRESS: 196 TAVERS RD Statesville NC 28625
PROPOSED FACILITY: 3BR House
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: I-77 North to Jennings to TAVERS ATTENDANCE on LEFT
WATER SUPPLY: X Private • Public X Well • Spring • Other
EVALUATION METHOD: • Auger Boring X Pit • Cut
TYPE OF WASTEWATER: X Sewage • Industrial Process • Mixed

APPLICATION DATE 12/30/09
DATE EVALUATED: 1/12/10
PROPERTY SIZE: 4.55
PROPERTY RECORDED: YES

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	B% L	0-24"	c med sbk	fr sp slep	N/A	32"	PS	N/A	PS .3 most limiting
		24-32"	cl wk sbk	fr ss sp slep					
		32-60"	loamy sp wk gr	fr ns np nep					
2	8% L	0-27"	c med sbk	fr sp slep	N/A	42"	PS	N/A	PS .3 most limiting
		27-42"	cl wk sbk	fr ss sp slep					
		42"-72"	loamy sp wk gr	fr ns np nep					
3	5% L	0-24"	c med sbk	fr sp slep	N/A	48"	PS	N/A	PS .3 most limiting
		24-48"	cl wk sbk	fr ss sp slep					
		48-60"	loamy sp wk gr	fr ns np nep					
4	10% L	0-8	c med sbk	fr sp slep	N/A	48"	PS	N/A	PS .3 most limiting
		8-48"	cl wk sbk	fr ss sp slep					
		48-60"	loamy sp wk gr	fr ns np nep					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	GRW 25%	GRW 25%
Site LTAR	.3	.3

OTHER FACTORS (.1946): 100' well setback due to spodite
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. COOK
OTHER(S) PRESENT: SHANNON Henderson / WESLEY

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

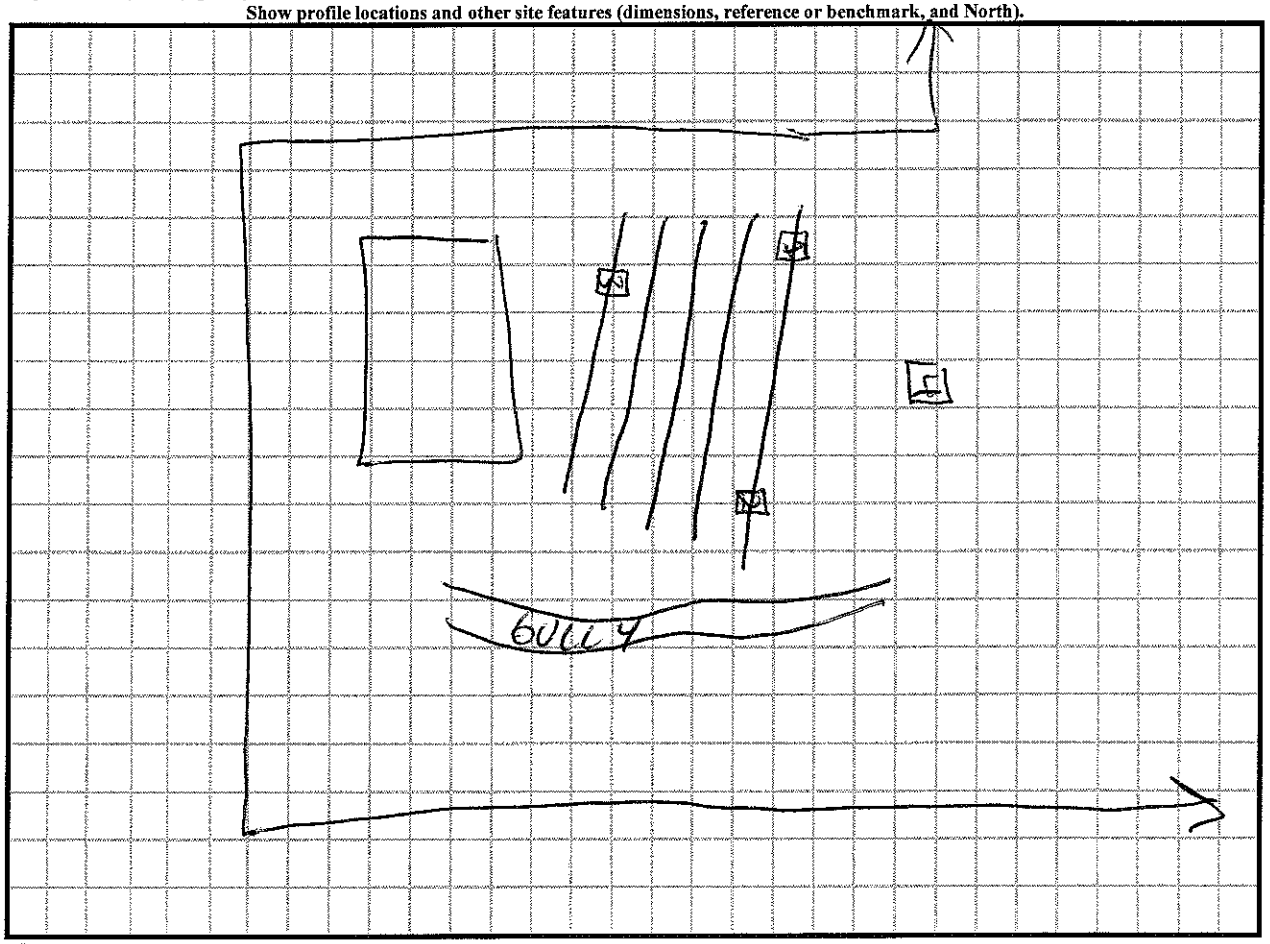

DENR (######)

Review (#####)