DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4747-95-0112
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: KORAC BLOCH
ADDRESS: 362 JENNINGS ROAD, STE, NC 28625-9487
PROPOSED FACILITY: 3 BR D/W
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: 362 JENNINGS ROAD
WATER SUPPLY: • Private • ✓Public • Well • Spring • Other
EVALUATION METHOD: • ✓Auger Boring • Pit • Cut
TYPE OF WASTEWATER: • ✓Sewage • Industrial Process • Mixed

APPLICATION DATE: 10-7-11
DATE EVALUATED: 10-11-11
PROPERTY SIZE: 1.0 ACRE
PROPERTY RECORDED:

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	SLIGHT H 4%	0-3	GR L	VFR SEAP	N/A	PS TO 46"	PS TO 46"	N/A	PS 0.3
		3-32	SBK C	FR SEAP					
		32-46	SBK CL	FR SEAP					
		46-48	SAPROLITE						
2	SLIGHT H 4%	0-4	GR L	VFR SEAP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		4-34	SBK C	FR SEAP					
		34-48	SBK CL	FR SEAP					
3	SLIGHT H 5%	0-3	GR L	VFR SEAP	N/A	PS TO 46"	~~N/A~~ PS TO 46"	N/A	PS 0.3
		3-32	SBK C	FR SEAP					
		32-46	SBK CL	FR SEAP					
		46-48	SAPROLITE						
4	L 3%	0-2	GR L	VFR SEAP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		2-34	SBK C	FR SEAP					
		34-48	SBK CL	FR SEAP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	~~III~~	~~III~~
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS

EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: KORAC BLOCH & OTHERS

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

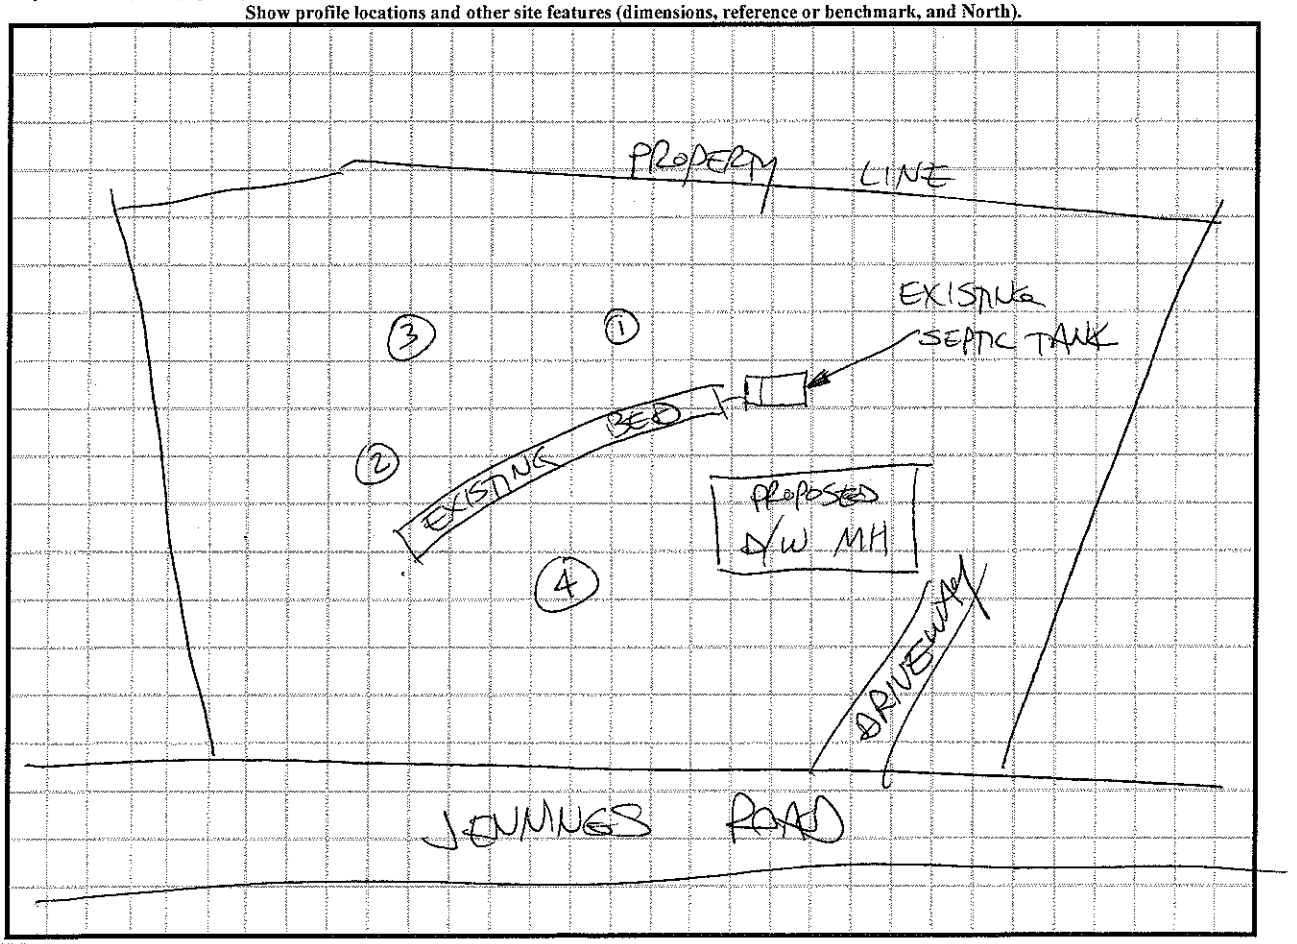

DENR (######)
Review (#####)