DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Dixie Land Inc APPLICATION DATE ___
ADDRESS: ___ DATE EVALUATED: June 2, 03
PROPOSED FACILITY: ___ PROPOSED DESIGN FLOW (.1949): 360 gpd PROPERTY SIZE: .5 ac
LOCATION OF SITE: Lot 5 Deer Crossing PROPERTY RECORDED: ___
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	~4%	0-5	wk sbk rbk sl	fr sss p					.3
		5-20	wk-m f sbk RC	fr s p so/po					
		20-45	wk f sbk yrcl	fr sss p common mica sp					
2	Top of Old Berm	0-26	wk sbk brn scl	fr sss p					.25-.3
		26-46	wk f sbk RC	fr s p so/po					
				few mica sp @ bottom/pit					
3	~4%	0-4	wk sbk brn sl	fr sss p					.3
		4-15	m f sbk RCL	fr sss p					
		15-45	wk f/m sbk R-YRCL	fi sss p					
				few-common mica flakes 36"L					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	BS per .1956
System Type(s)	Conv 25% Red	LPP/pm PPBPS
Site LTAR	.25-.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DR Hamm
OTHER(S) PRESENT: ___

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SCL (Sandy Clay Loam)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiL (Silt Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SiCL (Silty Clay Loam)				
S (Shoulder Slope)		Si (Silt)				
T (Terrace)						
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05		
		SiC (Silty Clay)				
		C (Clay)				
		O (Organic)	None			

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

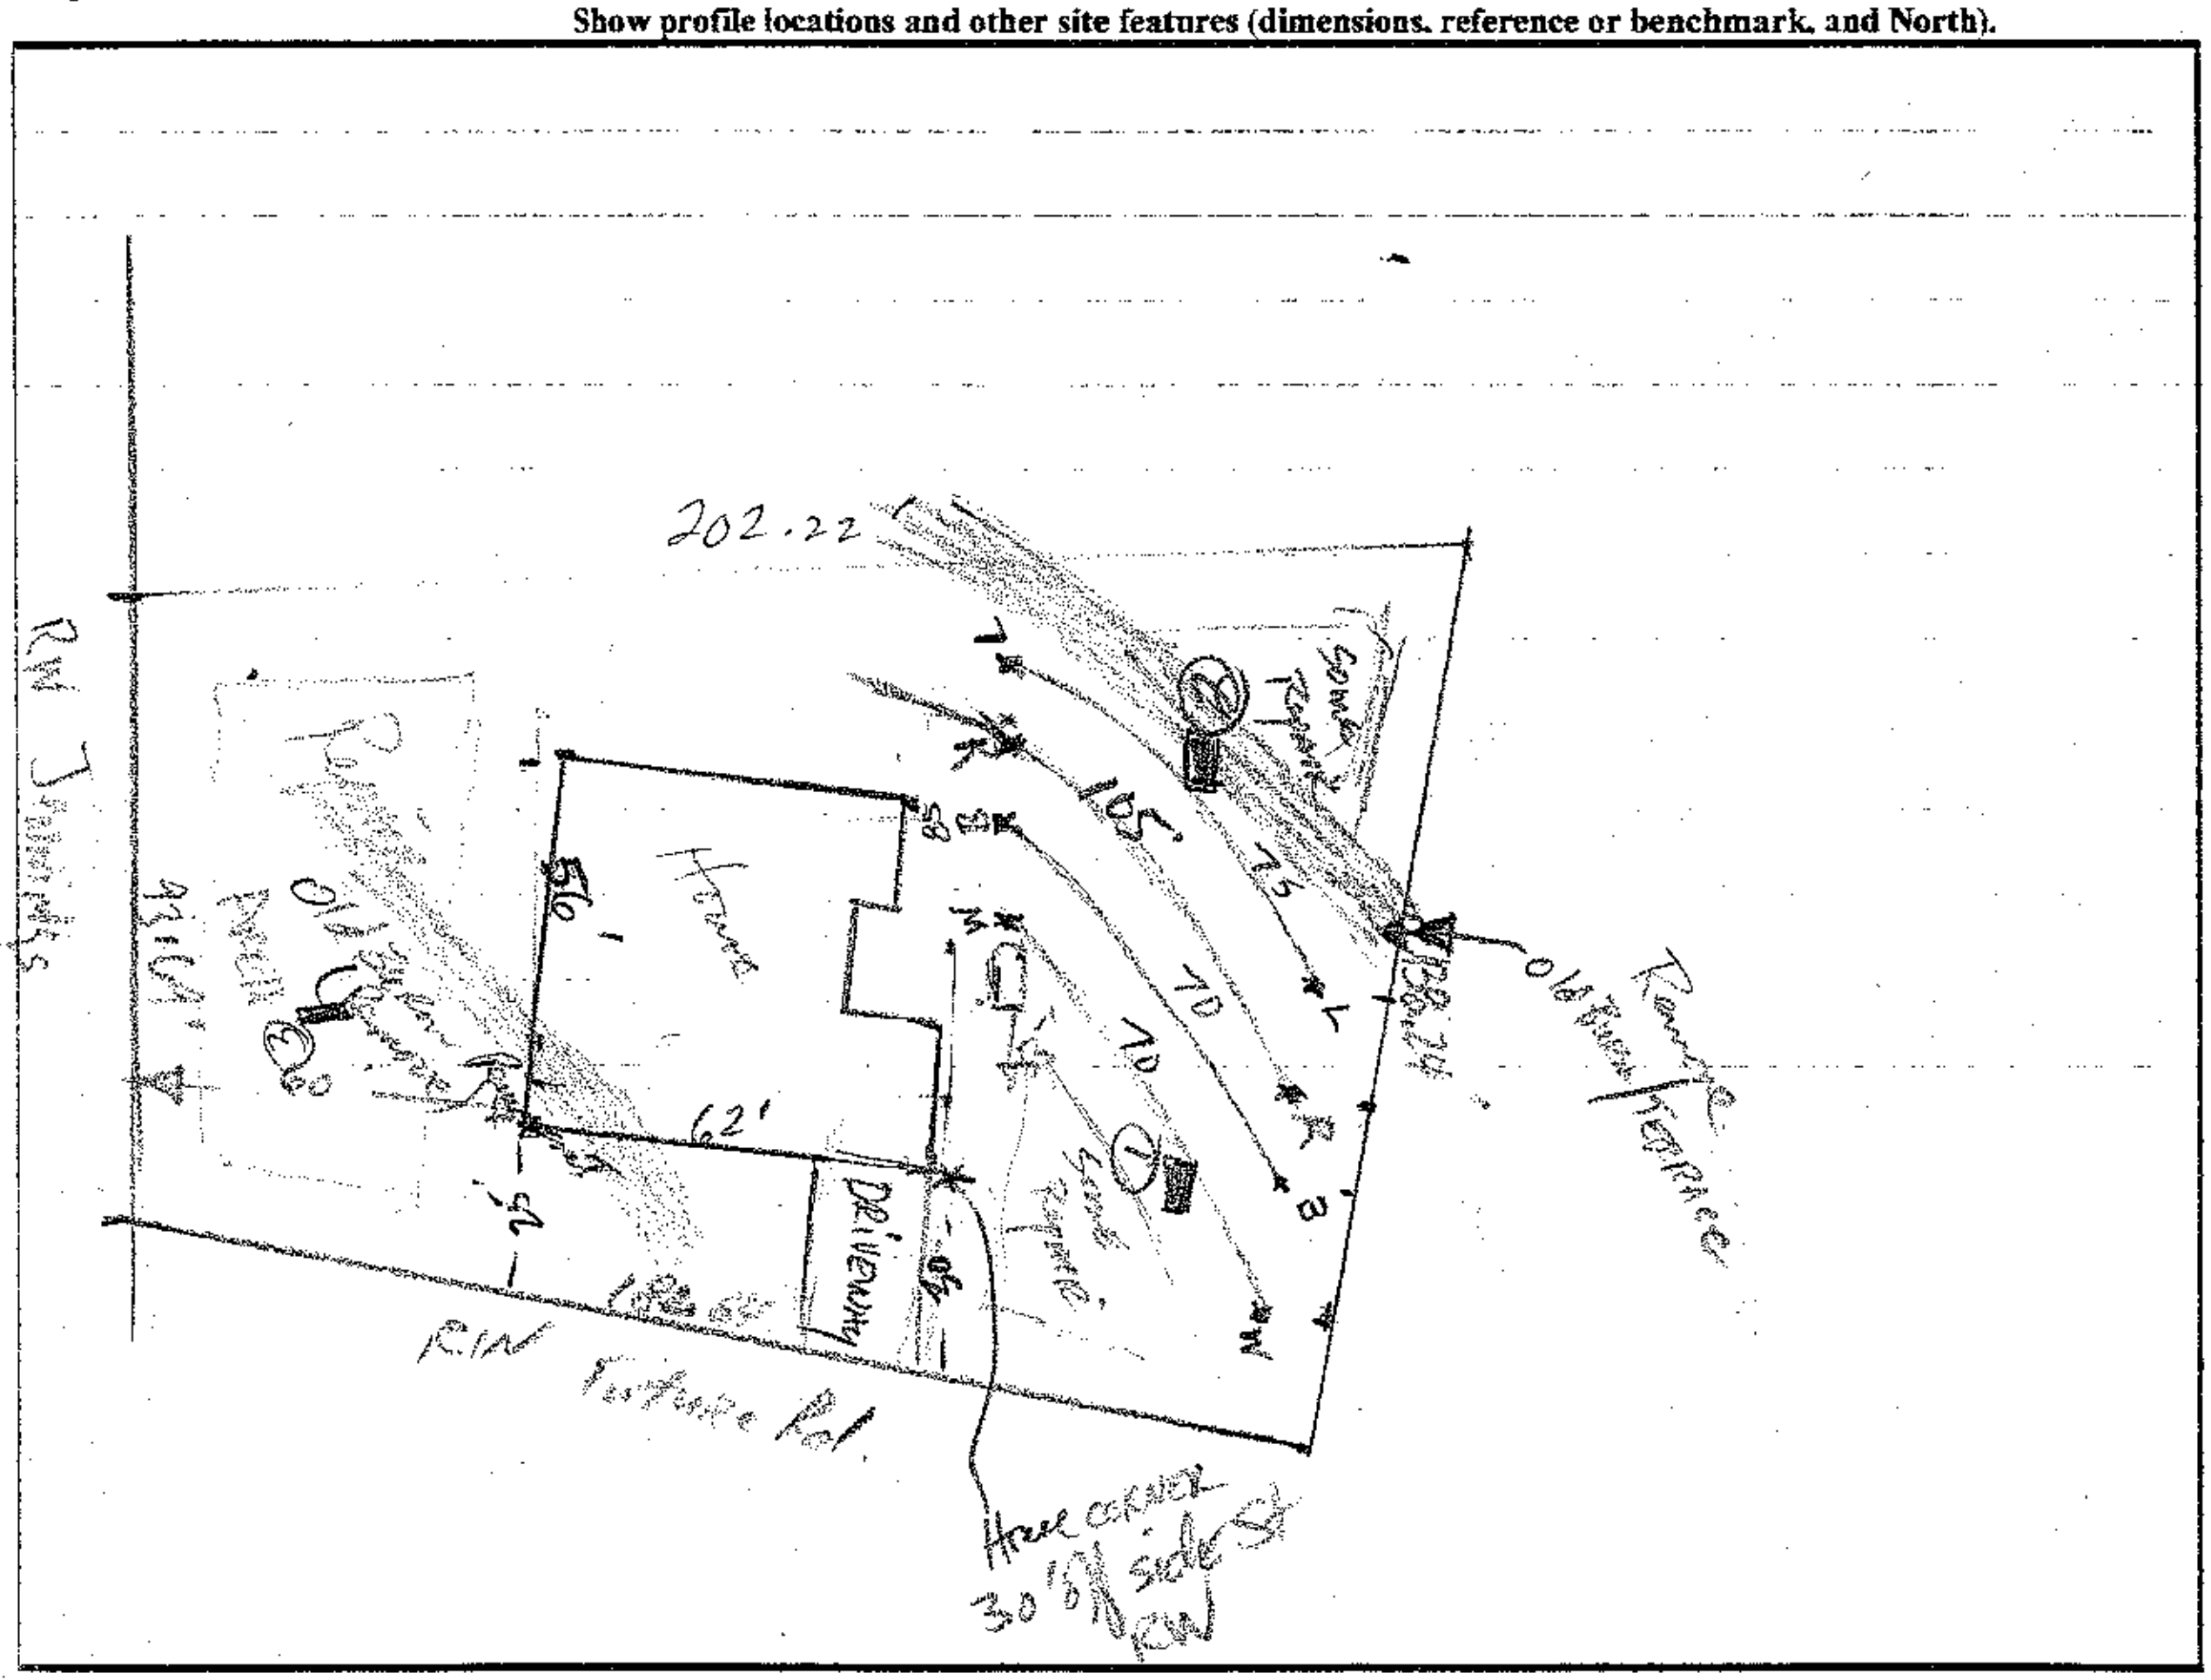

DENR (######)
Review (#####)

215
105
320 LF