DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: 128054
COUNTY: 4749-62-7518

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: RODNEY ROBERTSON
ADDRESS: 1300 JENNINGS RD STATESVILLE NC 28625
PROPOSED FACILITY: 3 BR HOUSE
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: JENNINGS RD NORTH @ BY TOWER INTO FIELD
APPLICATION DATE: 4-15-05
DATE EVALUATED: 6-6-05
PROPERTY SIZE: 0.913
PROPERTY RECORDED: YES

WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	8% L	0-3	SL WK GR	FR NP NS					PS .3
		3-36	C MED SBK	FI S P SS P					
		36-48"	SC MED SBK	FR SS SP SS P					
2	8% L	0-3	SL WK GR	FR NP NS					PS .3
		3-36"	C MED SBK	FI S P SS P					
		36-48"	SC MED SBK	FR SS SP SS P					
3	8% L	0-3"	SL WK GR	FR NP NS					PS .3
		3-36"	C MED SBK	FI S P SS P					
		36-48"	SC MED SBK	FR SS SP SS P					
4	8% L	0-3"	SL WK GR	FR NP NS					PS .3
		3-36"	C MED SBK	FI S P SS P					
		36-48"	SC MED SBK	FR SS SP SS P					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	CONV 2BEDROOM	SAME
Site LTAR	.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): ___
EVALUATED BY: L. COOK
OTHER(S) PRESENT: D. ROBERTSON

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

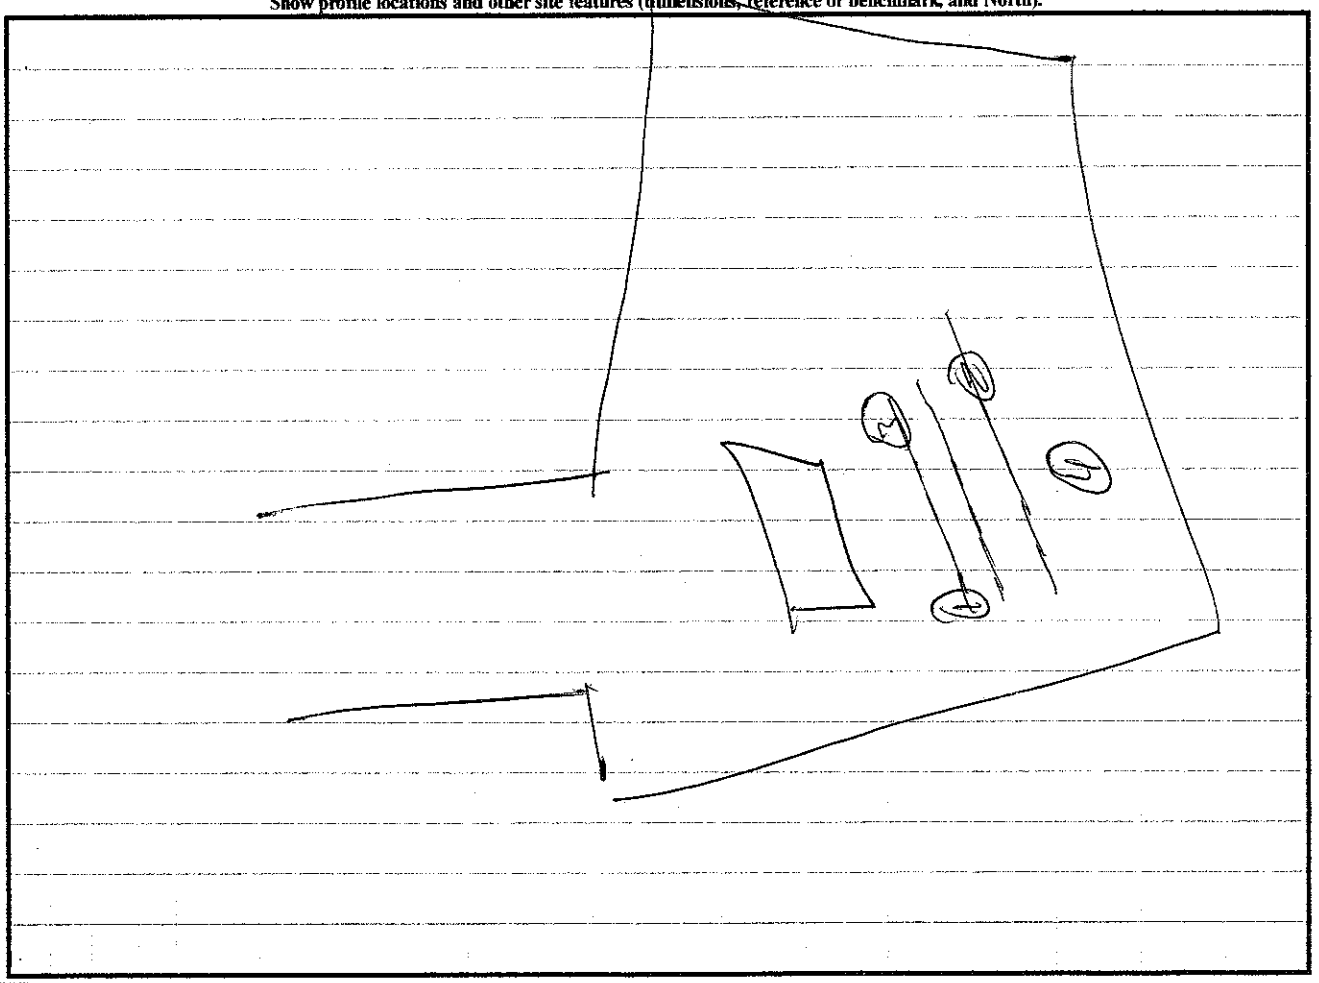

DENR (######)

Review (#####)