DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Kristen Kelly
ADDRESS: 108 Treeside Ct Troutman NC 28166 APPLICATION DATE 12/27/13
PROPOSED FACILITY: SFD PROPOSED DESIGN FLOW (.1949): 360 DATE EVALUATED: 01/16/13
LOCATION OF SITE: Kelly Farmstead PROPERTY SIZE: 1.75 ac
WATER SUPPLY: • (Private) • Public • Well • Spring • Other PROPERTY RECORDED: Yes
EVALUATION METHOD: • (Auger Boring) • Pit • Cut TYPE OF WASTEWATER: • (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	LSS 24%	0-10	CL fr	gr SE	PS	PS	N/A	N/A	PS .3
		10-32	C fi	ABK SE					
		32-50	BC(CL) fi/fr	WABK SE					
2	LSS 26%	0-12	CL fr	gr SE	PS	PS	N/A	N/A	PS .3
		12-32	C fi	SBK SE					
		32-49	BC(CL) fi/fr	WABK SE					
3	LSS 25%	0-3	CL fr	gr SE	PS	PS	N/A	N/A	PS .3
		3-35	C fi	SBK SE					
		35-49	BC(CL) fi/fr	WABK SE					
4	LSS 25%	0-10	CL fr	gr SE	PS	PS	N/A	N/A	PS .3
		10-33	C fi	SBK SE					
		33-49	BC(CL) fi/fr	WABK SE					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	25%	50%
Site LTAR	.3	.3

OTHER FACTORS (.1946): PS
SITE CLASSIFICATION (.1948): PS

EVALUATED BY: Heath Snow
OTHER(S) PRESENT: Alan McKinney

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

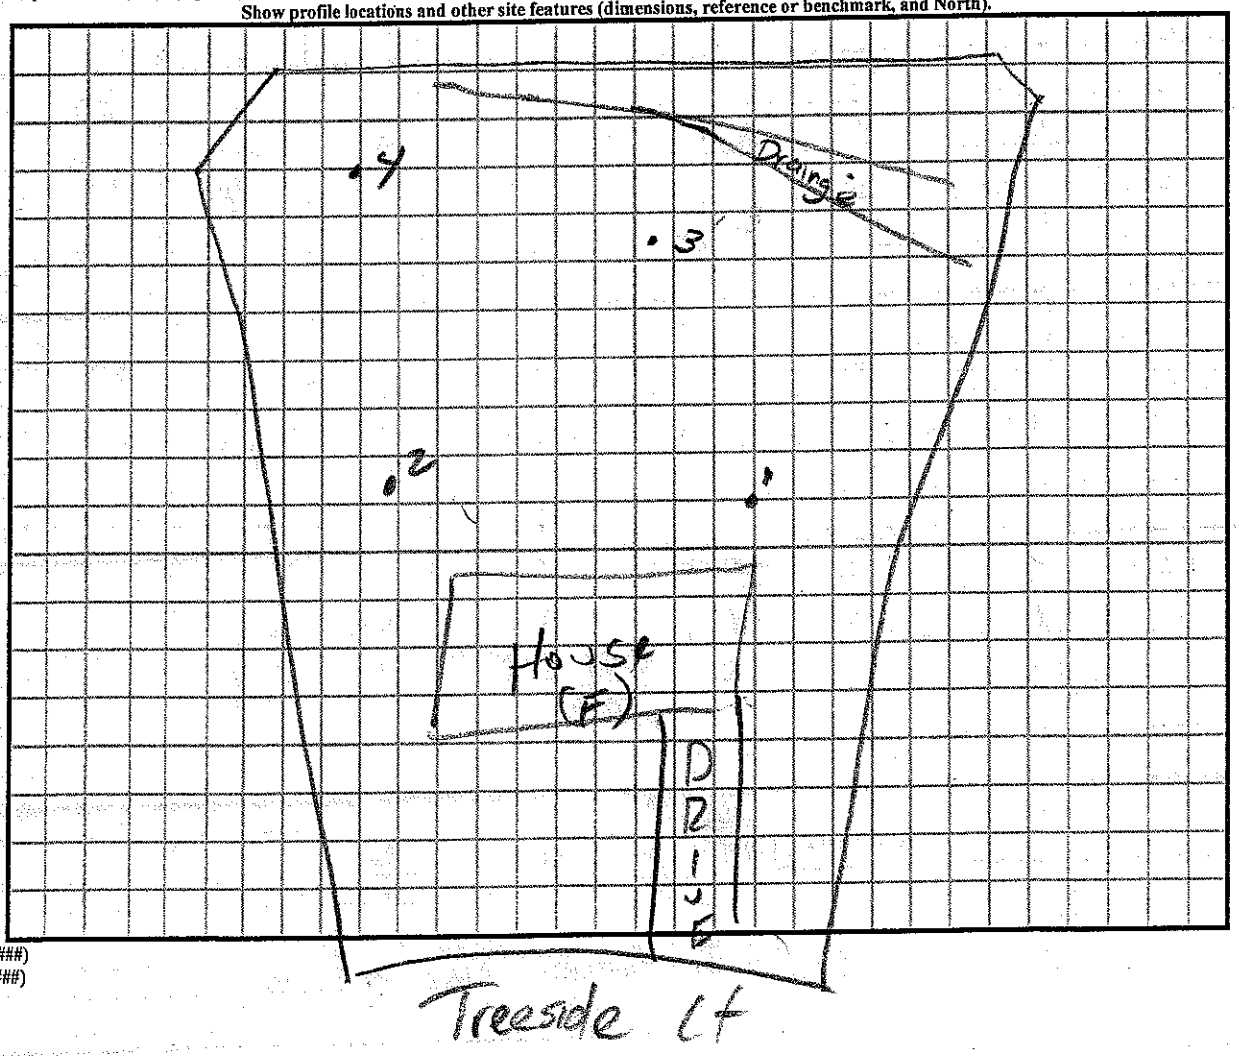

DENR (######)
Review (#####)