DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

130817
4751-98-1691

OWNER: JAMES CLONTZ
ADDRESS: 173 HAMPTONS COVE RD TROUTMAN, NC 28166
PROPOSED FACILITY: 4 BR HOUSE PROPOSED DESIGN FLOW (.1949): 430
LOCATION OF SITE: BEHIND BOX # 3511 AMITY HILL RD

APPLICATION DATE 8-23-05
DATE EVALUATED: 9-7-05
PROPERTY SIZE: 2.5 AC
PROPERTY RECORDED: NO

WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	15% L	0-4"	scl wkgr	fr sspr mp		100' WELL SETBACK			PS .4
		4-18"	cl mod sbk	fi s pl sp					
		18-50"	loamy sap	fr ss so sp					
2	15% L	0-4"	scl wk gr	fr sspr mp					PS .35
		4-18"	c mod sbk	fi s pl sp					
		18-43"	c sap cl wk sbk						
			fr ss so sp						
3	15% L	0-4"	scl wk sbk	fr sspr mp		100' well setback			PS .4
		4-24"	cl wk sbk	fr ss so sp					
		24-30"	loamy sap	fr sspr mp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	CONV SYSTEM	SAME
Site LTAR	.35	.4

OTHER FACTORS (.1946): 100' well setback
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. COOK
OTHER(S) PRESENT: DANIEL

COMMENTS: BLDR WANTS CHAMBERS/25% REDUCTION

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

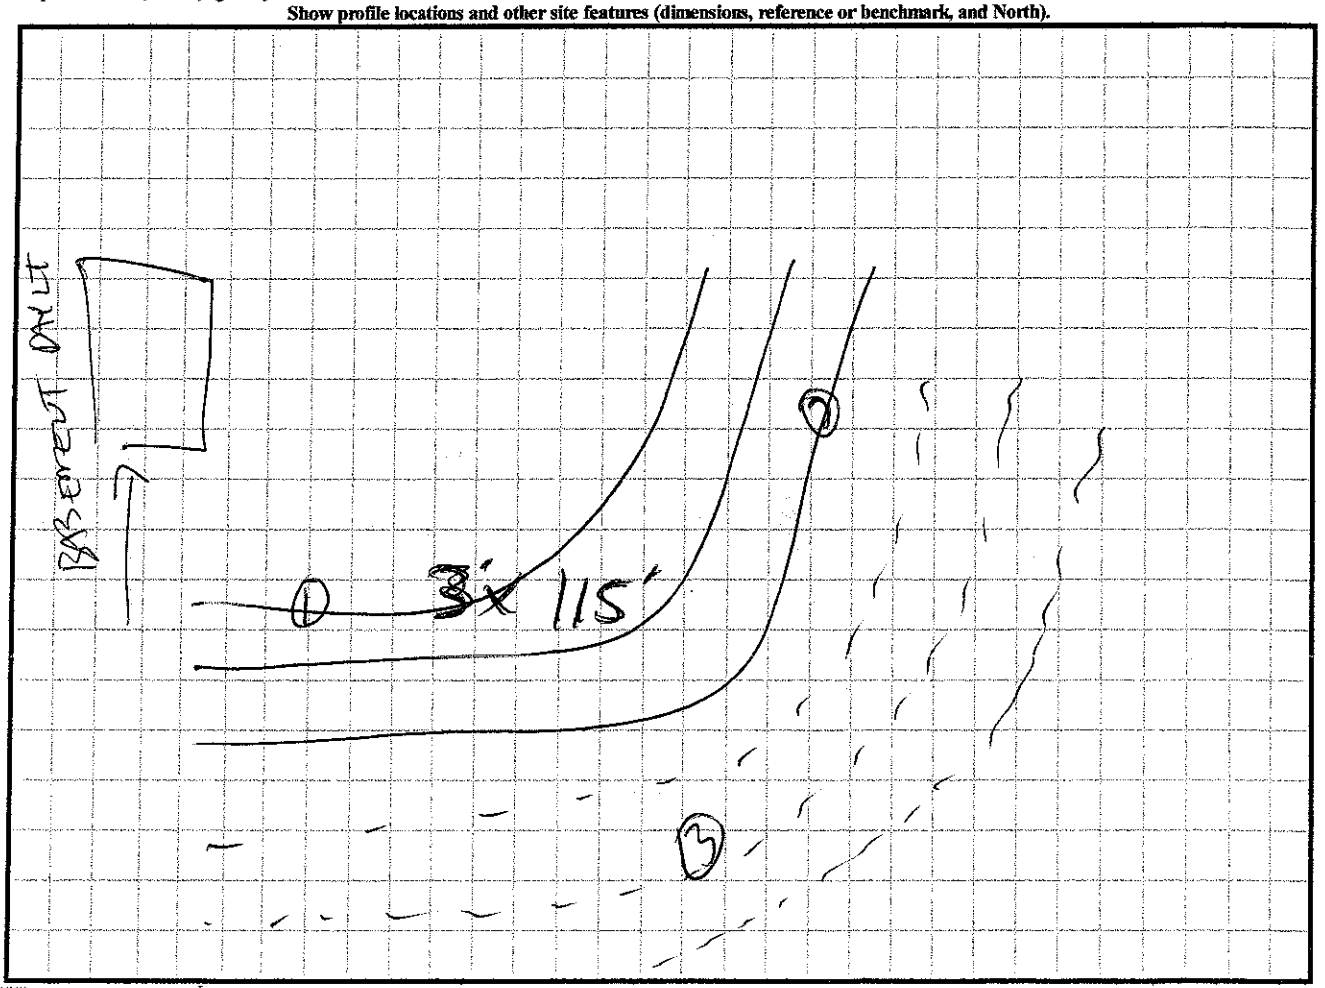

DENR (######)
Review (#####)