DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4753544383
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Juan Nunez
ADDRESS: 109 Wayne Dr, Statesville
PROPOSED FACILITY: SFR
PROPOSED DESIGN FLOW (.1949): 360gpd
LOCATION OF SITE: Corner of Wayne Dr. & Kim Dr.
WATER SUPPLY: • Private • (Public) • Well • Spring • Other
EVALUATION METHOD: • (Auger Boring) • Pit • Cut

APPLICATION DATE 4-8-11
DATE EVALUATED: 5-12-11
PROPERTY SIZE: ~190'x154'
PROPERTY RECORDED: Yes - 1971
TYPE OF WASTEWATER: • (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	3%	0-30	SBK C	friable, slightly					
		30-48	SBK CL	friable, slightly	NA	46"	NA	NA	-3
2	3%	0-30	SBK LFC	friable, slightly					
		30-48	SBK CL	friable, slightly	NA	NA	NA	NA	-3
3	3%	0-24	SBK L	friable, slightly					
		24-48	L SBK	FR SS NP					
4	3%	0-24	SBK L	friable, slightly					
		24-48	SBK CL	friable, slightly					-3

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	5	RS-4*
System Type(s)	PM PBBS	LP PBBS
Site LTAR	.3	.3

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): RS
EVALUATED BY: RC Thomson
OTHER(S) PRESENT: Juan Nunez

COMMENTS: Lot recorded in 1971, Limited repair area available, Setback exemptions off front pl and encroachment to be utilized.

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

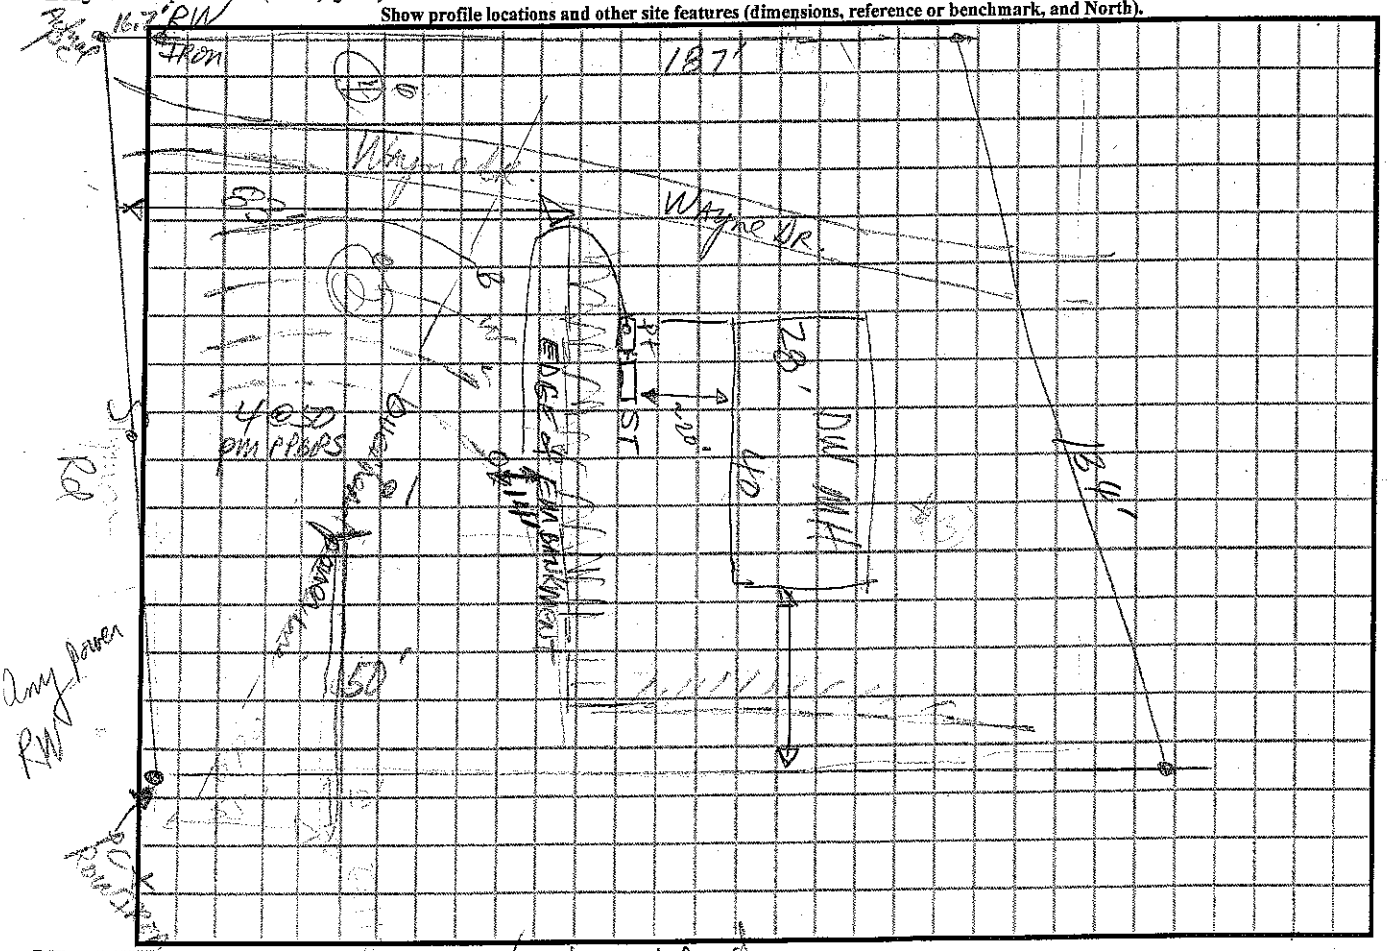

DENR (######)
Review (#####)

✓ 1971
✓ Note known perforated
✓ 5-19-11 Surveyed