DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of
PROPERTY ID #: 4783-73-9869
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: SHANNON FOX APPLICANT: SAME
ADDRESS: 211 SHILOH RD STVL 28677 APPLICATION DATE: 4-2-03 DATE EVALUATED: 7-3-03
PROPOSED FACILITY: 3BR S/W MH PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 1.62 ACRES
LOCATION OF SITE: 211 SHILOH ROAD, US 70 E, TR SHILOH, 0.5 on (L) PROPERTY RECORDED: ___
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	L 8%	0-4	SBK SC	FR SS/SP SOP	10YR 8/2	4			4
		4-8	SBK SC	FR SS/SP SOP					
		8-10	ABK C	FI S/VP EP	10YR 8/0				
2	H 10%	0-12	GR SL	VFR SS/SP SOP		4			4
		12+	ABK C	FI VS/VP EP					
3	H 10%	0-10	SBK SCL	VFR SS/SP SOP		4			4
		10+	ABK C	VFI S/VP EP	10YR 8/0				
4	N 6%	0-15	SBK SC	VFI SS/SP SOP		4			4
		15+	ABK C	VFI VS/VP EP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	4	4
System Type(s)	A	
Site LTAR		

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): 4
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: PATRICK MITCHELL, JM FOX

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

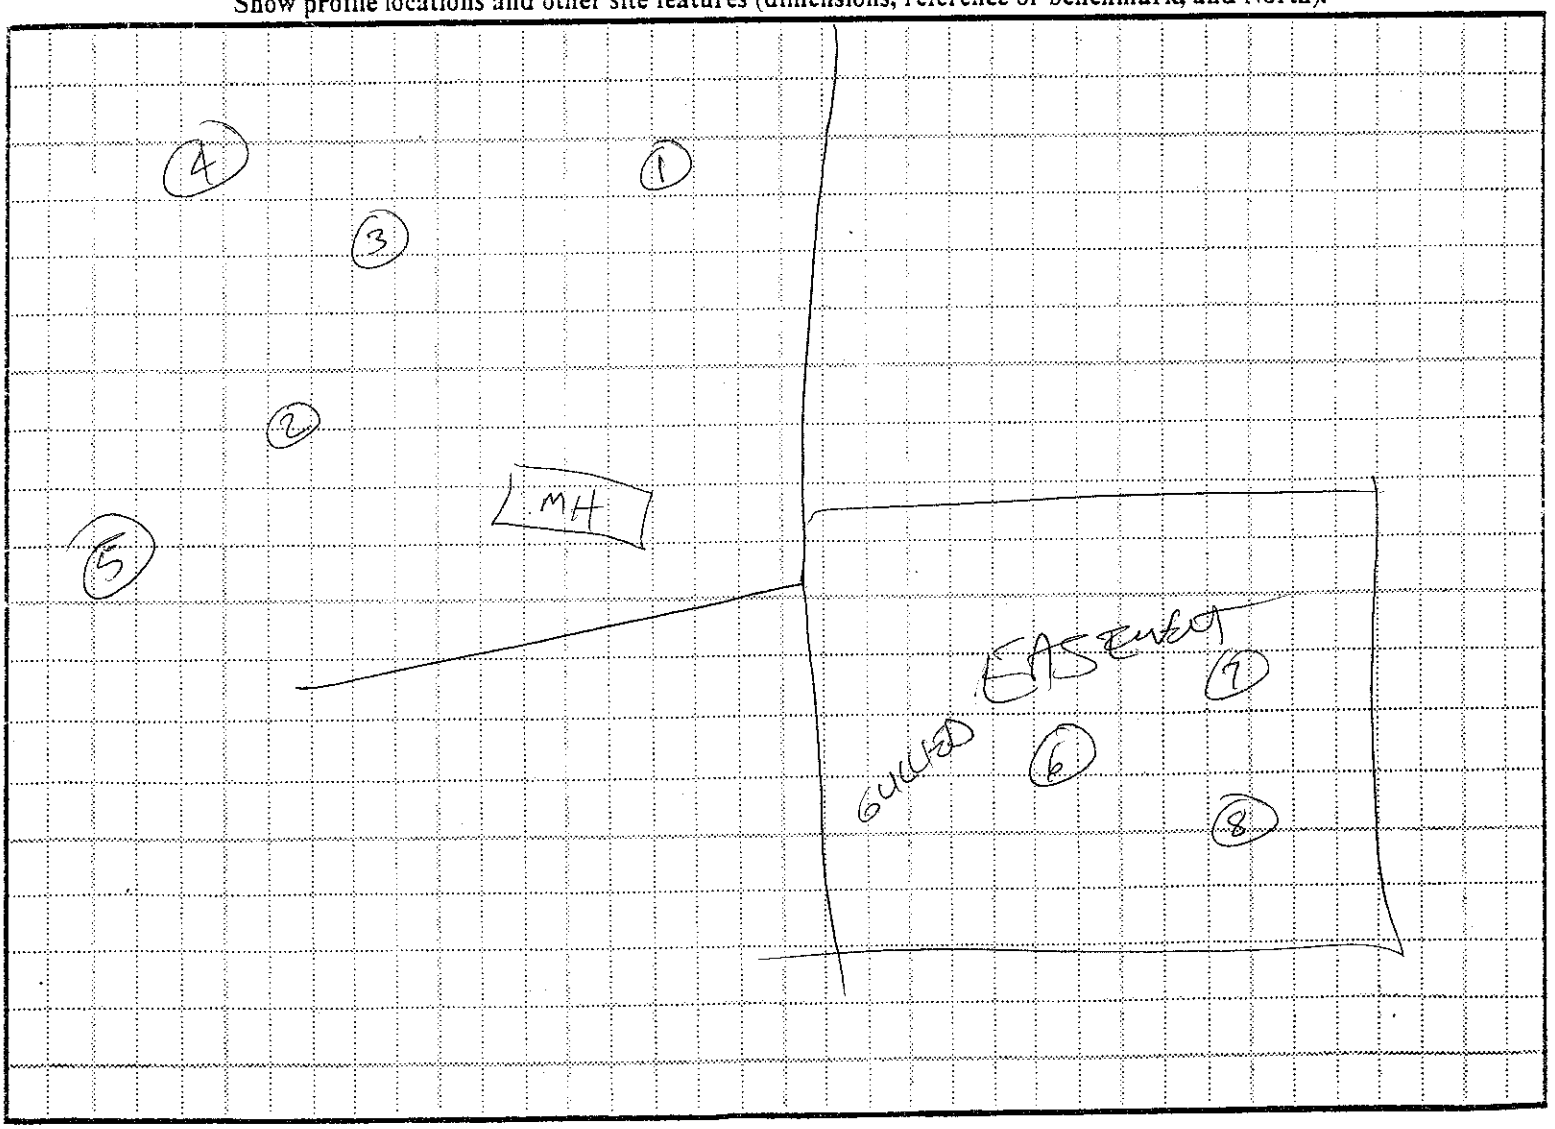

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of
PROPERTY ID #:
COUNTY: [redacted]

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

475373-9864

OWNER: SHANNON FOX APPLICANT: SAME
ADDRESS: 211 STRUTT RD, STVL 28607 APPLICATION DATE: 9-2-03 DATE EVALUATED: ___
PROPOSED FACILITY: 3BL SFW MH PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 1.62 ACRES
LOCATION OF SITE: US 70 E, TR STRUTT RD, 0.5 MI ON LEFT PROPERTY RECORDED: ___
WATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
5	L 8%	0-8	GR SC	VFR SS/SP		U			U
		8-16	ABK C	FR S/SP SS/P					
		16+	ABK C	VFI VS/VP SS/P					
6	EASEMENT L 20%	0-8	GR SC	VFR SS/P		PS @ 36"			PS 0.2
		8-24	ABK C	FR S/SP SS/P	10YR 8/2 @ 24"+				
		24-36	ABK C	FI S/P SS/P					
		36+	ABK C	VFI VS/VP EXP					
7	EASEMENT L 18%	0-10	GR SC	VFR SS/P		PS @ 38"			PS 0.2
		10-22	ABK C	FR S/SP SS/P	10YR 8/0 @ 22"+				
		22-38	ABK C	FI S/P SS/P					
		38+	ABK C	VFI VS/VP EXP					
8	EASEMENT 20%	0-8	GR SC	VFR SS/P		PS @ 38"			PS 0.2
		8-22	ABK C	FR S/SP SS/P	10YR 8/0 @ 22"+				
		22-38	ABK C	FI S/P SS/P					
		38+	ABK C	VFI VS/VP EXP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	IV SS/P VP
Site LTAR	0.2	0.1

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: PATRICK MITCHELL / TM FOX

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).