R

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of
PROPERTY ID #: 4955-84-5712
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Linda Buntier
ADDRESS: 336 Mocksville Hwy
PROPOSED FACILITY: 3BR Home
PROPOSED DESIGN FLOW (.1949): 360 gpd
LOCATION OF SITE: Mocksville Hwy 2nd House on RT past J.B.'s
WATER SUPPLY: • Private • Public • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • Pit • Cut
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

APPLICATION DATE 12/16/11
DATE EVALUATED:
PROPERTY SIZE: 20,000 Ft²
PROPERTY RECORDED:

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 2%	0-12	mixed F:	Fill	NA	48	NA	NA	PS 0.3
		12-20	gr/SL	vfr lsqf					
		20-48	SBK/C	fr-F: lsqf					
2	L 2%	0-8	mixed	Fill	NA	48	NA	NA	PS 0.3
		8-16	gr/L	vfr lsqf					
		16-48	SBK/C	fr-F: lsqf					
3	L 2%	0-11	gr/L	vfr lsqf	NA	48	NA	NA	PS 0.3
		11-40	SBK/C	fr-F: lsqf					
		40-48	mSBK/C/L	fr lsqf					
4	L 2%	0-12	gr/L	vfr lsqp	NA	48	NA	NA	PS 0.3
		12-41	SBK/C	fr-F: lsqp					
		41-48	mSBK/C/L	fr lsqp					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	Maximum feasible
System Type(s)	III	
Site LTAR	0.3	

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): PS

EVALUATED BY: TCH
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

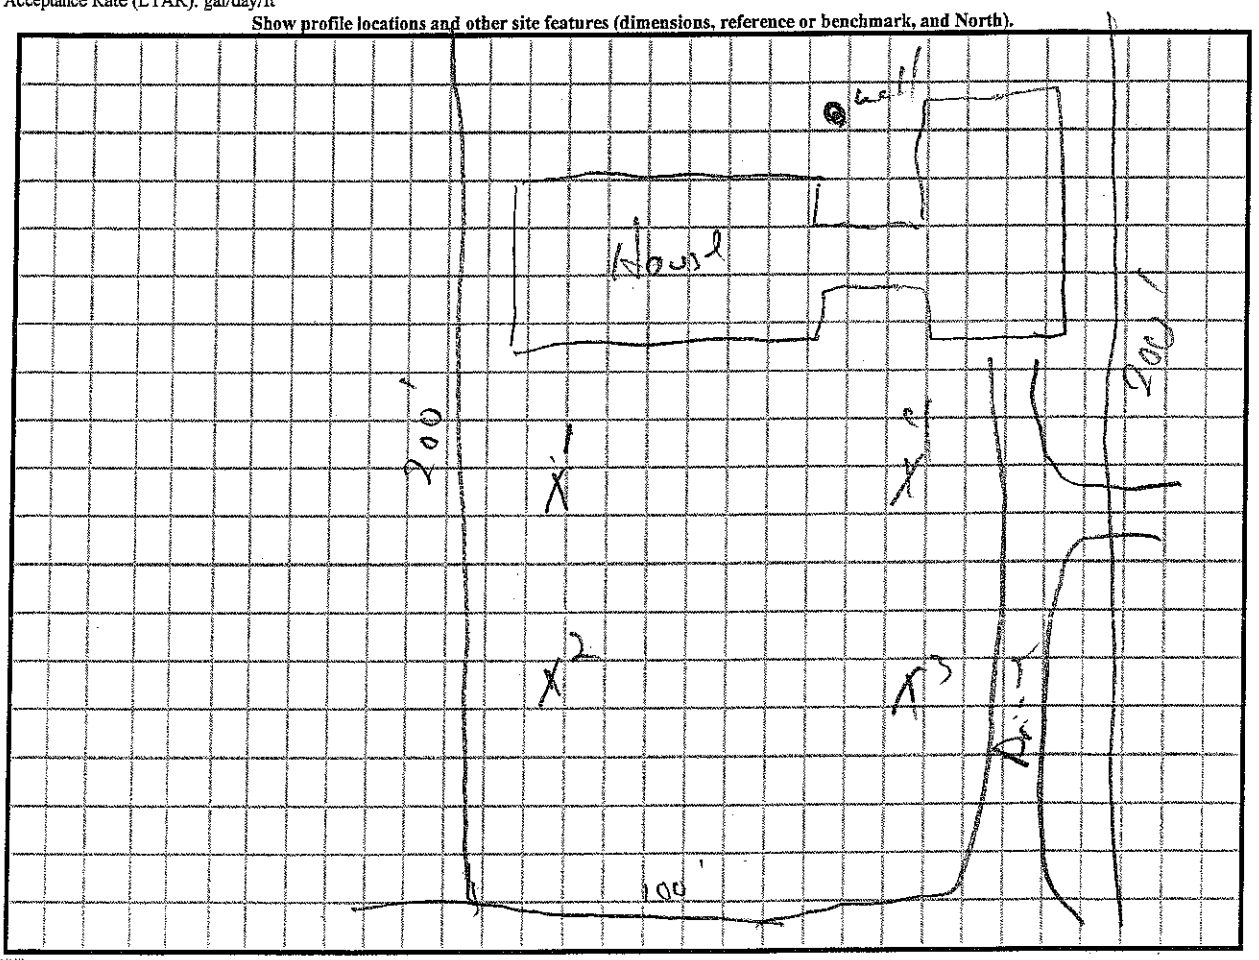

DENR (######)
Review (#####)