DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 9756466396
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Joseph Corentz
ADDRESS: 621 Jane Sowers Rd,
PROPOSED FACILITY: SFD
LOCATION OF SITE: 621 Jane Sowers Rd,
WATER SUPPLY: • Private • (Public) • Well • Spring • Other N/A
EVALUATION METHOD: (Auger Boring) • Pit • Cut

APPLICATION DATE: 6-12-15
DATE EVALUATED: 6-29-15
PROPOSED DESIGN FLOW (.1949): 360 gpd
PROPERTY SIZE: 0.86 acres
PROPERTY RECORDED: Yes
TYPE OF WASTEWATER: (Sewage) • Industrial Process • Mixed

PROFILE #	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) 1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) 1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS 1942 SOIL WETNESS/ COLOR	1943 SOIL DEPTH	1956 SAPRO CLASS	1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	4% slight HS	0-24	C ABK	Fr Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		24-48	BC Sap Incl WABK	Fr Mod SE					
2	4% slight HS	0-8	SCL SBK	Fr Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		8-26	C ABK	Fr Mod SE					
		26-48	BC Sap Incl WABK	Fr Mod SE					
3	6% slight HS	0-24	C ABK	Fr Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		24-48	BC Sap Incl WABK	Fr Mod SE					
			Lithacromic nodules present						
	3% slight HS	0-26	C ABK	Fr Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		26-48	BC mica/sap Incl ABK	Fr Mod SE					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
ailable Space (.1945)	PS	PS
tem Type(s)	III	III
LTAR	0.25	0.25

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Jack Henderson
OTHER(S) PRESENT: N/A

MENTS: Trench Bottoms @ 36"

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)			MOIST	WET
R (Ridge)		SCL (Sandy Clay Loam)				
S (Shoulder Slope)		SiL (Silt Loam)			VFR (Very Friable)	NS (Non-sticky)
T (Terrace)					FR (Friable)	SS (Slightly Sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FI (Firm)	S (Sticky)
		SiC (Silty Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		C (Clay)			EFI (Extremely Firm)	NP (Non-plastic)
		O (Organic)	None	None		SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

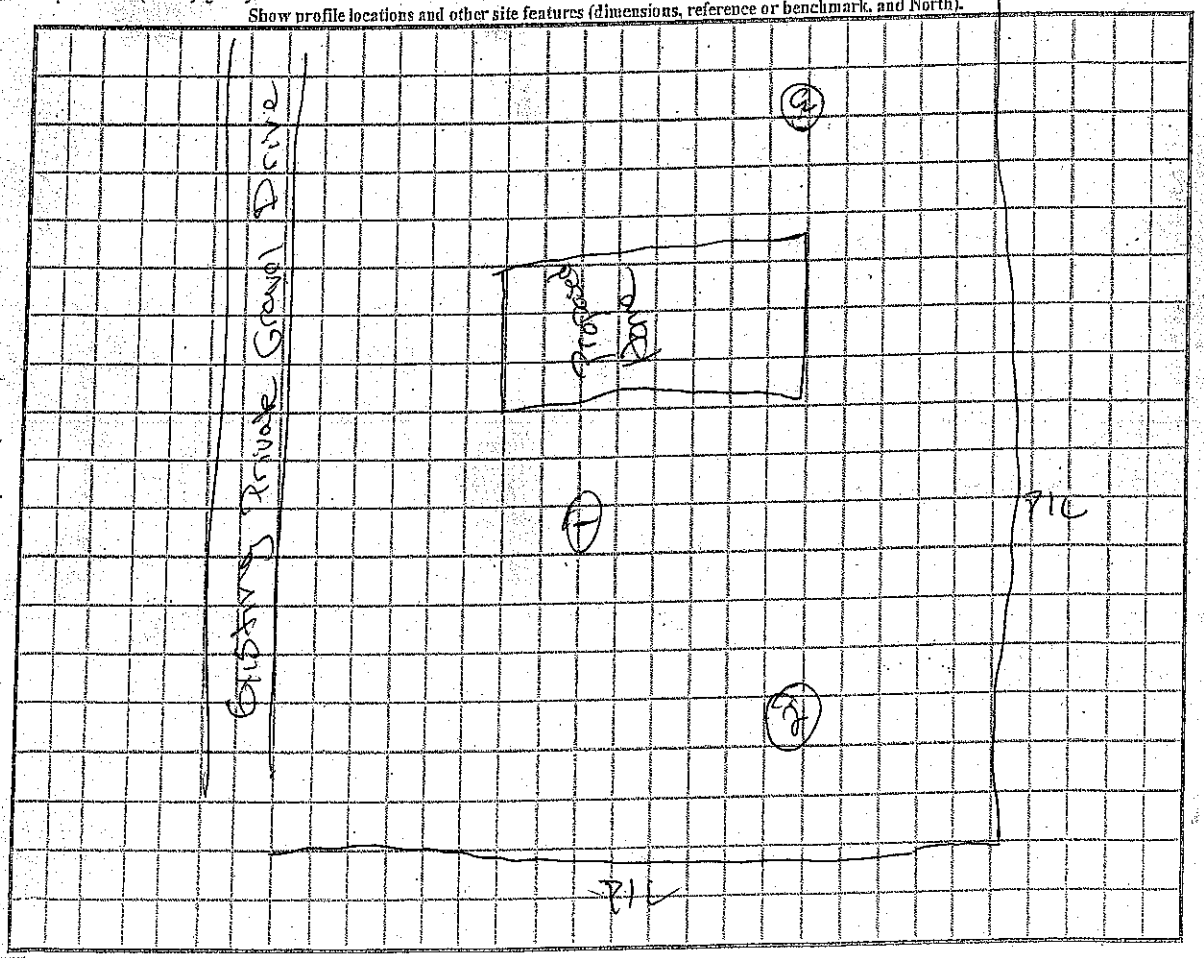

DENR (######)
Review (######)