158502
4759-42-0212

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of ___
PROPERTY ID #: 10
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Ralph Church
ADDRESS: 567 Fairmont Church RD
PROPOSED FACILITY: Mobile Home PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: Exit 55 (E) Tomlinson Mill (R) Fairmont
WATER SUPPLY: • Private • Public • Well • Spring • Other ___
EVALUATION METHOD: • Auger Boring • Pit • Cut

APPLICATION DATE 9-1-09
DATE EVALUATED: 11-16-09
PROPERTY SIZE: 1.508
PROPERTY RECORDED: ___
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	3%	0-9	SCWSBK	SSSPSOP fr					
		9-17	CWSBK	SSSPSOP f					
		17-48	CWSBK	SSSPSOP f	mica	inclusions			
						48			.25
					NA		NA	NA	
2	3%	0-8	SCWSBK	SSSPSOP f					
		8-48	CWSBK	SSSPSOP f	mica	inclusions			
									.25
					NA	48	NA	NA	
3	6%	0-8	SCWSBK	SSSPSOP fr					
		8-36	CWSBK	SSSPSOP fr	mica	inclusions			
		36-48	CWSBK	SSSPSOP f					
									.25
					NA	48	NA	NA	
4	6%	0-11	SCWSBK	SSSPSOP f					
		11-48	CWSBK	SSSPSOP f					
					NA	48	NA	NA	.25

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	1460 / 360	1460 - 360
System Type(s)	25% L	50% Loop
Site LTAR	.25	.25

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): DS
EVALUATED BY: Doug Cook
OTHER(S) PRESENT: NA

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

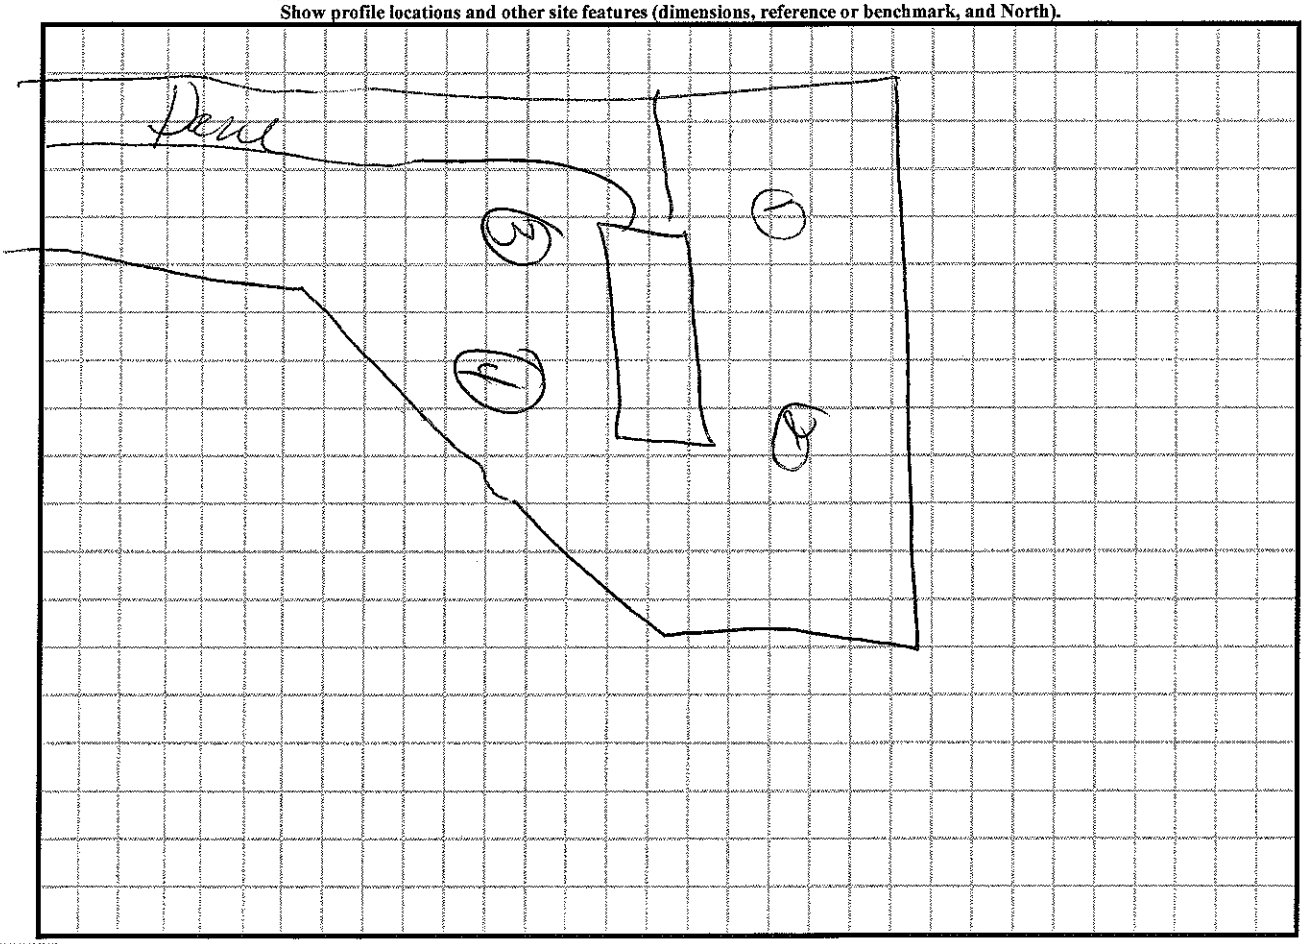

DENR (######)

Review (#####)