DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

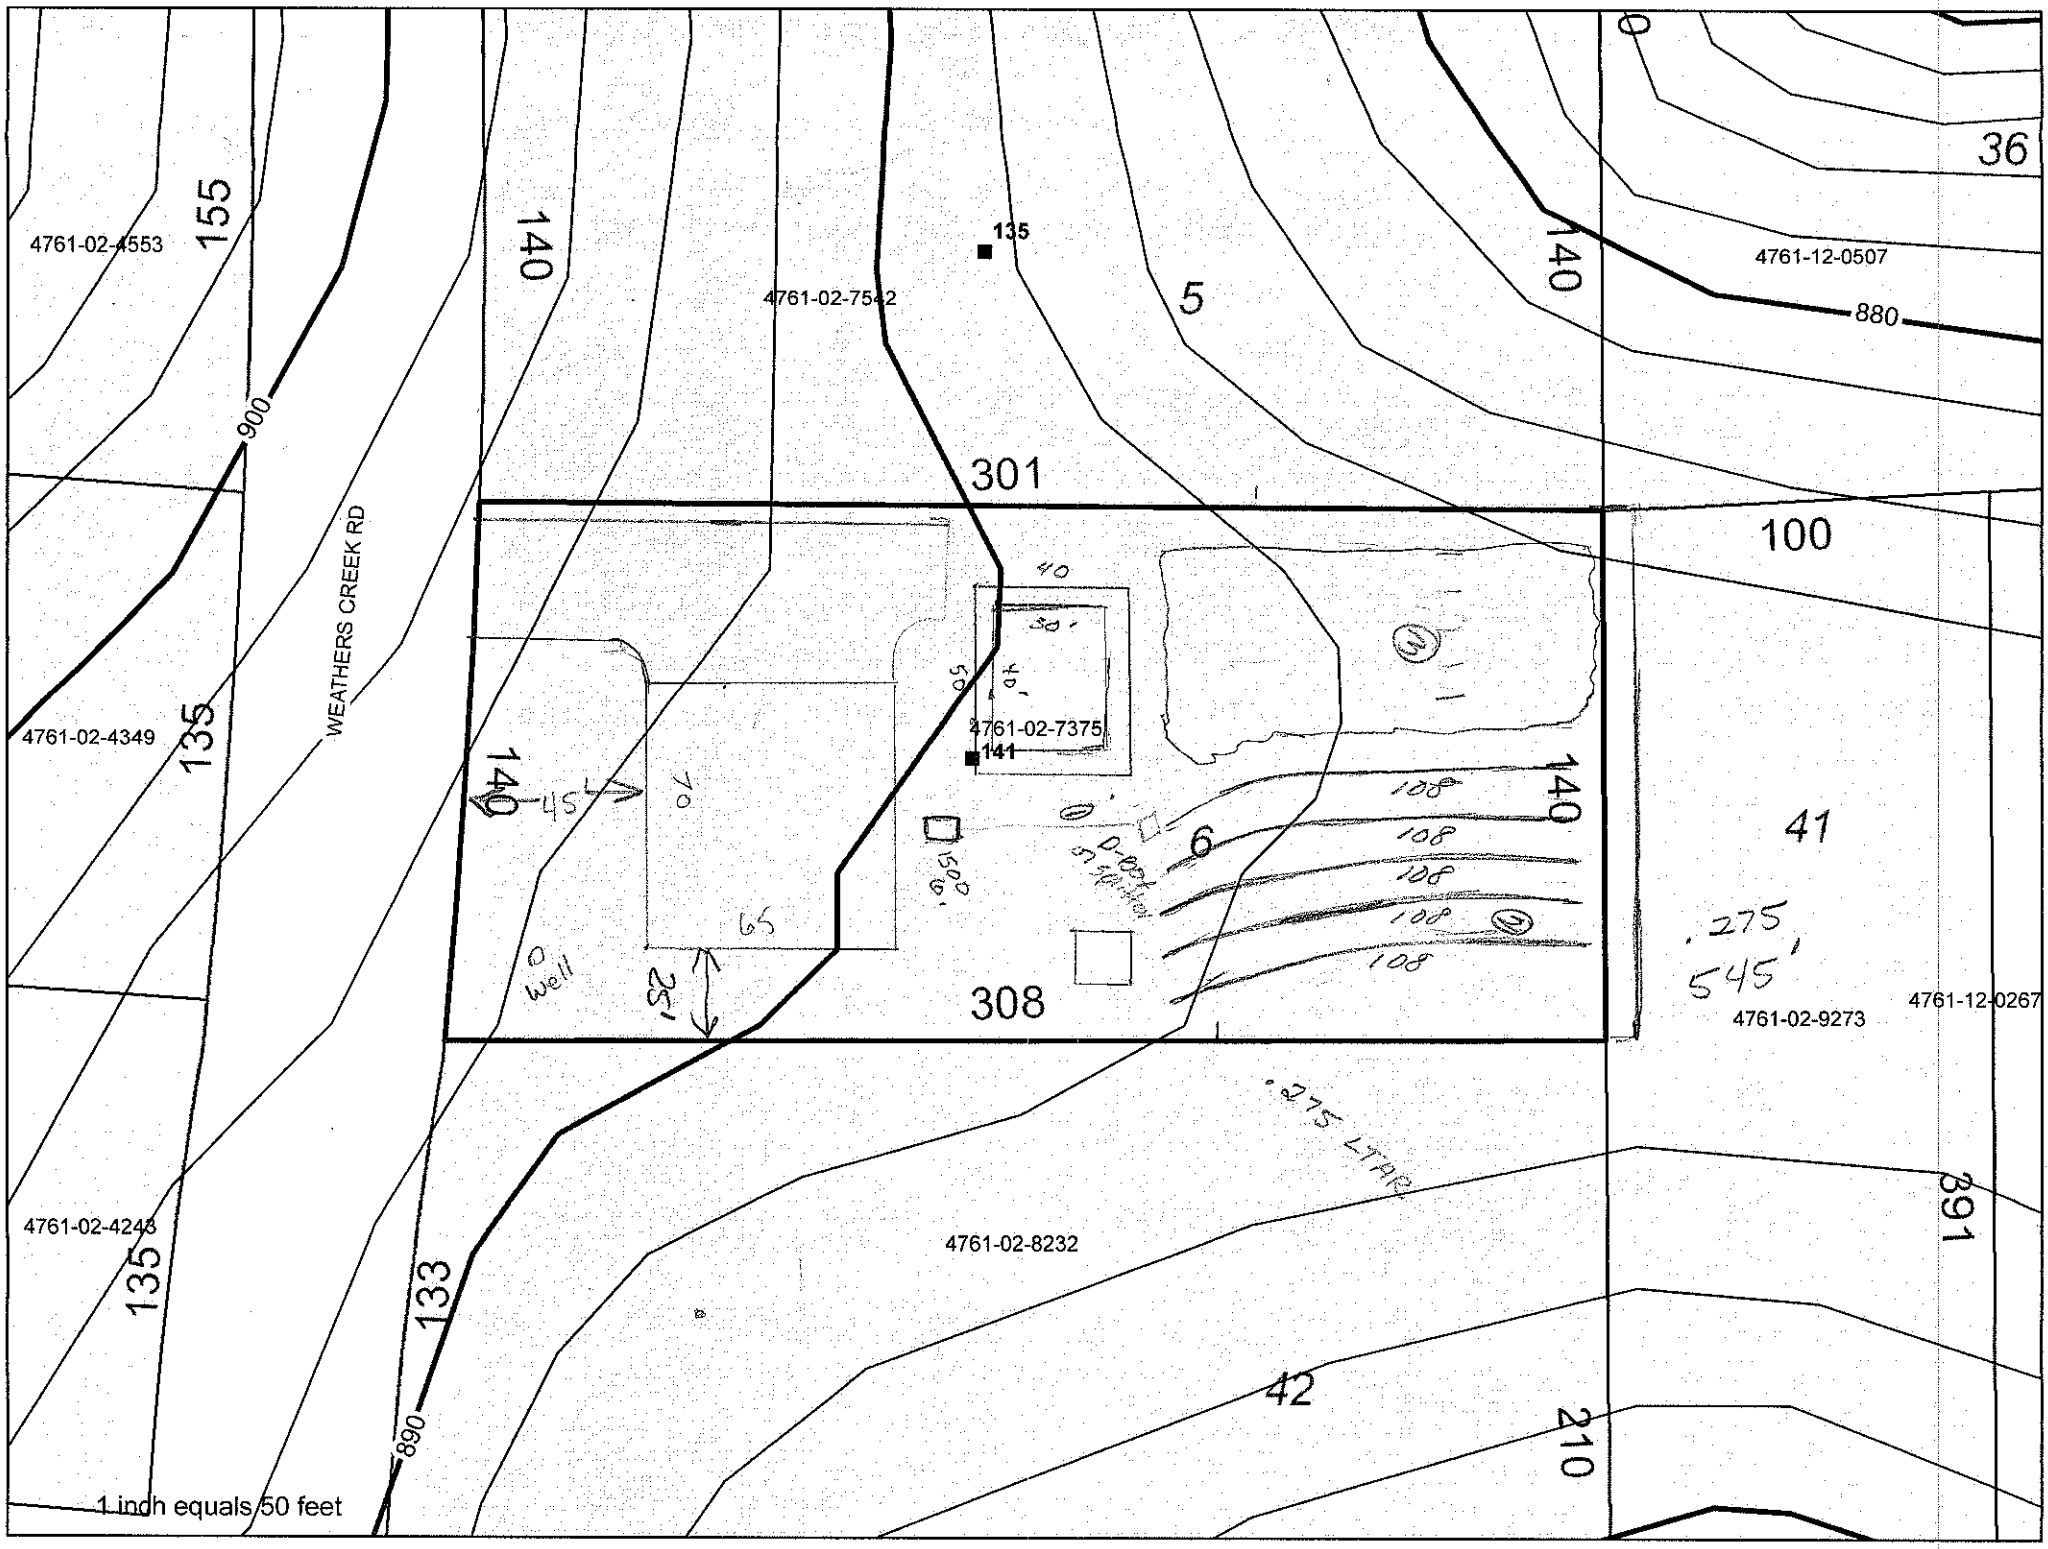
OWNER: Robert Kolessar
ADDRESS: _____
APPLICATION DATE _____
DATE EVALUATED: 1-16-07
PROPOSED FACILITY: Residential PROPOSED DESIGN FLOW (.1949): 600
LOCATION OF SITE: on Ridge Rd
PROPERTY SIZE: _____
PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	2/0	0-4	lsbk L		few inch, yel/br	48			.275
		4-30	lsbk/sbkc	fr ss/sp se					
		30-48	cl sap						
			few inc. sap		lighter chroma				
2		0-10	lsbks l			48			.275
		10-36	lsbk c	fr ss/sp se	few inc. dwn br.				
		36-48	cl + inc						
			sap						
3		0-10	lsbk sl			48			.275
		10-36	lsbk/sbkc	fr ss/sp se					
		36-48	cl + inc. few sap						
			few fi from 30-48						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	yes	yes
System Type(s)	25%	25%
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: A Melville
OTHER(S) PRESENT: _____

COMMENTS: _____


4761-02-4553
155
140
4761-02-7542
135
5
140
880
36
4761-12-0507
900
301
100
WEATHERS CREEK RD
4761-02-4349
135
40
50'
40'
95'
4761-02-7375
141
140
45'
70'
140
108
108
108
108
108
6
41
1500 G.
D-box
Septic
65'
Well
25'
.275
545'
308
4761-02-9273
4761-12-0267
.275 LTAP
4761-02-4243
135
4761-02-8232
391
133
890
42
210
1 inch equals 50 feet