DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #:
COUNTY: IREDELL
SHEET 1 of 2
4761-98-9902

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: TERESA NEWTON APPLICANT: SAME
ADDRESS: 525 SHEPHERD RD, TROUTMAN APPLICATION DATE: ' DATE EVALUATED: 09/23/02
PROPOSED FACILITY: 4 BR MOD. PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: 1.09 ACRES
LOCATION OF SITE: #9 Hemlock Rd. PROPERTY RECORDED:
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	H 4%	0-10	W, F, G/sbk, CL	Fr, SS, NP	SAP MIX ≤ 50% @ 44"				PS 0.25
		10-48	W, F, Abk, C	Fr, S, P, sexP					
2	H 4%	0-11	W, F, G/sbk, CL	Fr, SS, NP					PS 0.25
		11-30	W, F/m, sbk/Abk, SC	Fr, SS, SP, SexP					
		30-48	W, Abk, C	Fr/Fi, S, P, SexP					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	PS	PS
Site LTAR	0.25	0.25

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Patrick Mitchell
OTHER(S) PRESENT: Steve Hedrick

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	SI (Silt) SICL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SLC (Silt Loam Clay)	0.6 - 0.3	0.3 - 0.15		
					MOIST	**WET**
	IV	SC (Sandy Clay) SIC (Silty Clay)	0.4 - 0.1	0.2 - 0.05	VFR (Very Friable) FR (Friable) FI (Firm) VFI (Very Firm v. Very Sticky) EFI (Extremely Firm)	NS (Non-sticky) SS (Slightly Sticky) S (Sticky) VS (Very Sticky) NP (Non-plastic) SP (Slightly Plastic) P (Plastic) VP (Very Plastic)
		O (Organic)	None			


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

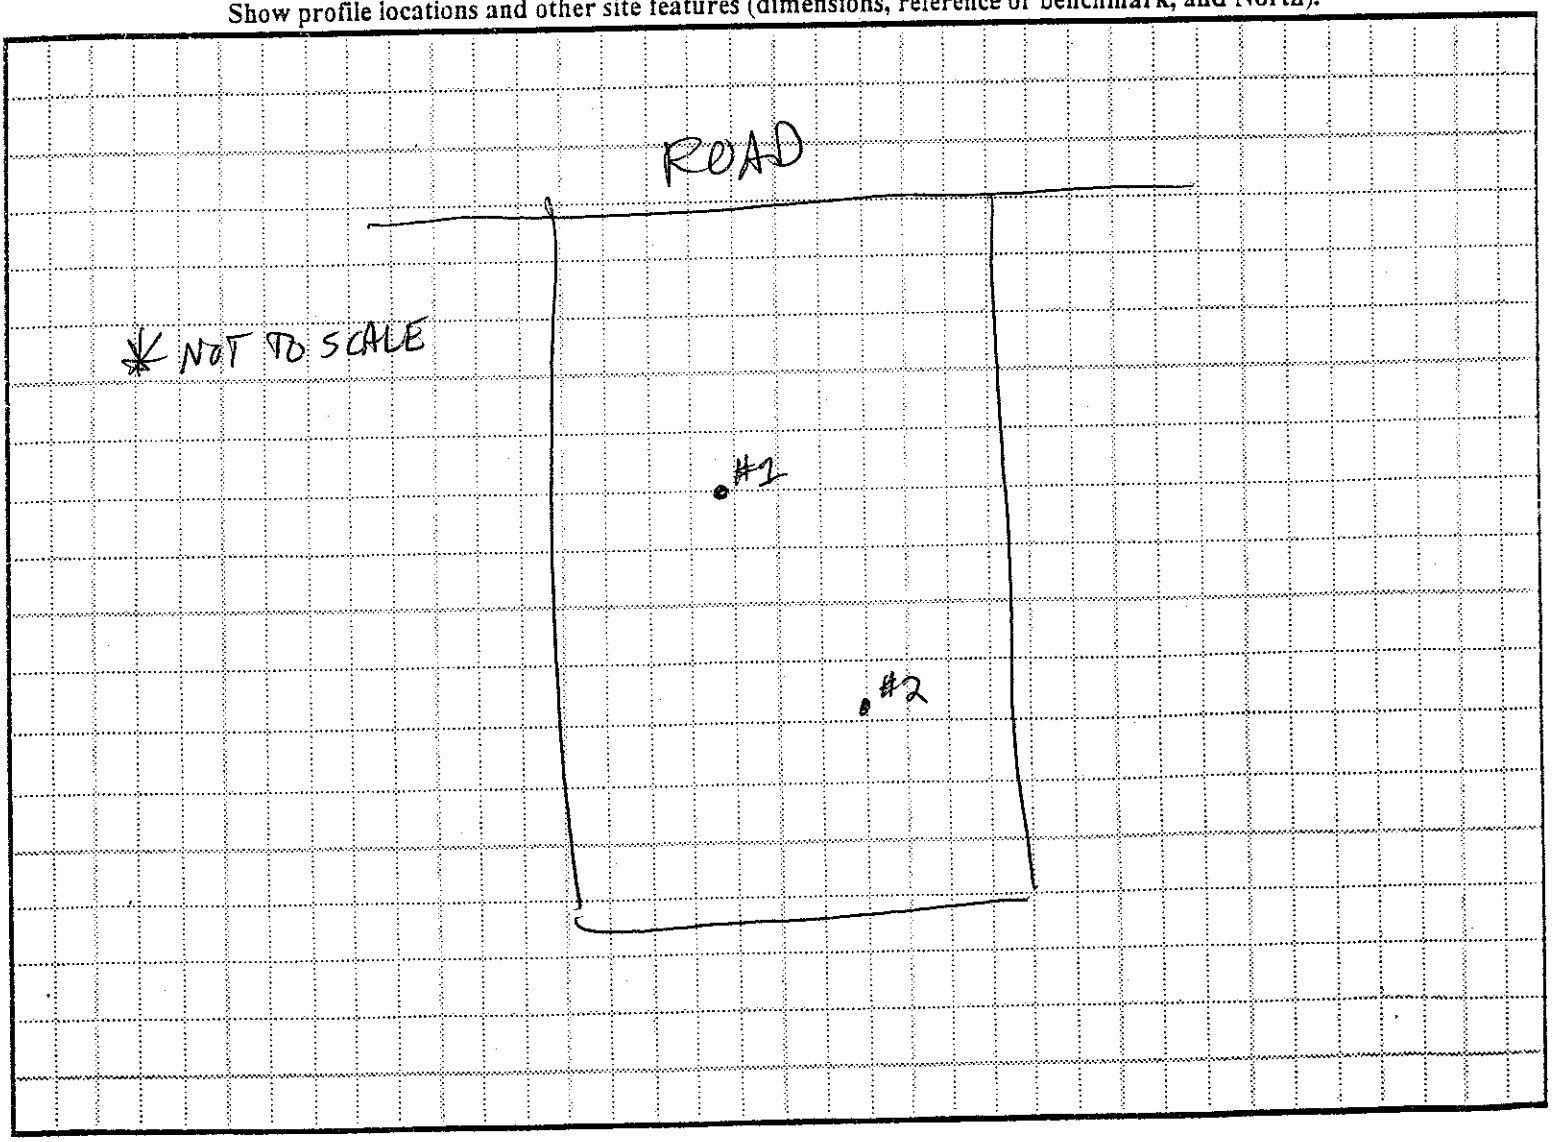

DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of
PROPERTY ID #: 4761-98-9902
COUNTY: IREDELL
SHEET 2 OF 2

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: TERESA NEWTON APPLICANT: SAME
ADDRESS: 525 SHEPHERD ROAD, TROUTMAN APPLICATION DATE: 10-2-02 DATE EVALUATED: 2-11-03
PROPOSED FACILITY: 4 BR MOD PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: 1.109 ACRES
LOCATION OF SITE: WILLIAM C. SWART LOT #9 PROPERTY RECORDED: ___
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☑ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFIL CLASS & LTAR
1	AUGER L 7%	0-24	SBK C	FR NS/SP SEXP					—
		24-48	SBK SAPROLITE → SL						
				NEED PIT EVALUATION					
2	PIT L 7%	0-23	SFSBK C	FR NS/SP SEXP			PS (.1956(6))		PS 0.4
		23-52	WFSBK SL SAPROLITE	VFR NS/NP SEXP					
3	PIT L 9%	0-3	SBK CL	VFR SEXP			PS (.1956(6))		PS 0.3
		3-23	MFABK C	FR SS/P SEXP					
		23-48	WFABK L	VFR SS/SP SEXP					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.3	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: TERESA NEWTON, JASON TRIVETTE — SEE ATTACHED JOSH WAUGH

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR	LPP .1957 LTAR	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SI (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SICL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SLC (Silt Loam Clay)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SIC (Silty Clay)			FI (Firm)	S (Sticky)
					VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

