DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4766-76-2980
COUNTY: _____

# SOIL/SITE EVALUATION
## *for* ON-SITE WASTEWATER SYSTEM

OWNER: Gary Linda Nichols — APPLICATION DATE 10/18/10
ADDRESS: 130 X 175 Township NC — DATE EVALUATED: 11/22/10
PROPOSED FACILITY: 3bR House — PROPOSED DESIGN FLOW (.1949): 360gpd — PROPERTY SIZE: 2.78 ac.
LOCATION OF SITE: Off Monkeyville Rd. TR Chestnut Grove Tl Rockford Area — PROPERTY RECORDED: _____
WATER SUPPLY: • Private • Public • Well • Spring • Other _____
EVALUATION METHOD: • Auger Boring • Pit • Cut — TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

| PROFILE # | .1940 LANDSCAPE POSITION/ SLOPE % | HORIZON DEPTH (IN.) | SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE | SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY | OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR | .1943 SOIL DEPTH | .1956 SAPRO CLASS | .1944 RESTR HORIZ | PROFILE CLASS & LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | SH 5% | 0-10 | gr/l | vfr/ss,sp | >48" | >48" | NA | NA | PS 0.3 |
| | | 10-48+ | ssk/c | fr-f:/ss,sp | | | | | |
| 2 | H 5% | 0-8 | gr/l | vfr/ss,sp | >48" | >48" | NA | NA | PS 0.3 |
| | | 8-48+ | ssk/c | f:/ss,sp | | | | | |
| 3 | L 5% | 0-9 | gr/sl | vfr/ss,sp | >48" | >48" | NA | NA | PS 0.3 |
| | | 9-48+ | ssk/c | fr-f:/ss,sp | | | | | |
| 4 | L 5% | 0-8 | gr/l | vfr/ss,sp | >48" | >48" | NA | NA | PS 0.3 |
| | | 8-48+ | ssk/c | fr/ss,sp | | | | | |

| DESCRIPTION | INITIAL SYSTEM | REPAIR SYSTEM |
|---|---|---|
| Available Space (.1945) | PS | PS |
| System Type(s) | III | III |
| Site LTAR | 0.3 | 0.3 |

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: TLH
OTHER(S) PRESENT: _____

COMMENTS: _____

# LEGEND

***use the following standard abbreviations***

| LANDSCAPE POSITION | GROUP | SOIL TEXTURE | CONVENTIONAL .1955 LTAR* | LPP .1957 LTAR* | MINERALOGY/ CONSISTENCE | STRUCTURE |
|---|---|---|---|---|---|---|
| CC (Concave Slope) | I | S (Sand) | 1.2 - 0.8 | 0.6 - 0.4 | NEXP (Non-expansive) | G (Single Grain) |
| CV (Convex Slope) | | LS (Loamy Sand) | | | SEXP (Slightly Expansive) | M (Massive) |
| D (Drainage Way) | | | | | EXP (Expansive) | CR (Crumb) |
| DS (Debris Slump) | II | SL (Sandy Loam) | 0.8 - 0.6 | 0.4 - 0.3 | | GR (Granular) |
| FP (Flood Plain) | | L (Loam) | | | | SBK (Subangular Blocky) |
| FS (Foot Slope) | | | | | | ABK (Angular Blocky) |
| H (Head Slope) | III | Si (Silt) | 0.6 - 0.3 | 0.3 - 0.15 | | PL (Platy) |
| L (Linear Slope) | | SiCL (Silty Clay Loam) | | | | PR (Prismatic) |
| N (Nose Slope) | | CL (Clay Loam) | | | | |
| R (Ridge) | | SCL (Sandy Clay Loam) | | | **MOIST** | **WET** |
| S (Shoulder Slope) | | SiL (Silt Loam) | | | | |
| T (Terrace) | | | | | VFR (Very Friable) | NS (Non-sticky) |
| | IV | SC (Sandy Clay) | 0.4 - 0.1 | 0.2 - 0.05 | FR (Friable) | SS (Slightly Sticky) |
| | | SiC (Silty Clay) | | | FI (Firm) | S (Sticky) |
| | | C (Clay) | | | VFI (Very Firm v. Very Sticky) | VS (Very Sticky) |
| | | O (Organic) | None | None | EFI (Extremely Firm) | NP (Non-plastic) |
| | | | | | | SP (Slightly Plastic) |
| | | | | | | P (Plastic) |
| | | | | | | VP (Very Plastic) |

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


***NOTES***

| | |
|---|---|
| *HORIZON DEPTH* | In inches below natural soil surface |
| *DEPTH OF FILL* | In inches from land surface |
| *RESTRICTIVE HORIZON* | Thickness and depth from land surface |
| *SAPROLITE* | S(suitable) or U(unsuitable) |
| *SOIL WETNESS* | Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation |
| *CLASSIFICATION* | S (Suitable), PS (Provisionally Suitable), or U (Unsuitable) |

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft$^2$

**Show profile locations and other site features (dimensions, reference or benchmark, and North).**

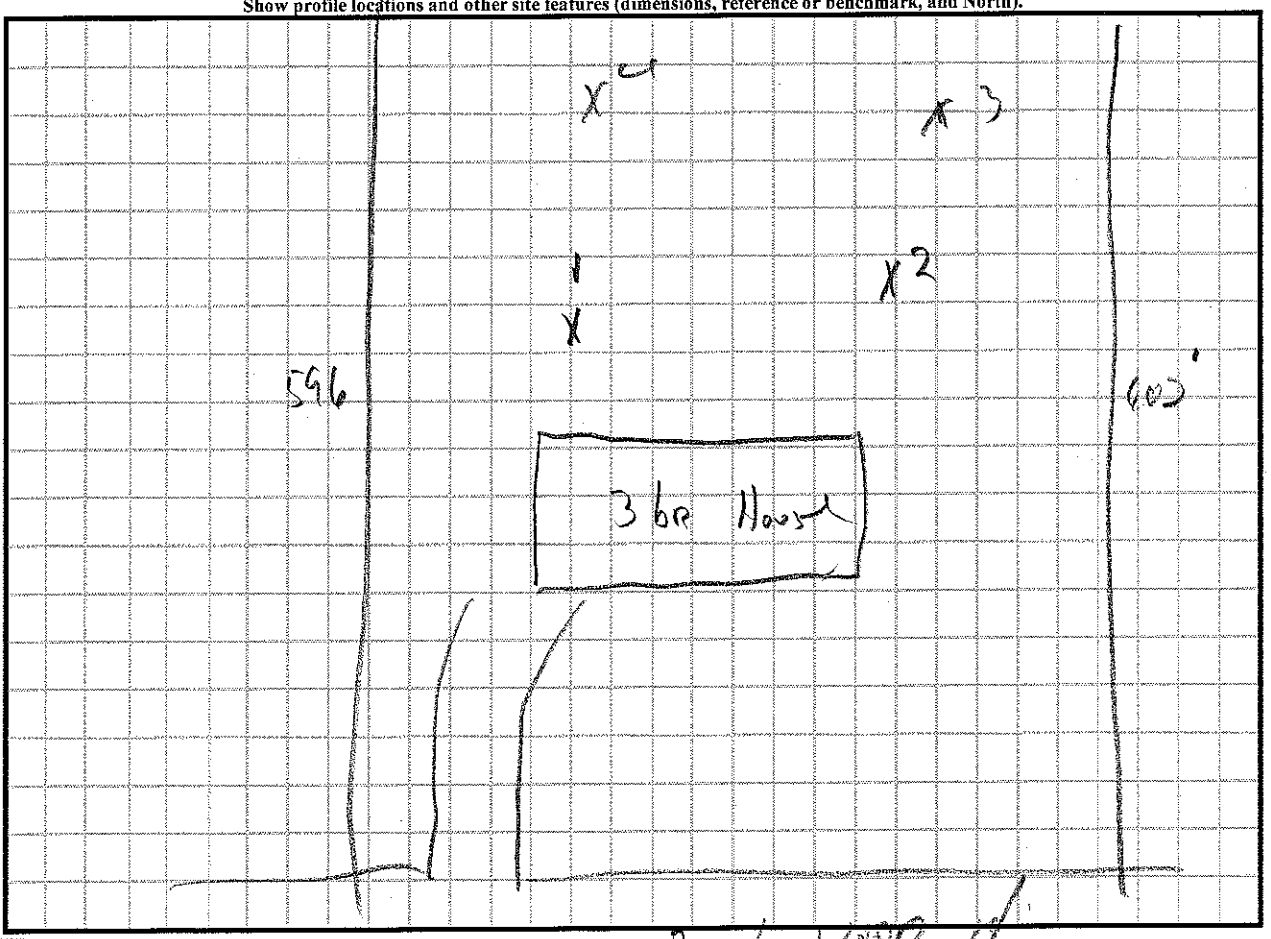


DENR (######)
Review (######)

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4766-37-3132
COUNTY: IREDELL

# SOIL/SITE EVALUATION
## *for* ON-SITE WASTEWATER SYSTEM

OWNER: KAREN T. CLARK
ADDRESS: 232 DAVIE AVE, STATESVILLE, NC 28677
PROPOSED FACILITY: 3 BR HOUSE
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: CHESTNUT ACRES # 4
APPLICATION DATE: 5-14-05
DATE EVALUATED: 5-20-05
PROPERTY SIZE: 2.788 ACRES
PROPERTY RECORDED: _____
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

| PROFILE # | .1940 LANDSCAPE POSITION/ SLOPE % | HORIZON DEPTH (IN.) | SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE | SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY | OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR | .1943 SOIL DEPTH | .1956 SAPRO CLASS | .1944 RESTR HORIZ | PROFILE CLASS & LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | SLIGHT H 5% | 0-10 | GR SC | VFR SSPP | | | | | PS 0.3 |
| | | 10-48 | SBK C | FR SSPP | | | | | |
| 2 | SLIGHT H 5% | 0-10 | GR SC | VFR SSPP | | | | | PS 0.3 |
| | | 10-48 | SBK C | FR SSPP | | | | | |
| 3 | L 5% | 0-8 | GR SC | VFR SSPP | | | | | PS 0.3 |
| | | 8-48 | SBK C | FR SSPP | | | | | |
| 4 | | | | | | | | | |

| DESCRIPTION | INITIAL SYSTEM | REPAIR SYSTEM |
|---|---|---|
| Available Space (.1945) | PS | PS |
| System Type(s) | II | II |
| Site LTAR | 0.3 | 0.3 |

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: KAREN T. CLARK

COMMENTS: _____

# LEGEND

***use the following standard abbreviations***

| LANDSCAPE POSITION | GROUP | SOIL TEXTURE | CONVENTIONAL .1955 LTAR* | LPP .1957 LTAR* | MINERALOGY/ CONSISTENCE | STRUCTURE |
|---|---|---|---|---|---|---|
| CC (Concave Slope)<br>CV (Convex Slope)<br>D (Drainage Way)<br>DS (Debris Slump)<br>FP (Flood Plain)<br>FS (Foot Slope)<br>H (Head Slope)<br>L (Linear Slope)<br>N (Nose Slope)<br>R (Ridge)<br>S (Shoulder Slope)<br>T (Terrace) | I | S (Sand)<br>LS (Loamy Sand) | 1.2 - 0.8 | 0.6 - 0.4 | NEXP (Non-expansive)<br>SEXP (Slightly Expansive)<br>EXP (Expansive) | G (Single Grain)<br>M (Massive)<br>CR (Crumb)<br>GR (Granular)<br>SBK (Subangular Blocky)<br>ABK (Angular Blocky)<br>PL (Platy)<br>PR (Prismatic) |
| | II | SL (Sandy Loam)<br>L (Loam) | 0.8 - 0.6 | 0.4 - 0.3 | | |
| | III | Si (Silt)<br>SiCL (Silty Clay Loam)<br>CL (Clay Loam)<br>SCL (Sandy Clay Loam)<br>SiL (Silt Loam) | 0.6 - 0.3 | 0.3 - 0.15 | | |
| | IV | SC (Sandy Clay)<br>SiC (Silty Clay)<br>C (Clay) | 0.4 - 0.1 | 0.2 - 0.05 | | |
| | | O (Organic) | None | None | | |

| MOIST | WET |
|---|---|
| VFR (Very Friable) | NS (Non-sticky) |
| FR (Friable) | SS (Slightly Sticky) |
| FI (Firm) | S (Sticky) |
| VFI (Very Firm v. Very Sticky) | VS (Very Sticky) |
| EFI (Extremely Firm) | NP (Non-plastic)<br>SP (Slightly Plastic)<br>P (Plastic)<br>VP (Very Plastic) |

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


***NOTES***

| | |
|---|---|
| *HORIZON DEPTH* | In inches below natural soil surface |
| *DEPTH OF FILL* | In inches from land surface |
| *RESTRICTIVE HORIZON* | Thickness and depth from land surface |
| *SAPROLITE* | S(suitable) or U(unsuitable) |
| *SOIL WETNESS* | Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation |
| *CLASSIFICATION* | S (Suitable), PS (Provisionally Suitable), or U (Unsuitable) |

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft$^2$

**Show profile locations and other site features (dimensions, reference or benchmark, and North).**

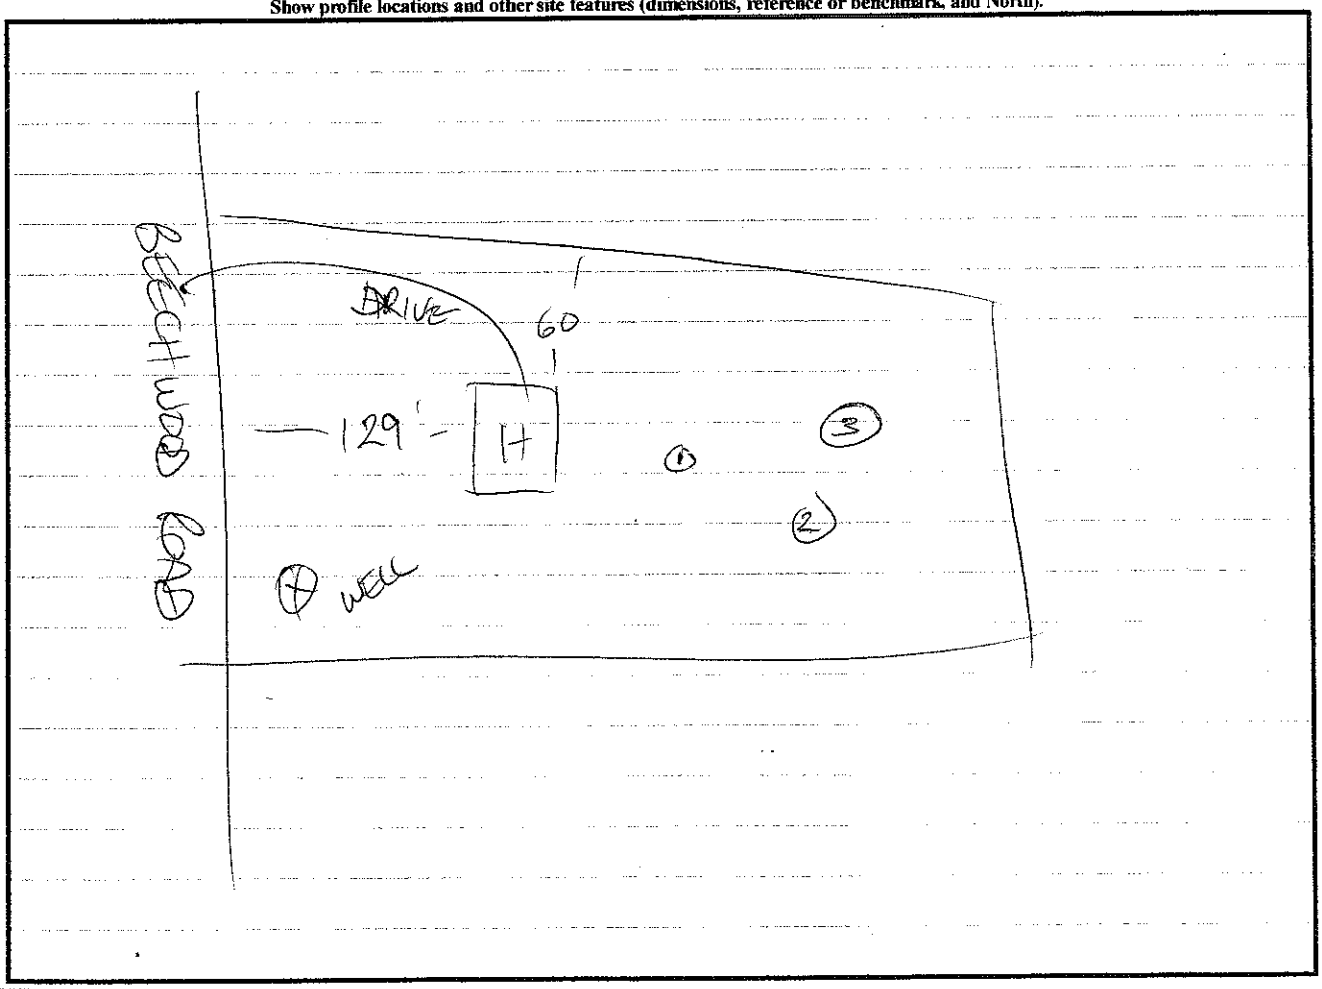


DENR (######)
Review (#####)