DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4766 732196
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: K A WATT CONSTRUCTION, INC
ADDRESS: 334 SEVEN SPRINGS LOOP
PROPOSED FACILITY: 3BR (H) PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: SEVEN SPRINGS LOT 71
WATER SUPPLY: • Private ✓ Public • Well • Spring • Other
EVALUATION METHOD: ✓ Auger Boring • Pit • Cut TYPE OF WASTEWATER: ✓ Sewage • Industrial Process • Mixed

APPLICATION DATE 1/31/12
DATE EVALUATED: 2/14/12
PROPERTY SIZE: 0.78 ACRES
PROPERTY RECORDED: YES

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	SLIGHT N	0 - 8	WFSBK MICACEOUS CL	VFR SS/SP SCAP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		8 - 29	SBK C	FR SS/SP SCAP					
		29 - 48	WFSBK SAP INCR CL	VFR SCAP					
2	SLIGHT N	0 - 10	WFSBK MICACEOUS CL	VFR SCAP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		10 - 32	MMSBK C	FR SS/SP SCAP					
		32 - 48	WFSBK SAP INCR CL	VFR SCAP					
3	SLIGHT N	0 - 10	WFSBK MICACEOUS CL	VFR SCAP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		10 - 30	MMSBK C	FR SCAP					
		30 - 48	WFSBK SAP INCR CL	VFR SCAP					
4	SLIGHT N	0 - 7	WFSBK CL	VFR SCAP	N/A	PS TO 48"	N/A	N/A	PS 0.3
		7 - 37	MMSBK C	FR SCAP					
		37 - 48	WMSBK SAP INCR CL	VFR SCAP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III(b)
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HENDRICK
OTHER(S) PRESENT: KENNY WATT

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05		
		O (Organic)	None	None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

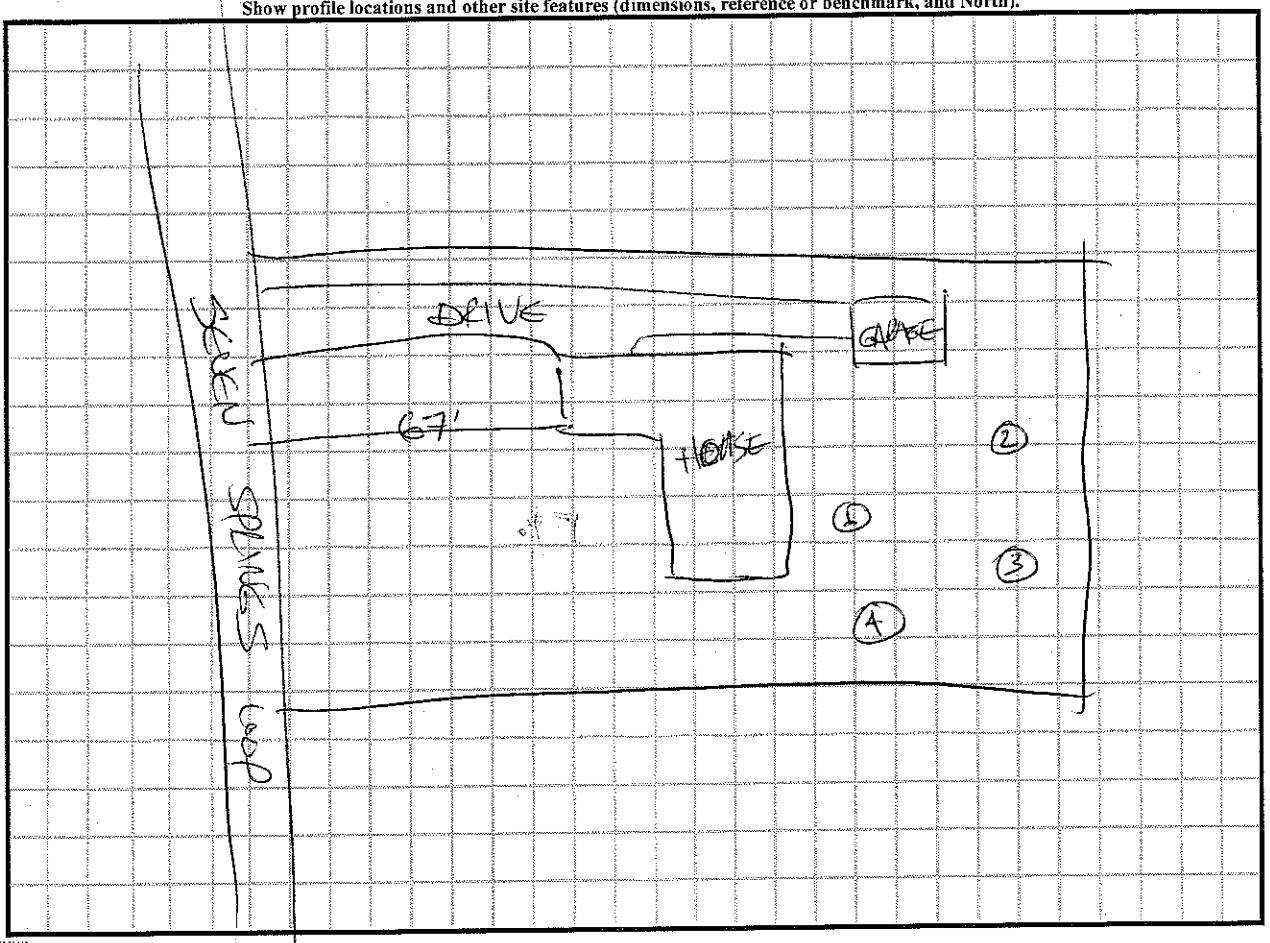

DENR (######)

Review (#####)