DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 3
PROPERTY ID #:
COUNTY:

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: MIKE ENDY
ADDRESS:
PROPOSED FACILITY:
PROPOSED DESIGN FLOW (.1949):
LOCATION OF SITE: LOT #7 NEW SALEM EST. S/D
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

APPLICATION DATE
DATE EVALUATED:
PROPERTY SIZE:
PROPERTY RECORDED:

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	H ~7%	0-6	W,M,Gr,SCL		N/A	23"			US (Need Perc)
		6-23	Mo,M,sbk,C	Fr,SS,SP,SEXP					
		23+	ROCK						
2	H	0-8	SCL		N/A	15"			US (Need Perc)
		8-15	C						
		15+	ROCK						
3	H	0-7	SCL		N/A	20"			US (Need Perc)
		7-20	C						
		20-33	SAP MIX						
Perc 4		0-4	WF,Gr,SL	VFr,NP,NSP	N/A	30"	S (L)	>53"	PS 0.25
		4-18	Mo W,M,sbk,C	Fr,SP,SEXP					
		18-33	C w/ SAP	DUCTILE.					
		33-53	SAP + C MIX (≈50% SAP)		(W,M,Sbk)				

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	~	~
System Type(s)		
Site LTAR	0.25	0.25

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: P. Mitchell
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay) O (Organic)	0.4 - 0.1 None	0.2 - 0.05 None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

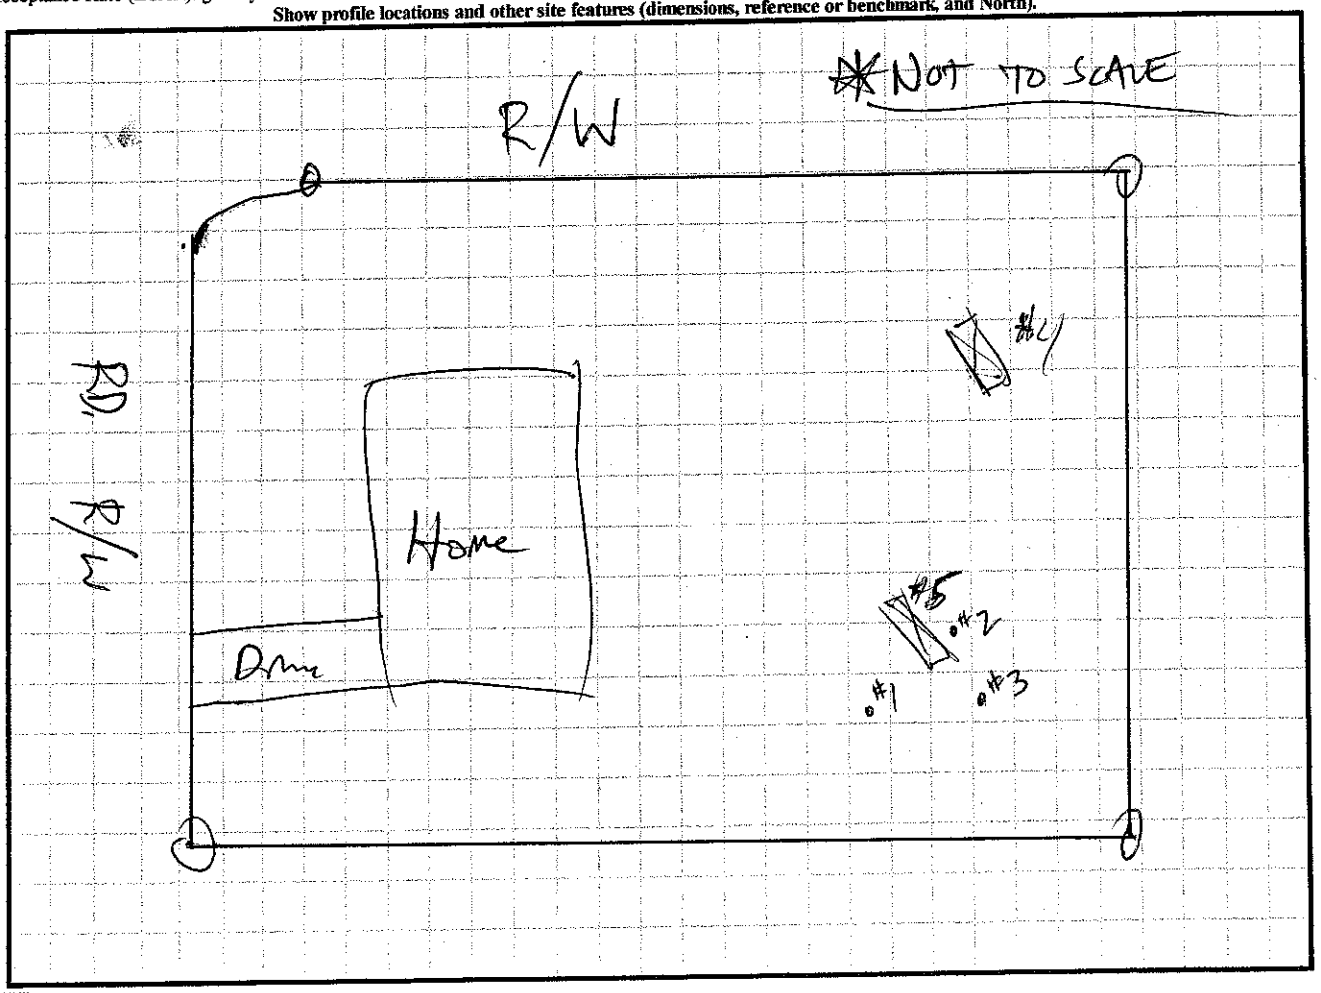

DENR (######)
Review (#####)

SOIL/SITE EVALUATION

(Continuation Sheet)

ARTMENT OF ENVIRONMENT AND NATURAL RESOURCES

DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

SHEET: 3 of 3

PROPERTY ID #:

COUNTY: Iredell

PROFILE #	.1940 LSCP POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
5 (P1)		0-4	1, F, Gr, SL	VFr, NP, MExP	N/A	54+	N/A	>54+	PS 0.275
		4-28	2/1, M, sbk, C	Fr, SP, SExP					
		28-49	1, M, sbk, C w/SAP INCLUS.						
		49-54	1, M, sbk, C + SAP	MOD (<50% SAP)					
6									
7									
8									
9									

COMMENTS: