DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4776-74-1942
COUNTY: IREDELL

# SOIL/SITE EVALUATION
## *for* ON-SITE WASTEWATER SYSTEM

OWNER: JOHN MOOREFIELD
ADDRESS: 1516 MOCKSVILLE HWY, STVL, 28625
PROPOSED FACILITY: 3 BR HOUSE
PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: US 64 E, TL SWANN RD, TR FIFTH CREEK RD, 1ST ON RIGHT
APPLICATION DATE: 9-29-09
DATE EVALUATED: 11-2-09
PROPERTY SIZE: 0.968 ACRE
PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

| PROFILE # | .1940 LANDSCAPE POSITION/ SLOPE % | HORIZON DEPTH (IN.) | SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE | SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY | OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR | .1943 SOIL DEPTH | .1956 SAPRO CLASS | .1944 RESTR HORIZ | PROFILE CLASS & LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | L 6% | 0-6 | GR SL | VFR SS/P | | | | | PS 0.25 |
| | | 6-48 | ABK C | FR S/P SS/P | | | | | |
| 2 | SLIGHT H 6% | 0-4 | GR SL | VFR SS/P | | | | | PS 0.25 |
| | | 4-48 | ABK C | FR S/P SS/P | | | | | |
| 3 | L 8% | 0-6 | GR SL | VFR SS/P | | | | | PS 0.25 |
| | | 6-48 | ABK C | FR S/P SS/P | | | | | |
| 4 | | | | | | | | | |

| DESCRIPTION | INITIAL SYSTEM | REPAIR SYSTEM |
|---|---|---|
| Available Space (.1945) | S | PS |
| System Type(s) | II | IV |
| Site LTAR | 0.25 | 0.25 |

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: JOHN MOOREFIELD

COMMENTS: _____

# LEGEND

***use the following standard abbreviations***

| LANDSCAPE POSITION | GROUP | SOIL TEXTURE | CONVENTIONAL .1955 LTAR* | LPP .1957 LTAR* | MINERALOGY/ CONSISTENCE | STRUCTURE |
|---|---|---|---|---|---|---|
| CC (Concave Slope)<br>CV (Convex Slope)<br>D (Drainage Way)<br>DS (Debris Slump)<br>FP (Flood Plain)<br>FS (Foot Slope)<br>H (Head Slope)<br>L (Linear Slope)<br>N (Nose Slope)<br>R (Ridge)<br>S (Shoulder Slope)<br>T (Terrace) | I | S (Sand)<br>LS (Loamy Sand) | 1.2 - 0.8 | 0.6 - 0.4 | NEXP (Non-expansive)<br>SEXP (Slightly Expansive)<br>EXP (Expansive) | G (Single Grain)<br>M (Massive)<br>CR (Crumb)<br>GR (Granular)<br>SBK (Subangular Blocky)<br>ABK (Angular Blocky)<br>PL (Platy)<br>PR (Prismatic) |
| | II | SL (Sandy Loam)<br>L (Loam) | 0.8 - 0.6 | 0.4 - 0.3 | | |
| | III | Si (Silt)<br>SiCL (Silty Clay Loam)<br>CL (Clay Loam)<br>SCL (Sandy Clay Loam)<br>SiL (Silt Loam) | 0.6 - 0.3 | 0.3 - 0.15 | | |
| | IV | SC (Sandy Clay)<br>SiC (Silty Clay)<br>C (Clay) | 0.4 - 0.1 | 0.2 - 0.05 | | |
| | | O (Organic) | None | None | | |

| MOIST | WET |
|---|---|
| VFR (Very Friable) | NS (Non-sticky) |
| FR (Friable) | SS (Slightly Sticky) |
| FI (Firm) | S (Sticky) |
| VFI (Very Firm v. Very Sticky) | VS (Very Sticky) |
| EFI (Extremely Firm) | NP (Non-plastic) |
| | SP (Slightly Plastic) |
| | P (Plastic) |
| | VP (Very Plastic) |

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


***NOTES***

| | |
|---|---|
| *HORIZON DEPTH* | In inches below natural soil surface |
| *DEPTH OF FILL* | In inches from land surface |
| *RESTRICTIVE HORIZON* | Thickness and depth from land surface |
| *SAPROLITE* | S(suitable) or U(unsuitable) |
| *SOIL WETNESS* | Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation |
| *CLASSIFICATION* | S (Suitable), PS (Provisionally Suitable), or U (Unsuitable) |

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft$^2$

**Show profile locations and other site features (dimensions, reference or benchmark, and North).**

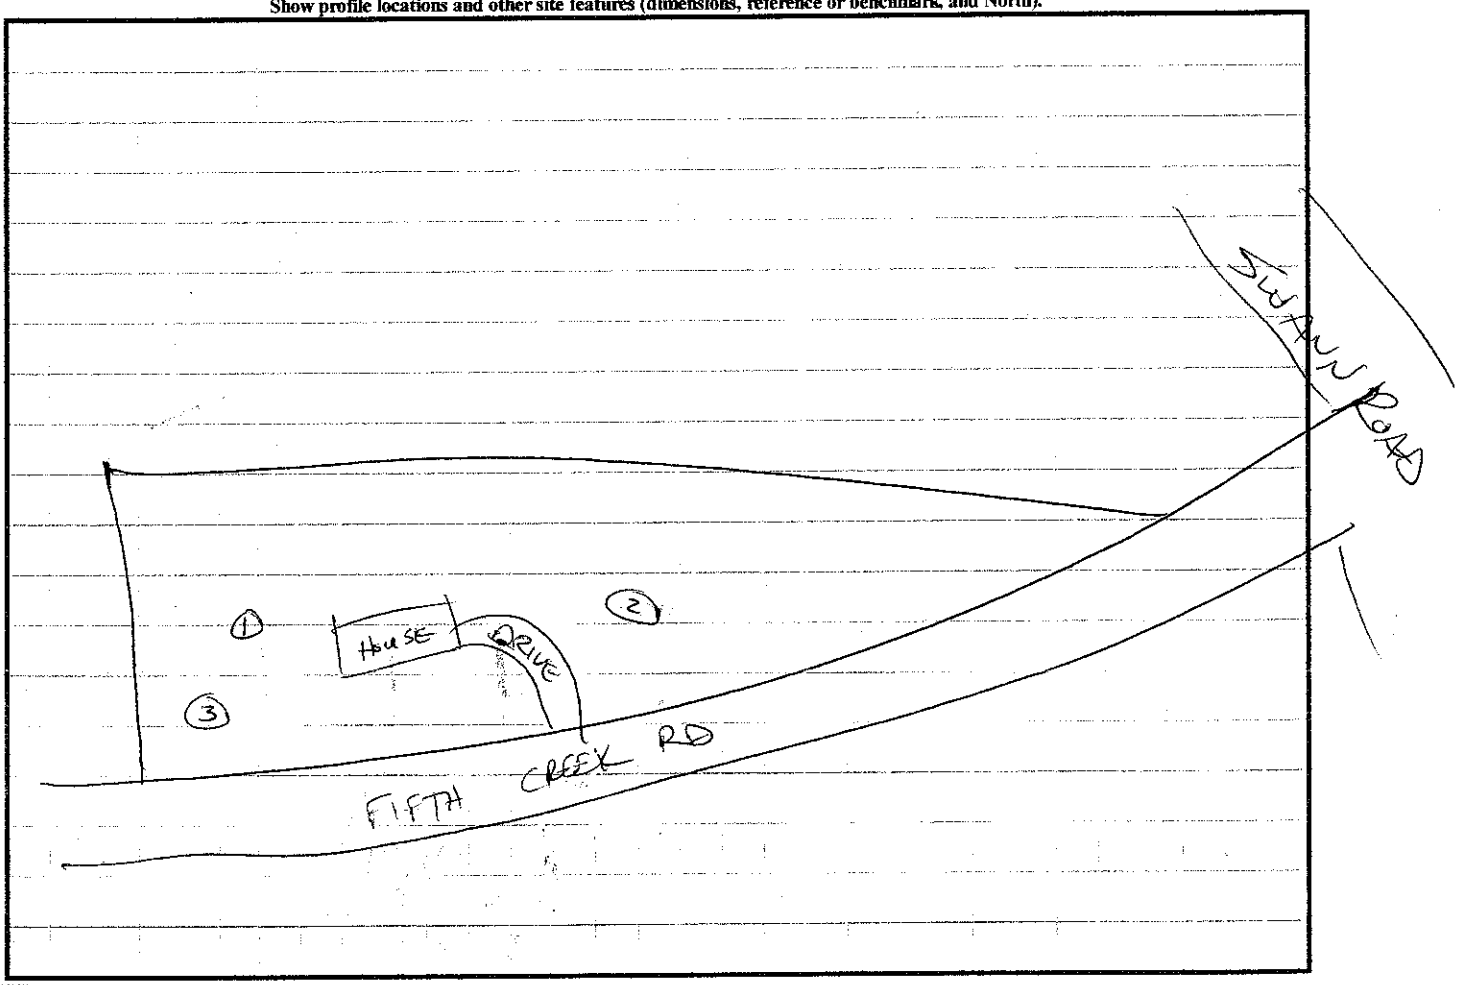


DENR (######)
Review (#####)