DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 477681834
COUNTY: Escambia

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Steve Hunt
ADDRESS: PO Box 64 Steinhatchee, FL 32359
PROPOSED FACILITY: 3BR Dwelling Unit PROPOSED DESIGN FLOW (.1949): 360 gpd
LOCATION OF SITE: 125 Cactus Ln. Lot 12
WATER SUPPLY: • Private • (Public) • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • (Pit) • Cut

APPLICATION DATE 4-13-12
DATE EVALUATED: 4-30-12
PROPERTY SIZE: 0.49
PROPERTY RECORDED: Yes

TYPE OF WASTEWATER: (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	Slight NS 9%	0-7	SC SS	Fr SBK M	+48"	+48"	+48"	+48"	.3 PS
		7-49	C SS/SP	Fr ABK M					
2	Slight NS 9%	0-7	SL SS	Fr SBK M	+48"	+48"	+48"	+48"	.25 PS
		7-36	C SS/SP micaceous	Fr ABK M					
		36-48"	BC CL SS micaceous	Fr ABK M					
3	Slight NS 7%	0-11	SCL SS	FR SBK M	+48"	+48"	+48"	+48"	.25 PS
		11-42	C SS/SP micaceous	Fr ABK M					
		42-48	BC (CL)	Fr WABK M					
4	Slight NS 7%	0-8	SCL	Fr SBK M	+48"	+48"	+48"	+49"	.25 PS
		8-36	C	Fr ABK M					
		36-48	BC CL micaceous	Fr ABK M					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	25% III	50% IV
Site LTAR	.25	.25

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: ~~BH~~ Trench Bottom @ 24" on low side (Initial)
OTHER(S) PRESENT: ~~BH~~

COMMENTS: Repair TB max 36"

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

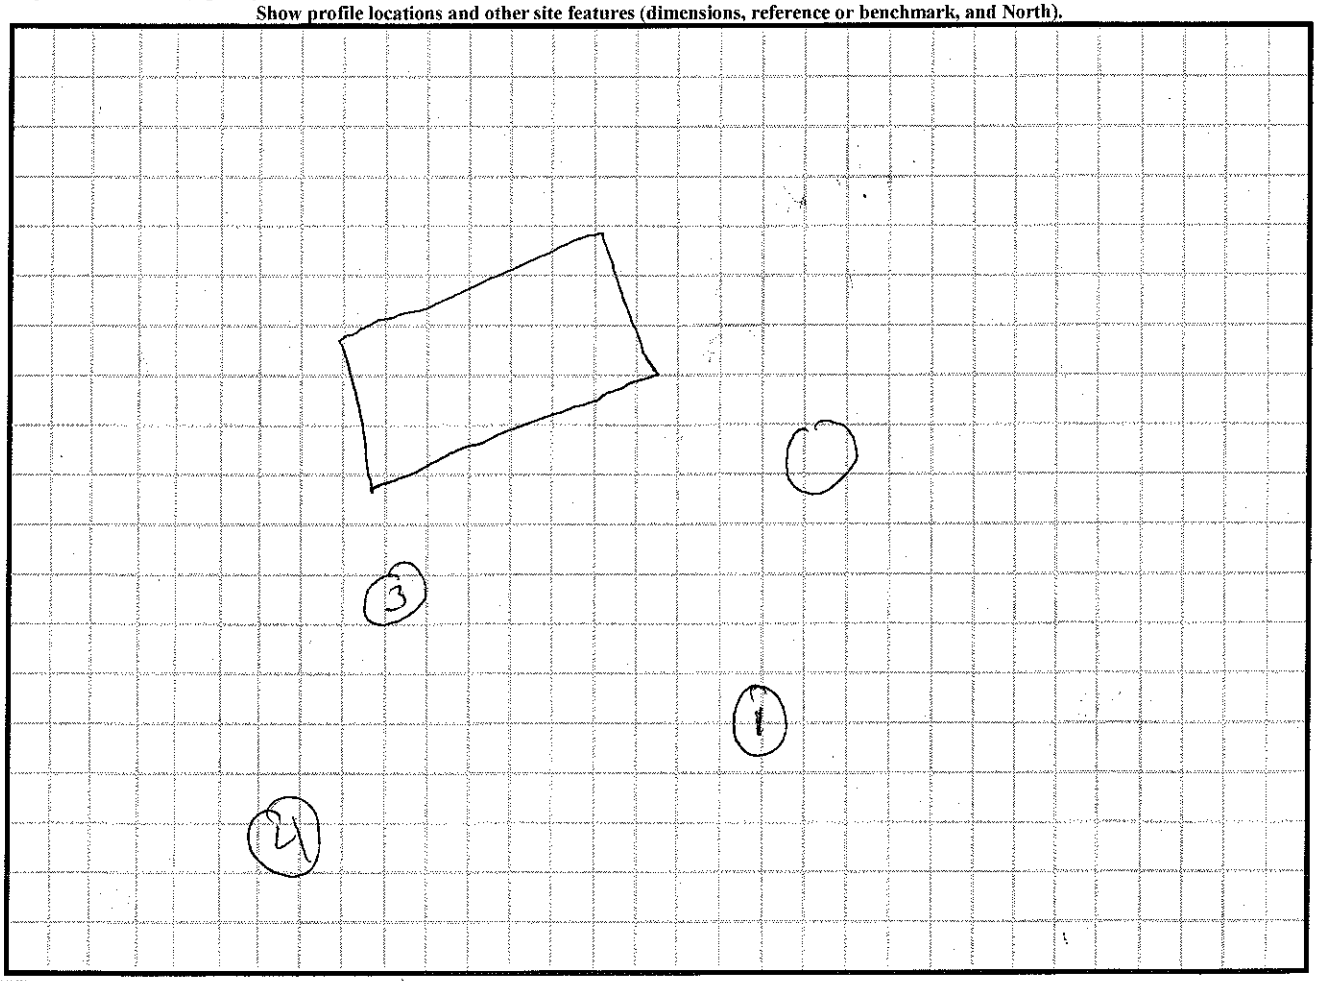

DENR (######)

Review (#####)