DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 129461
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: JOSEPH L STARLE
ADDRESS: 212 HARMONY BLVD DR HARMONY, NC 28634
PROPOSED FACILITY: SINGLE FAMILY PROPOSED DESIGN FLOW (.1949): 360 GPD
LOCATION OF SITE: NW @ CNR OF THOMAS & HARMONY BLVD @ LOT
APPLICATION DATE 6/21/05
DATE EVALUATED: 7/25/05
PROPERTY SIZE: 1.17 ACRES
PROPERTY RECORDED:
WATER SUPPLY: ☒ Private ☐ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	SS LL 6%	0-5	MgrSCL	VFr SS/SP SOXP		42"			PS .3
		5-42	mSBKC	Fr SS/SP SOXP					
		42+	C+SAP						
2	SS LL 6%	0-12	mSBKSCL	VFr SS/SP SOXP		48"			PS .3
		12-48	mSBKC	Fr SS/SP SOXP					
3	SS LL 6%	0-10	mSBKSCL	VFr SS/SP SOXP		48"			PS .3
		10-48	mSBKC	Fr SS/SP SOXP					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	5	5
System Type(s)	GRAV CONV	PUMP
Site LTAR	.3	

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay) O (Organic)	0.4 - 0.1 None	0.2 - 0.05 None	**MOIST** VFR (Very Friable) FR (Friable) FI (Firm) VFI (Very Firm v. Very Sticky) EFI (Extremely Firm)	**WET** NS (Non-sticky) SS (Slightly Sticky) S (Sticky) VS (Very Sticky) NP (Non-plastic) SP (Slightly Plastic) P (Plastic) VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

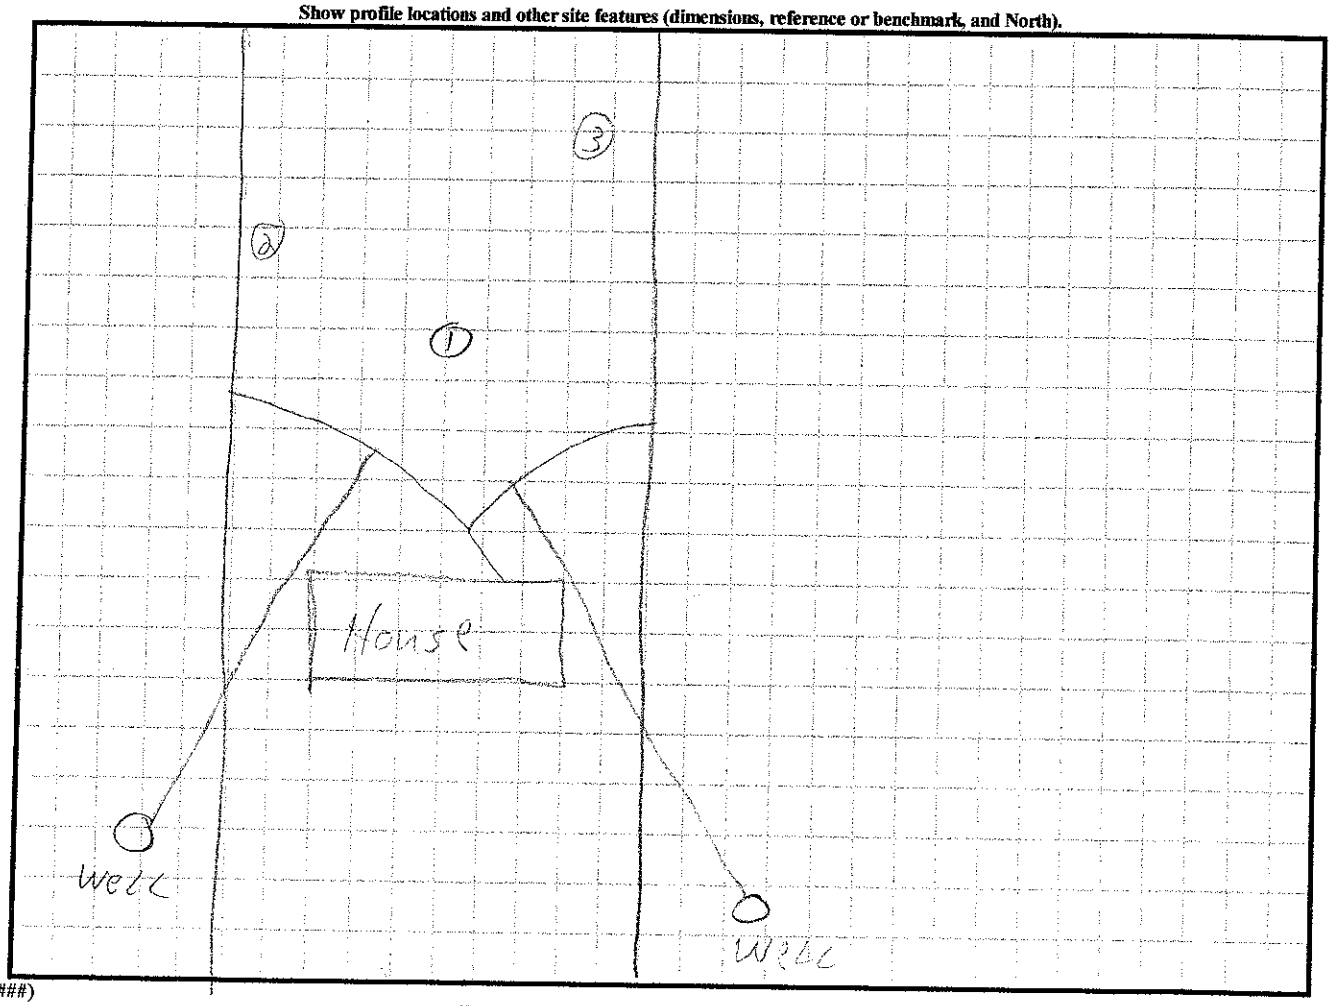

DENR (######)
Review (#####)

ROAD