DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: 4786336143
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Steven Lee
ADDRESS: 1706 Mocksville Hwy, Cleveland 27013
PROPOSED FACILITY: SFR
PROPOSED DESIGN FLOW (.1949): 3 bdroom
LOCATION OF SITE: Hwy 64 E - 1 mile past Davis Hospital on L
WATER SUPPLY: • Private • Public • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • Pit • Cut
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

APPLICATION DATE: 4-8-11
DATE EVALUATED: 5-11-11
PROPERTY SIZE: 5.98 Ac
PROPERTY RECORDED: yes

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	9% LS	0-10	wk sbk scl	fr ss sp	None	48"	NA	NA	.3
		10-44	sbk c	fr ss sp					
		44-48	sbk cl	fr ss sp					
2	7% LS	0-12	wk sbk scl	fr ss sp	None	48"	NA	NA	.3
		12-22	sbk c	fr ss sp					
		22-48	wk cl	fr ss sp					
3	8% LS (Repair Area)	0-12	wk sbk scl	fr ss sp	None	37"	NA	NA	.3
		12-37	sbk c/cl	fr ss sp					
		37+	stopped @ 37" - Water table * Appears to be a Water						
4	5% LS (Repair Area)	0-4	gr brn scl	fr ss	None	48"	NA	NA	.3
		4-22	sbk c	fr ss sp					
		22-48	wk sbk cl	fr ss sp					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	S	S
System Type(s)	Conv conv	Conv conv
Site LTAR	.3	.3

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): RS
EVALUATED BY: DP Henson
OTHER(S) PRESENT: Todd Ellis - builder

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

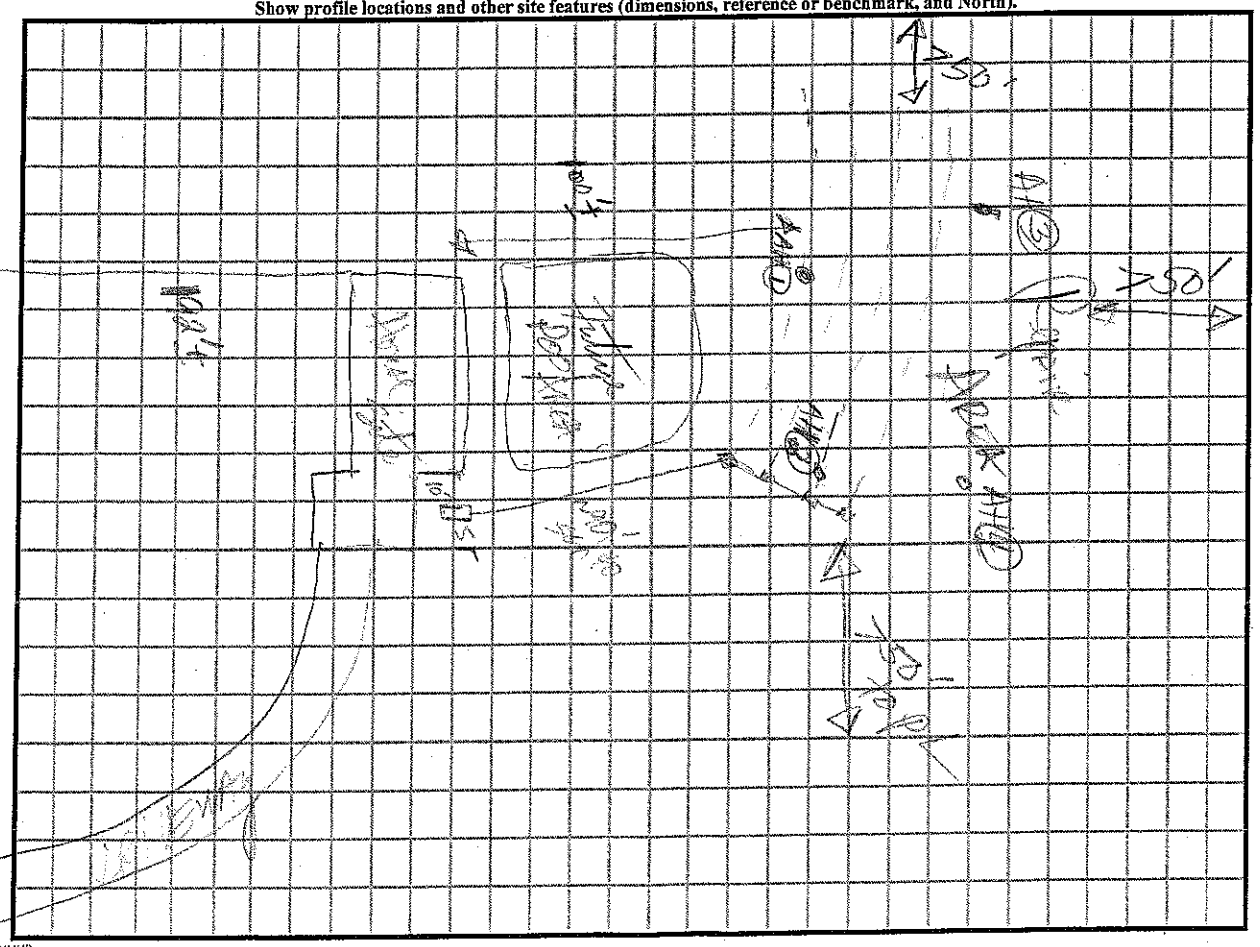

DENR (######)
Review (#####)