DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1

PROPERTY ID #: 4789007872

COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: JOE JACK BARKLEY — APPLICATION DATE 2-8-12

ADDRESS: 167 DALY LANE — DATE EVALUATED: 2-13-12

PROPOSED FACILITY: 3BR HOUSE — PROPOSED DESIGN FLOW (.1949): 360 — PROPERTY SIZE: 1.7 ACRES

LOCATION OF SITE: US 21 N, TR BETHEL, TL RIMROCK, TR DALY, 2nd on (R) — PROPERTY RECORDED: _____

WATER SUPPLY: • Private • Public • Well • Spring • Other _____

EVALUATION METHOD: • Auger Boring • Pit • Cut — TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 16%	0-14	SBK MICACEOUS CL	FR SEP	N/A	PS ~ 48"	PS SAP. INCL. @38"+	N/A	PS 0.3
		14-38	SBK C	FR SS/SP SOP					
		38-48	W SBK SAP MIX CL	VFR SEP					
2	L 18%	0-16	SBK MICACEOUS CL	FR SEP	N/A	PS ~ 48"	PS SAP. INCL. @40"+	N/A	PS 0.3
		16-40	SBK C	FR SS/SP SEP					
		40-48	W SBK SAP MIX CL	VFR SEP					
3	L 12%	0-12	SBK CL	FR SEP	N/A	PS ~ 48"	N/A	N/A	PS 0.3
		12-40	SBK C	FR SS/SP SEP					
		40-48	SBK CL	FR SEP					
4	L 12%	0-12	SBK CL	FR SEP	N/A	PS ~ 48"	N/A	N/A	PS 0.3
		12-38	SBK C	FR SS/SP SEP					
		38-48	SBK CL	FR SEP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III (6)
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NONE

SITE CLASSIFICATION (.1948): PS

EVALUATED BY: S. HEDRICK

OTHER(S) PRESENT: JACK BARKLEY & DAUGHTER

COMMENTS: _____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

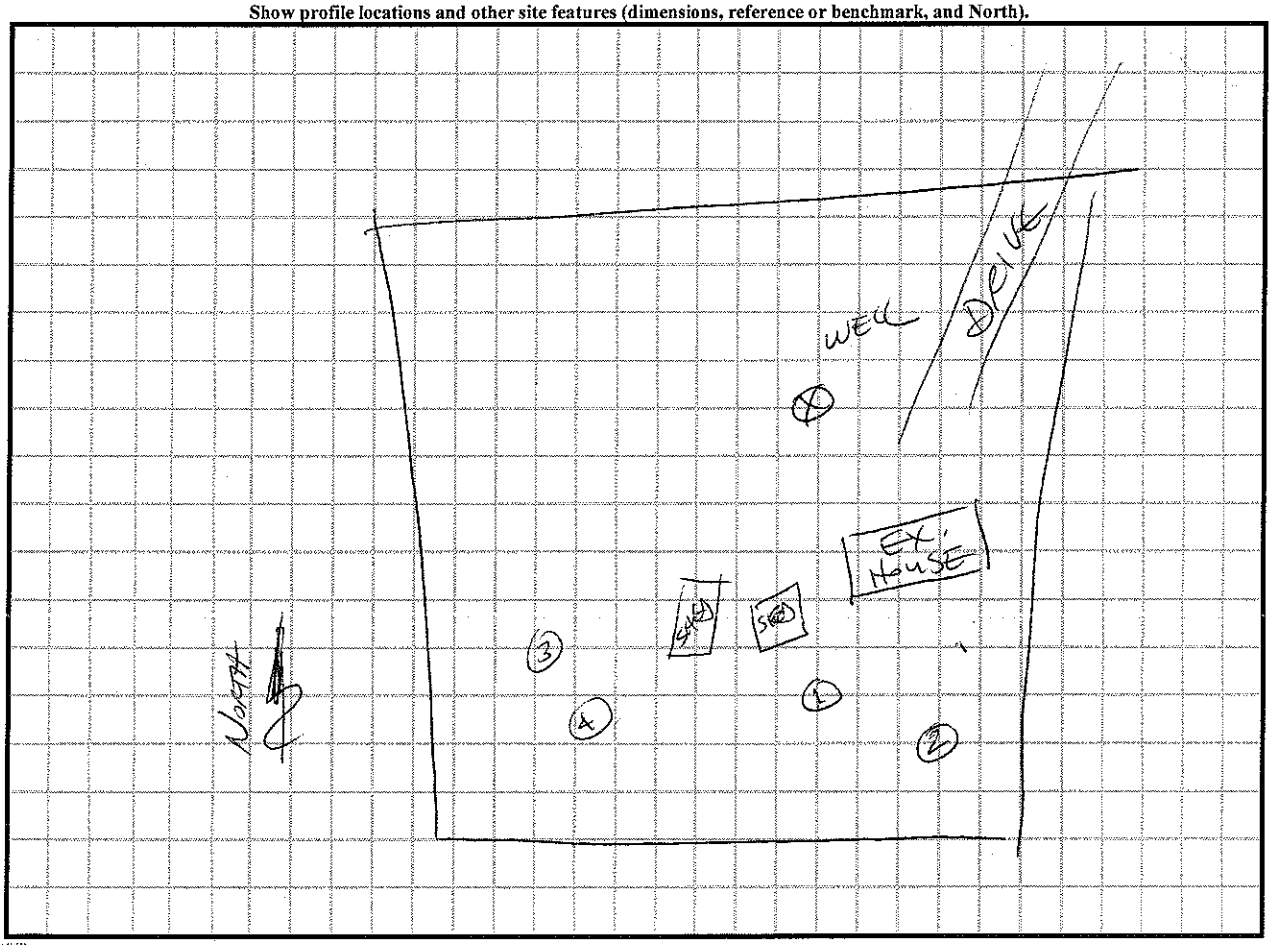

DENR (######)

Review (#####)