1586564
4789 02 5446

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Zitlali Torres / Gelbyto Gonzalez
ADDRESS: 105 Maidfield Lane Harmony 28634
PROPOSED FACILITY: 4 Mobile Home PROPOSED DESIGN FLOW (.1949): 480
LOCATION OF SITE: 21N to 1st Belted (L) Kimrock (R) Hardware
WATER SUPPLY: • Private • Public • Well • Spring • Other
EVALUATION METHOD: • Auger Boring • Pit • Cut

APPLICATION DATE: 10/16/09
DATE EVALUATED: 11-23-09
PROPERTY SIZE: 4 AC
PROPERTY RECORDED:
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	A 0%	0-8	SCWBL	SSSPSEAPL					
		8-48	CWBL	SSSPSEAPL	mica inclusions				
					NA	48	NA	NA	.25
2	A 14%	0-9	SCWBL	SSSPSEAPL					
		9-18	CWBL	SSSPSEAPL					
		18-48	CWBL	SSSPSEAPL	mica inclusions				
					NA	48	NA	N/A	.25
3	A 12%	0-8	SCWBL	SSSPSEAPL					
		8-48	CWBL	SSSPSEAPL	mica inclusions				
					NA	48	NA	NA	.25
4	A 7%	0-8	SCWBL	SSSEAPL					
		9-30	CABL	SSSPSEAPL					
		30-48	CWBL	SSSPSEAPL	mica inclusions				
					NA	48	NA	N/A	.25

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	1920/480	1950 - 330
System Type(s)	25% C	50% LowPr
Site LTAR	.25	.25

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): RS
EVALUATED BY: Kelly Cox
OTHER(S) PRESENT: Amanda Stewart

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

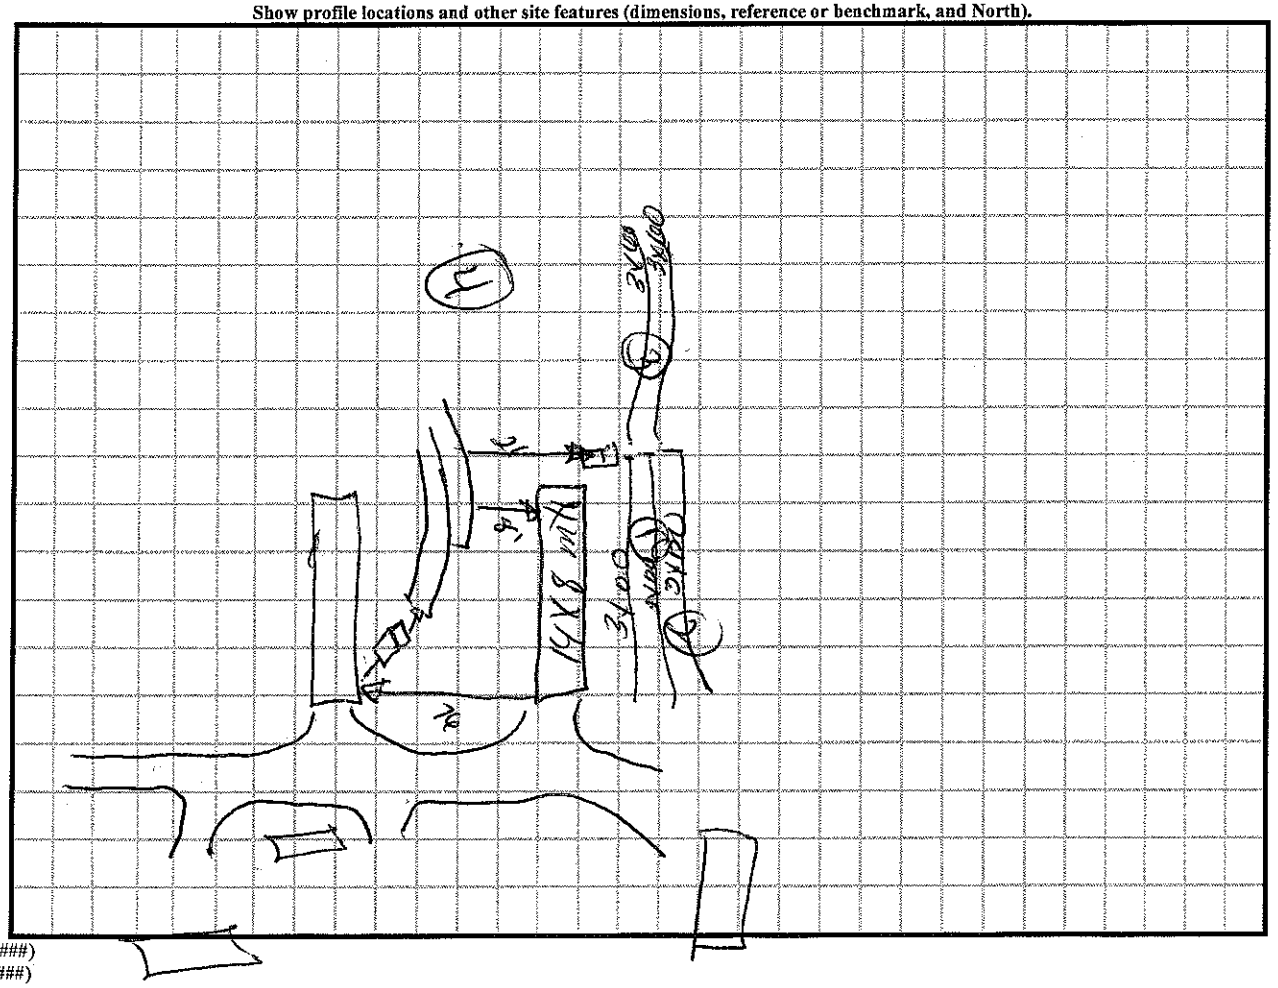

DENR (#######)
Review (#####)