DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4814437207
COUNTY: Tyrrell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Ronnie Broome
ADDRESS: PO Box 248, Trotman
PROPOSED FACILITY: SFD
PROPOSED DESIGN FLOW (.1949): 360gpd
LOCATION OF SITE: 299 Paddock Rd.
WATER SUPPLY: • (Private) • Public • Well • Spring • Other N/A
EVALUATION METHOD: • Auger Boring • (Pit) • Cut
TYPE OF WASTEWATER: • (Sewage) • Industrial Process • Mixed

APPLICATION DATE 4-21-15
DATE EVALUATED: 6-1-15
PROPERTY SIZE: 31.86 acres
PROPERTY RECORDED: YES

PROFILE #	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	18% NS	0-23	C ABK	Fr Mod SE	+60"	48"	48"	+60"	PS 0.25
		23-48	BC SAP Incl WABK	Fr Mod SE					
		48-60	SAP L Gr	Fr Mod SE					
2	18% NS	0-17	C ABK	Fr Mod SE	+60"	44"	42"	+60"	PS 0.25
		17-44	BC SAP Incl WABK	Fr Mod SE					
		44-60	SAP SL Gr	Fr Mod SE					
3	17% NS	0-6	C ABK	Fr Mod SE	+60"	28"	25"	+60"	PS 0.25
		6-28	BC many SAP Incl WABK	Fr Mod SE					
		28-60	SAP SL Gr	Fr Mod SE					
4	16% NS	0-7	SCL SBK	Fr Mod SE	+53"	48"	48"	+53"	PS 0.25
		7-17	C ABK	Fr Mod SE					
		17-48	BC SAP Incl WABK	Fr Mod SE					
		48-53	SAP SL Gr	Fr Mod SE					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II	II
Site LTAR	0.25	0.25

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Justin Henderson
OTHER(S) PRESENT: N/A

COMMENTS: A TB @ 36" A B

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL 1955 LTAR*	LPP 1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

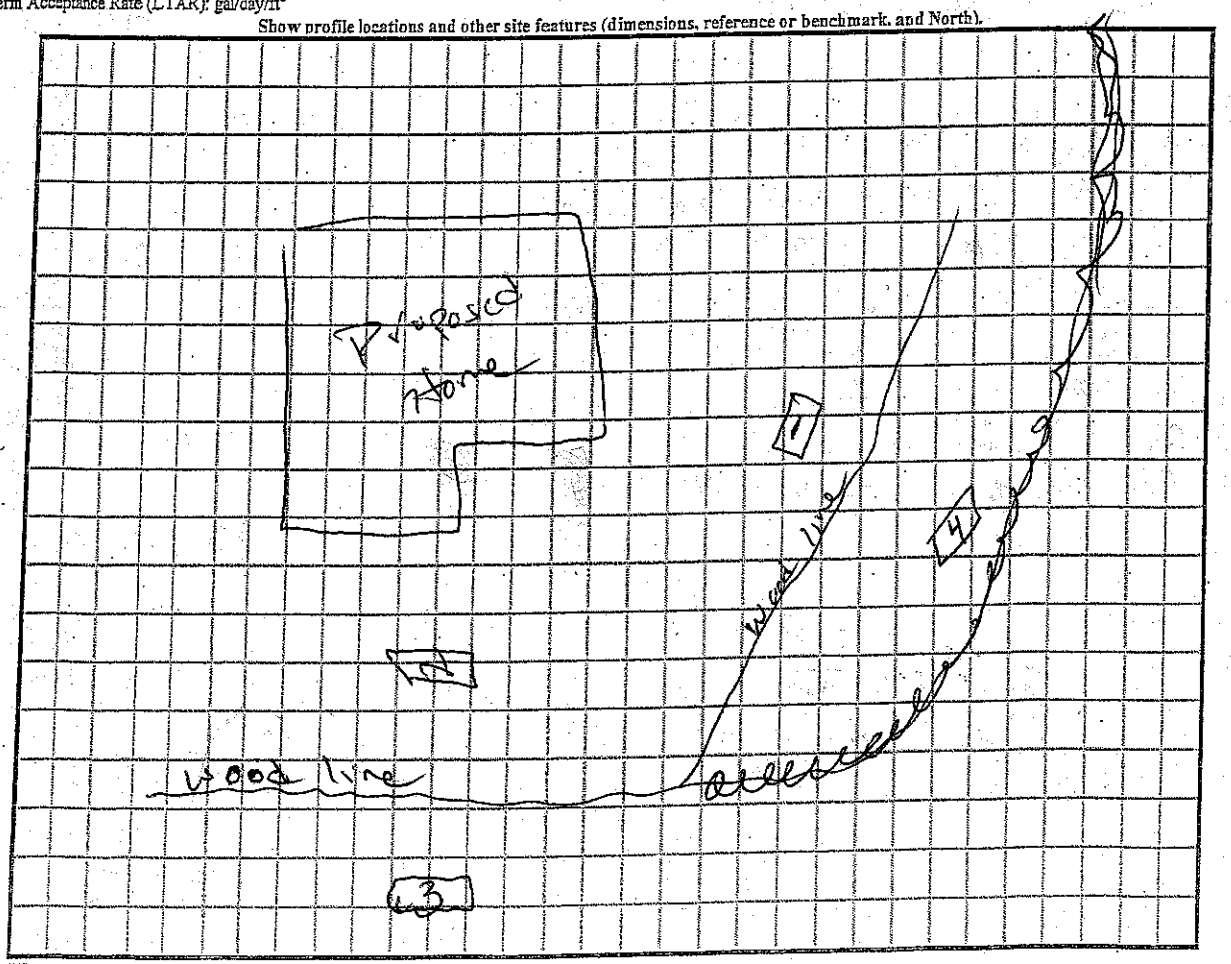

DENR (######)
Review (#####)