DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 2
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Christie Barkley APPLICATION DATE 3-10-04
ADDRESS: 7611 Babe Stillwell Farm Rd Huntersville 28078 DATE EVALUATED: 4-21-04
PROPOSED FACILITY: 4br PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: 7.92
LOCATION OF SITE: 21 N (L) Jennings (L) Byway all the way to end PROPERTY RECORDED: yes
WATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 5%	0-5	vk sbk scl	vfr ss/sp sexp	—	40	n/a	n/a	PS .3
		5-36	mo sbk c	fr s/p					
		36-40	mo sbk c+sap	fr s/p					
		40+	sl m sap	—					
2	L 5%	0-3	wk gr sl	vfr ns/np sexp	—	36	n/a	n/a	PS .3
		3-18	mo sbk c	fr s/p					
		18-36	mo sbk c+sap	fr s/p					
		36+	sl m sap	—					
3	L 3%	0-18	wk gr sl	vfr ns/np sexp	—	>48	n/a	n/a	PS .3
		18-36	wk sbk scl	vfr s/sp sexp					
		36-48	mo sbk c	fr s/p sexp					
4	L 3%	0-6	wk gr sl	vfr ns/np sexp	—	>48	n/a	n/a	PS .3
		6-24	mo sbk c	fr s/p					
		24-48	mo sbk c+sap	fr s/p					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948):
EVALUATED BY:
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTU
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky,
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SCL (Sandy Clay Loam)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiL (Silt Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SiCL (Silty Clay Loam)			MOIST	WET
S (Shoulder Slope)		Si (Silt)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

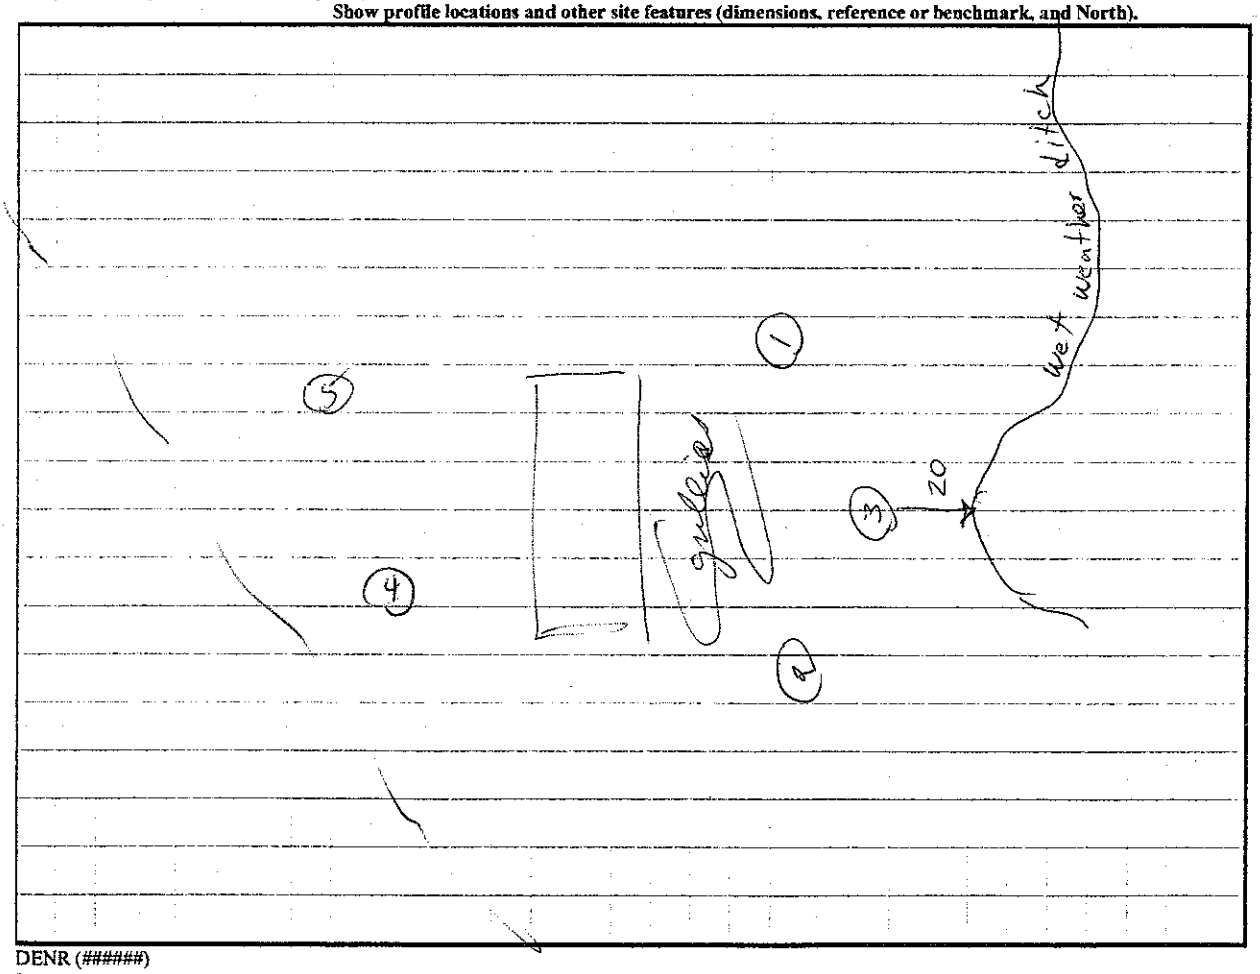

5
L
0-6 SL
6-32 C
32-48 C+Sap
.3

DENR (######)
Review (#####)

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Christi Barkley APPLICATION DATE 3-10-04
ADDRESS: 7611 Babe Stillwell Rd Huntersville 28078 DATE EVALUATED: 4-21-04
PROPOSED FACILITY: 4br PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: 7.92
LOCATION OF SITE: 21 N @ Jennings @ Byway on left PROPERTY RECORDED: yes
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 3%	0-6	wk gr sl	vfr NS/np sexp	—	>48	—	—	PS .3
		6-32	mo sbk c	fr S/p					
		32-48	mo sbk c+sap	fr S/p					
2	L 3%	0-8	wk sbk scl	vfr SS/sp sexp	—	>48	—	—	PS .3
		8-20	mo sbk c	fr S/p					
		20-48	mo sbk c+sap	fr S/p					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

COMMENTS: _____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTU
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky,
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SCL (Sandy Clay Loam)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiL (Silt Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SiCL (Silty Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		Si (Silt)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**

NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

DENR (######)

Review (#####)