DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: IREDELL

SOIL/SITE EVALUATION 4844-01-8348
for ON-SITE WASTEWATER SYSTEM

OWNER: ALLEN TATE REALTY - BRENDA JORDAN — APPLICATION DATE
ADDRESS: 134-F TOWN CENTER DR. MOORESVILLE NC 28117 — DATE EVALUATED: 7-22-05
PROPOSED FACILITY: 5 BR — PROPOSED DESIGN FLOW (.1949): 600 — PROPERTY SIZE:
LOCATION OF SITE: I-77N TL HWY 901 TR WARREN BRIDGE — PROPERTY RECORDED: Y
WATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other TL BUTCH BRANCH PROPERTY ON RIGHT
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut — TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 10% 15%	0-4	SBK SCL	VFR SS/SP SXP	—	36"	—	—	PS 0.30
		4-20	" C	FR S/P "					
		20-36	" SCL	FR S/P "					
		36+	M SAP	—					
2	L	0-5	SBK SCL	VFR SS/SP SXP	—	42"	—	—	PS 0.30
		5-18	" C	FR S/P "					
		18-42	" SCL	FR S/P "					
		42+	M	—					
3	CC	0-6	SBK SCL	VFR SS/SP SXP	—	36"	—	—	PS 0.30
		6-24	" C	FR S/P "					
		24-36	" CL	" " "					
		36+	M SAP	—					
4	L	0-5	SBK SCL	VFR SS/SP SXP	—	>48"	—	—	PS 0.30
		5-24	" C	FR S/P "					
		24-48	" SCL	" " "					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II 25% GRAVITY	SAME
Site LTAR	0.30	SAME

OTHER FACTORS (.1946): SURFACE SWALE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: CS
OTHER(S) PRESENT: BRENDA JORDAN

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3		
	III	Si (Silt) SiCL (Silty Clay Loam) CL (Clay Loam) SCL (Sandy Clay Loam) SiL (Silt Loam)	0.6 - 0.3	0.3 - 0.15		
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay)	0.4 - 0.1	0.2 - 0.05		
		O (Organic)	None	None		

MOIST	WET
VFR (Very Friable)	NS (Non-sticky)
FR (Friable)	SS (Slightly Sticky)
FI (Firm)	S (Sticky)
VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
EFI (Extremely Firm)	NP (Non-plastic)
	SP (Slightly Plastic)
	P (Plastic)
	VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

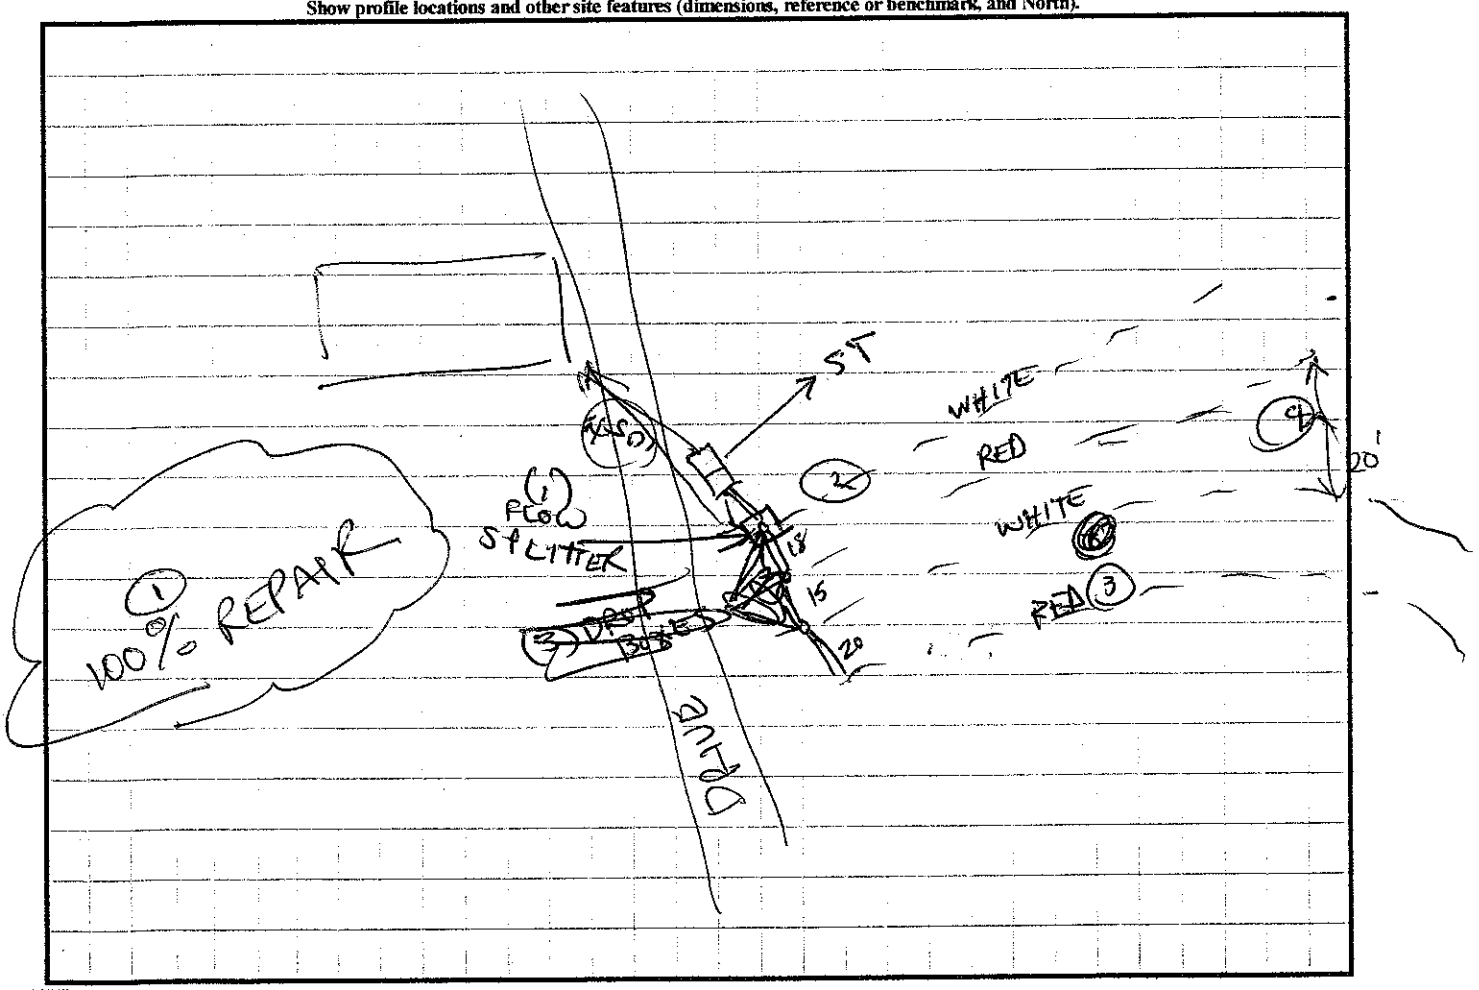

DENR (######)
Review (#####)