DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4852303864
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Cmtt Homes — APPLICATION DATE 12-30-14
ADDRESS: 1124 Charlotte Hwy — DATE EVALUATED: 1-16-14
PROPOSED FACILITY: SFD — PROPOSED DESIGN FLOW (.1949): 360gpd — PROPERTY SIZE: 1.0 acre
LOCATION OF SITE: 694 Sloans Mill Rd — PROPERTY RECORDED: YES
WATER SUPPLY: • Private • (Public) • Well • Spring • Other N/A
EVALUATION METHOD: • (Auger Boring) • Pit • Cut — TYPE OF WASTEWATER: • (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	8% HS	0-22	C SBK	Fr S/P Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		22-48	Cl mSBK	Fr Mod SE					
2	5% HS	0-9	SCL SBK	Fr Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		9-26	C SBK	Fr S/P Mod SE					
		26-48	Cl SAPROLITE SBK	Fr Mod SE					
3	5% HS	0-10	SCL SBK	Fr Mod SE	>48"	>48"	>48"	>48"	PS 0.25
		10-42	C SBK	Fr S/P Mod SE					
		42-48	Cl SAPROLITE mSBK	Fr Mod SE					
4	8% HS	0-10	SCL SBK	Fr Mod SE	>30"	30"	>30"	30"	PS 0.25 0.125 DRP
		10-25	C SBK	Fr S/P Mod SE					
		25-30	Cl SBK	Fr Mod SE					
		30	Rock (Floater)						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	II	V
Site LTAR	0.25	0.125

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Josh Henderson
OTHER(S) PRESENT: N/A

COMMENTS: N/A

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)			**MOIST**	**WET**
R (Ridge)		SCL (Sandy Clay Loam)				
S (Shoulder Slope)		SiL (Silt Loam)			VFR (Very Friable)	NS (Non-sticky)
T (Terrace)					FR (Friable)	SS (Slightly Sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FI (Firm)	S (Sticky)
		SiC (Silty Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		C (Clay)			EFI (Extremely Firm)	NP (Non-plastic)
		O (Organic)	None	None		SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2 R2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

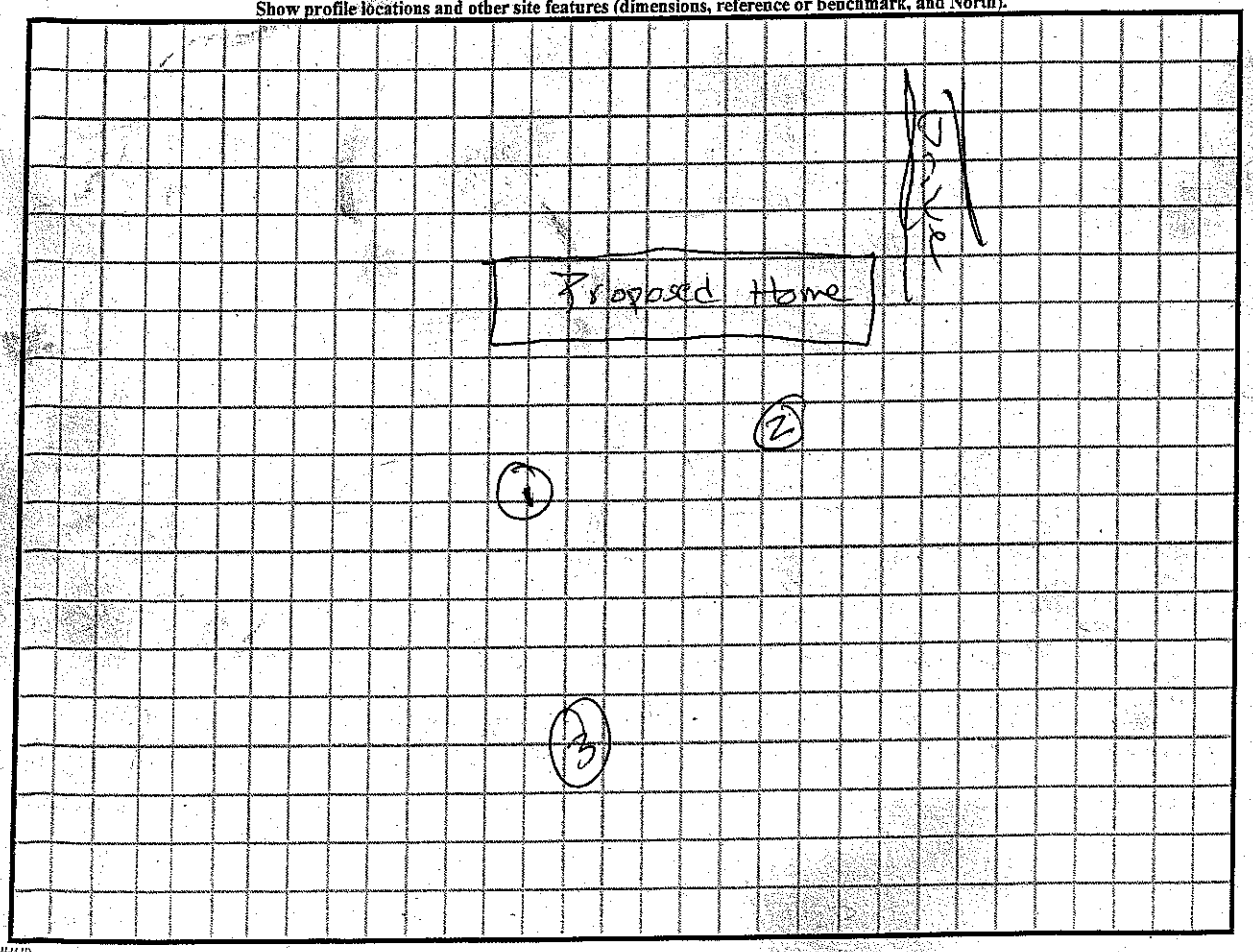

DENR (######)
Review (#####)