DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: IREDELL

SOIL/SITE EVALUATION

4852-71-4925.001

for ON-SITE WASTEWATER SYSTEM

OWNER: RONALD FULLWOOD APPLICATION DATE 2-18-04
ADDRESS: 478 LAKE MULLIS, HARMONY 28634 DATE EVALUATED: 3-18-04
PROPOSED FACILITY: 3BR MOD PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: LIMITED
LOCATION OF SITE: I-77 N, TR NC901, TR JERICHO PROPERTY RECORDED: ___
WATER SUPPLY: ☑ Private ☐ Public ☑ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☑ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	N 4%	0-14	SBK C	FR SEXP					PS 0.4
		14-32	SBK SC	FR SEXP					
		32-48	SBK SAP MIX SC	VFR SEXP					
2	SLIGHT N 6%	0-18	SBK C	FR SEXP					PS 0.4
		18-34	SBK SC	FR SEXP					
		34-48	SBK SAP MIX SC	VFR SEXP					
3	L 8%	0-20	SBK C	FR SEXP					PS 0.4
		20-48	SBK SC	FR SEXP					
4	PT SLIGHT N 6%	0-18	SBK C	FR SEXP					PS 0.4
		18-34	SBK SC	FR SEXP					
		34-48	SBK SAP. MIX SC	VFR SEXP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	S	PS
System Type(s)	II	III
Site LTAR	0.4	0.4

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT: RONALD FULLWOOD

COMMENTS: ___

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*
CC (Concave Slope) CV (Convex Slope) D (Drainage Way) DS (Debris Slump) FP (Flood Plain) FS (Foot Slope) H (Head Slope) L (Linear Slope) N (Nose Slope) R (Ridge) S (Shoulder Slope) T (Terrace)	I	S (Sand) LS (Loamy Sand)	1.2 - 0.8	0.6 - 0.4
	II	SL (Sandy Loam) L (Loam)	0.8 - 0.6	0.4 - 0.3
	III	SCL (Sandy Clay Loam) SiL (Silt Loam) CL (Clay Loam) SiCL (Silty Clay Loam) Si (Silt)	0.6 - 0.3	0.3 - 0.15
	IV	SC (Sandy Clay) SiC (Silty Clay) C (Clay) O (Organic)	0.4 - 0.1 None	0.2 - 0.05

MINERALOGY/ CONSISTENCE	STRUCTURE
NEXP (Non-expansive) SEXP (Slightly Expansive) EXP (Expansive)	G (Single Grain) M (Massive) CR (Crumb) GR (Granular) SBK (Subangular Blocky) ABK (Angular Blocky) PL (Platy) PR (Prismatic)

MOIST	WET
VFR (Very Friable) FR (Friable) FI (Firm) VFI (Very Firm v. Very Sticky) EFI (Extremely Firm)	NS (Non-sticky) SS (Slightly Sticky) S (Sticky) VS (Very Sticky) NP (Non-plastic) SP (Slightly Plastic) P (Plastic) VP (Very Plastic)

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

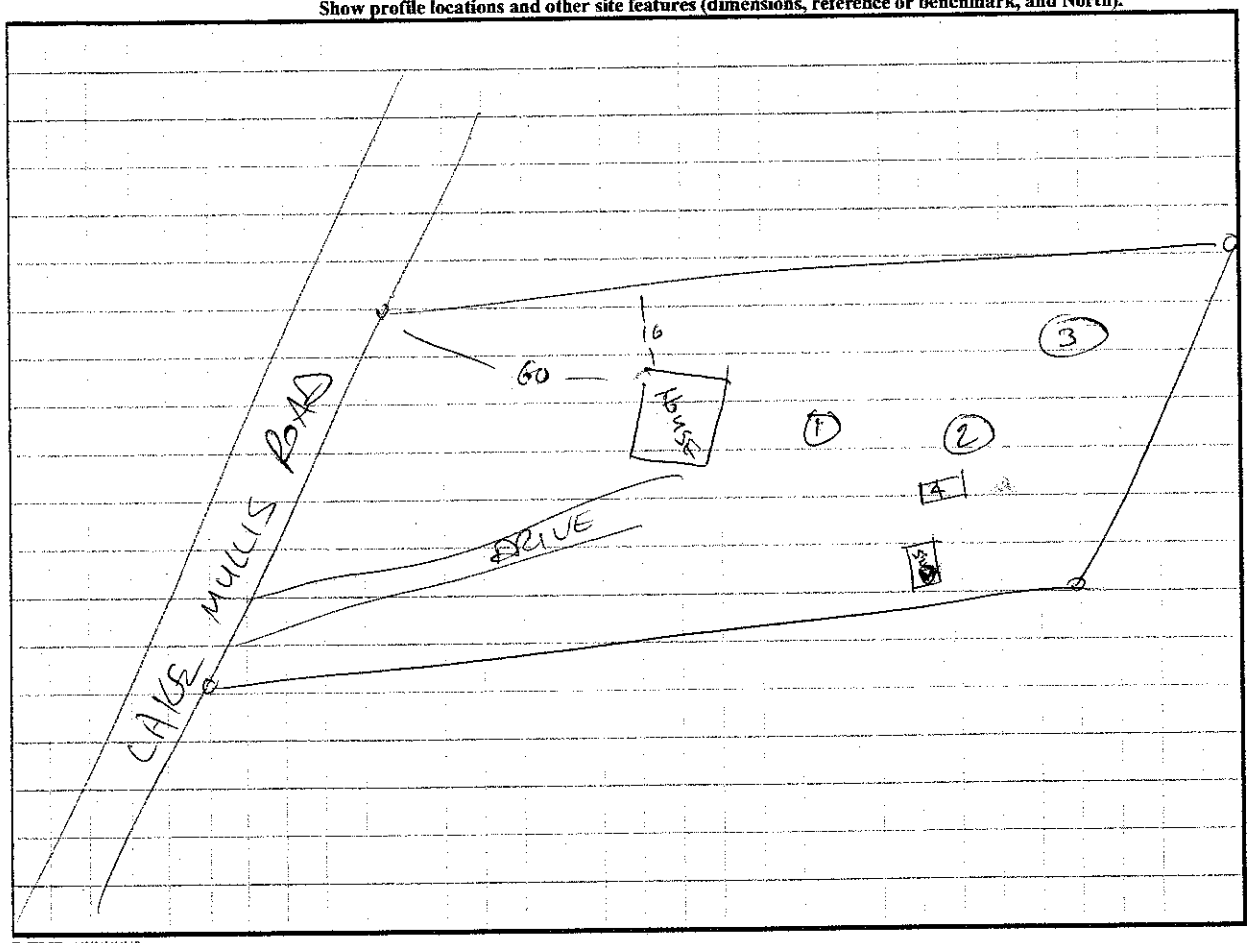

DENR (######)
Review (#####)