DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4861-32-56IC
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: HORNE BUILDING INC — APPLICATION DATE 10-6-08
ADDRESS: 229 CEDAR LAKE DRIVE, STATESVILLE NC 28625 — DATE EVALUATED: 10-15-08
PROPOSED FACILITY: 3BR HOUSE — PROPOSED DESIGN FLOW (.1949): 360 — PROPERTY SIZE: 0.461 ACRES
LOCATION OF SITE: PADGETT FARMS LOT 38 — PROPERTY RECORDED: _____
WATER SUPPLY: • Private • Public • Well • Spring • Other _____
EVALUATION METHOD: • Auger Boring • Pit • Cut — TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	SLIGHT H 3%	0-2	GR/SCL	FR/SEXP	S	PS TO 38"	U AT 38"+	NONE	PS TO 38" 0.35
		2-38	WFABK/CL	FI/SEXP					
		38-47	MASS/SAPROLITE						
2	SLIGHT H 2.5%	0-2	WFSBK/SCL	FR SEXP	S	S	N/A ~~X~~ MIXED SAP @40"+	N/A	PS 0.35
		2-40	WFABK/CL	FI SS/SP SEXP					
		40-48	WFABK/SL	VFR NEXP					
3	Slight H 2.5%	0-4	GR/SBK SCL	FR SEXP	S	S	SAP INCL @ 26"		PS 0.35
		4-36'	WFSBK CL	FR SEXP					
		36-48	WFABK CL	FI SEXP					
4	SLIGHT N 6%	0-42	WFABK CL	FR SS/SP SEXP	S	PS TO 42"	NA	PS @42"	PS 0.35
		42+	ROCKY	COULD NOT AUGER					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.35	0.35

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK / FRED CLEMMER
OTHER(S) PRESENT: _____

COMMENTS: _____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

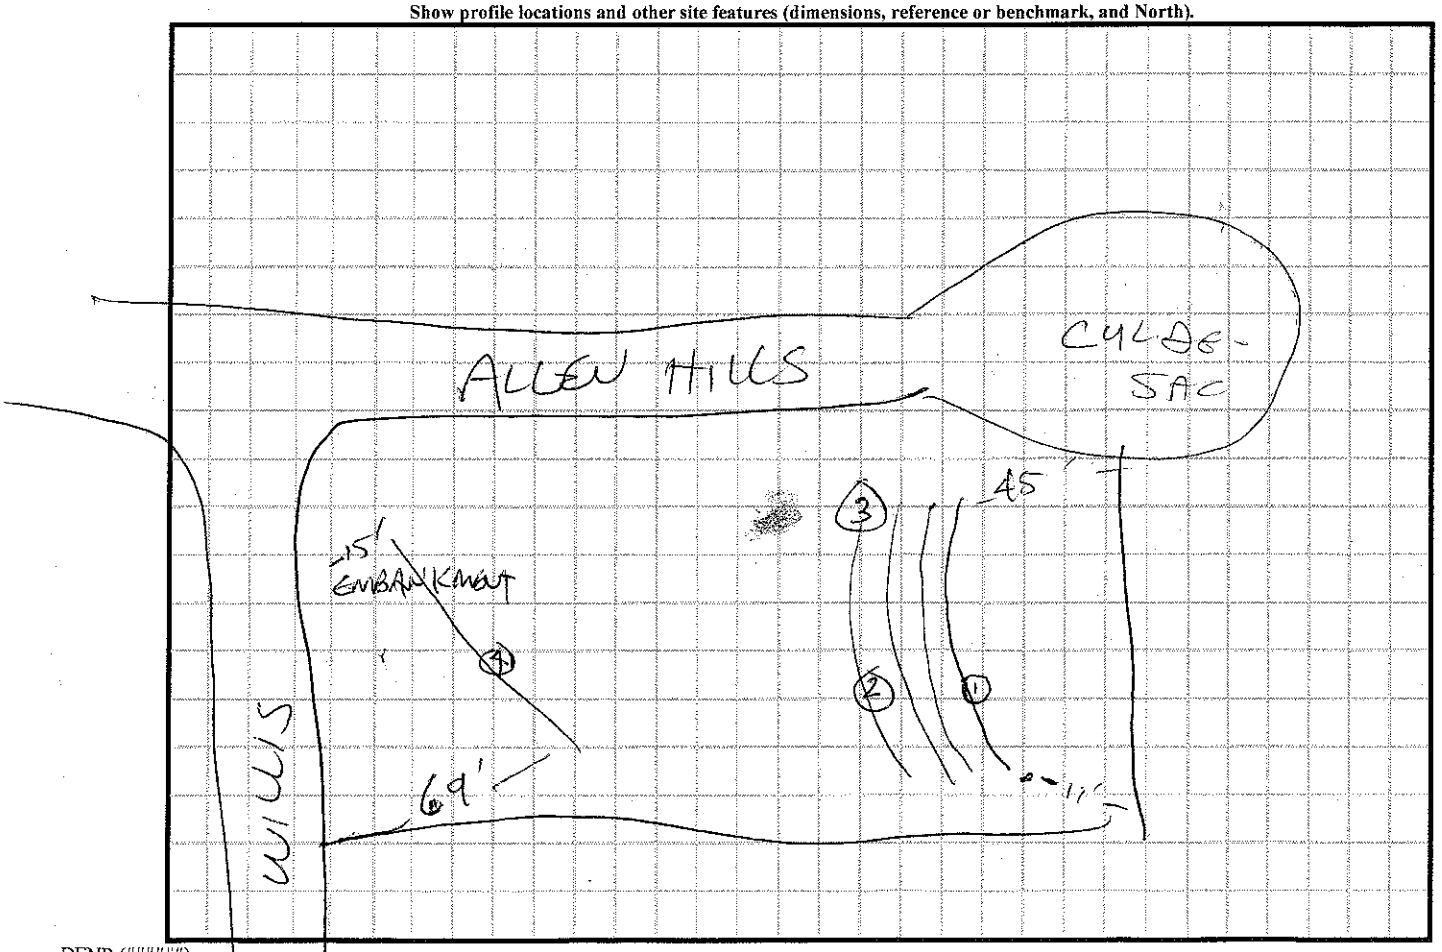

DENR (######)
Review (#####)