DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4862734561
COUNTY: Moore

159532 Permit #

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Veronica Witherspoon
ADDRESS: 172 Tranquility Lake Heaming NC 28634
PROPOSED FACILITY: 4BR House
LOCATION OF SITE: 398 Miller Rd Corner of Miller & Hoastonville
WATER SUPPLY: • Private • X Public • Well • Spring • Other
EVALUATION METHOD: X Auger Boring • Pit • Cut

APPLICATION DATE 1-8-10
DATE EVALUATED: 1-20-10
PROPOSED DESIGN FLOW (.1949): 480
PROPERTY SIZE:
PROPERTY RECORDED: NO
TYPE OF WASTEWATER: X Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	6% L	0-6"	cl wk gr	fr ns sp nep	N/A	48"	N/A	N/A	PS .3
		6-45"	cmed sbk	fr sp sep					
		45-48"	cwk sbk	fr sss p sep					
			sap inc < 50%						
2	7% L	0-6"	cl wk gr	fr ns sp nep	N/A	48"	N/A	N/A	PS .3
		6-48"	cmed sbk	fr sp sep					
3	8%	0-6"	cl wk gr	fr ns sp nep	N/A	48"	N/A	N/A	PS .3
		6-48"	cmed sbk	fr sp sep					
4	8% L	0-6"	scl wk gr	fr ns sp nep	10 yr 7/6 20"-48"	48"	N/A	N/A	PS .25
		6-18"	cl wk sbk	fr ss sp sep					
		18-48"	cmed sbk	fr sp sep					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	GRAV CONV	SAME
Site LTAR	.3	.25

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. CODY
OTHER(S) PRESENT: V. WITHERSPOON / NEIGHBOR

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

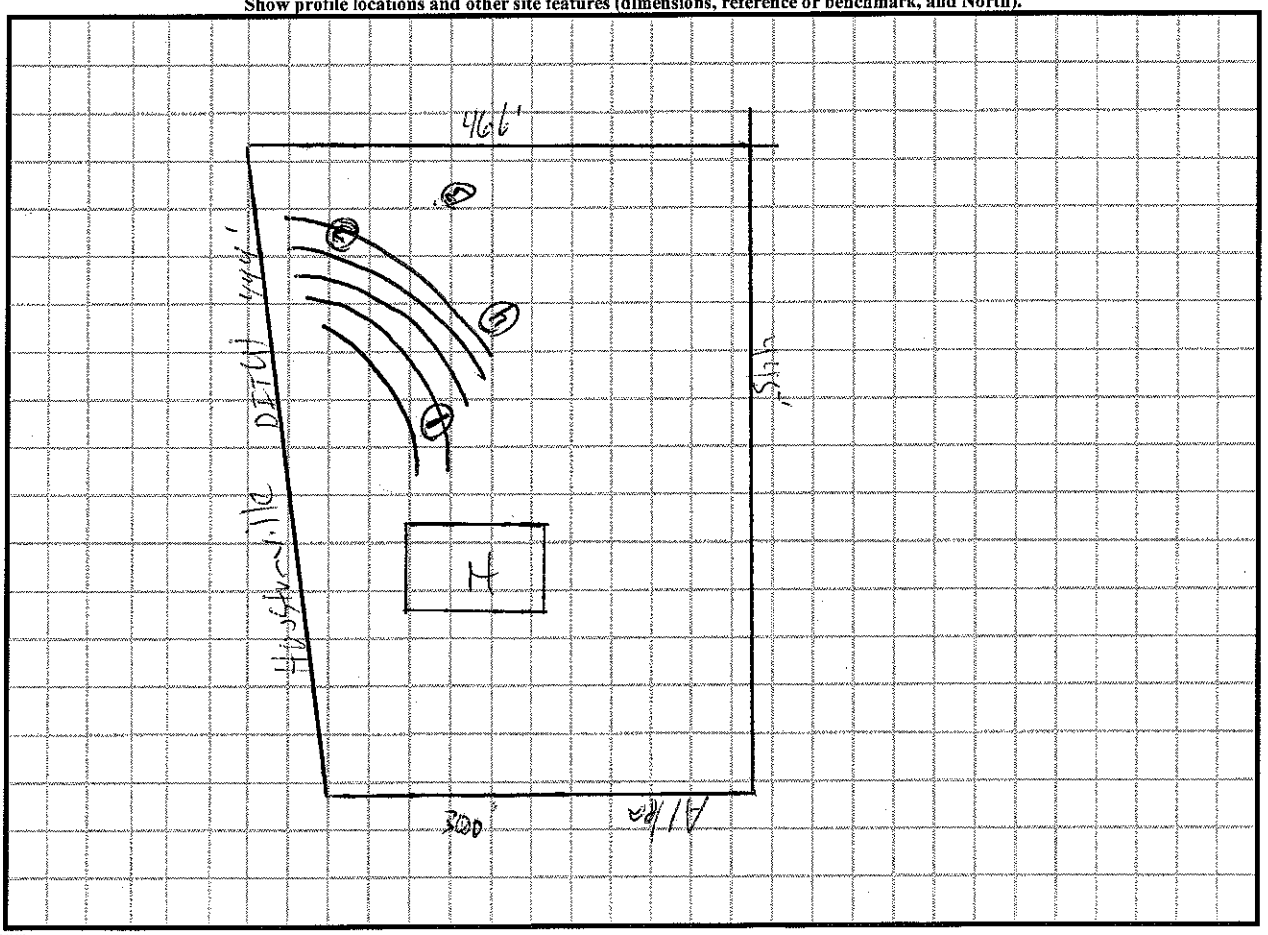

DENR (######)
Review (#####)