DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: IREDELL

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: HARMONY MEDICAL CLINIC — FLOW REDUCED TO 317 GPD PER BEH A-19-06
ADDRESS: 110 WEST MEMORIAL Hwy, HARMONY — APPLICATION DATE 2-6-06
PROPOSED FACILITY: 3450 SF MEDICAL PROPOSED DESIGN FLOW (.1949): 1035 GPD — DATE EVALUATED: 2-23/28-06
LOCATION OF SITE: US 21 N OFFICE 1ST ON RIGHT PAST ROSEWOOD — PROPERTY SIZE: 1.0 ACRE
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other — PROPERTY RECORDED:
EVALUATION METHOD: ☑ Auger Boring ☑ Pit ☐ Cut — TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
AUGER 1	SLIGHT N 5%	0-3	GR L	VFR SSP			NEED BACKHOE PIT		PS 0.35
		3-26	SBK C	FR SSP					
		26-39	WSBK CL	FR SSP					
		39-48	WSBK LOAMY SAP	VFR SSP					
AUGER 2	SLIGHT N 6%	0-30	SBK C	VFR SSP					PS 0.3
		30-44	SBK CL	FR SSP					
		44-48	WSBK LOAMY SAP	VFR SSP					
AUGER 3	L 6%	0-34	SBK C	FR SS/SP SSP					PS 0.25
		34-48	SBK C	FR SS/SP SSP					
AT 4	SLIGHT N 5%	0-3	GR L	VFR SSP					PS 0.35
		3-26	SBK C	FR SSP					
		26-39	WSBK CL	FR SSP					
		39-48	WSBK LOAM SAP.	VFR SSP					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	S	S
System Type(s)	II	II
Site LTAR	0.3	0.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: S. HEDRICK
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

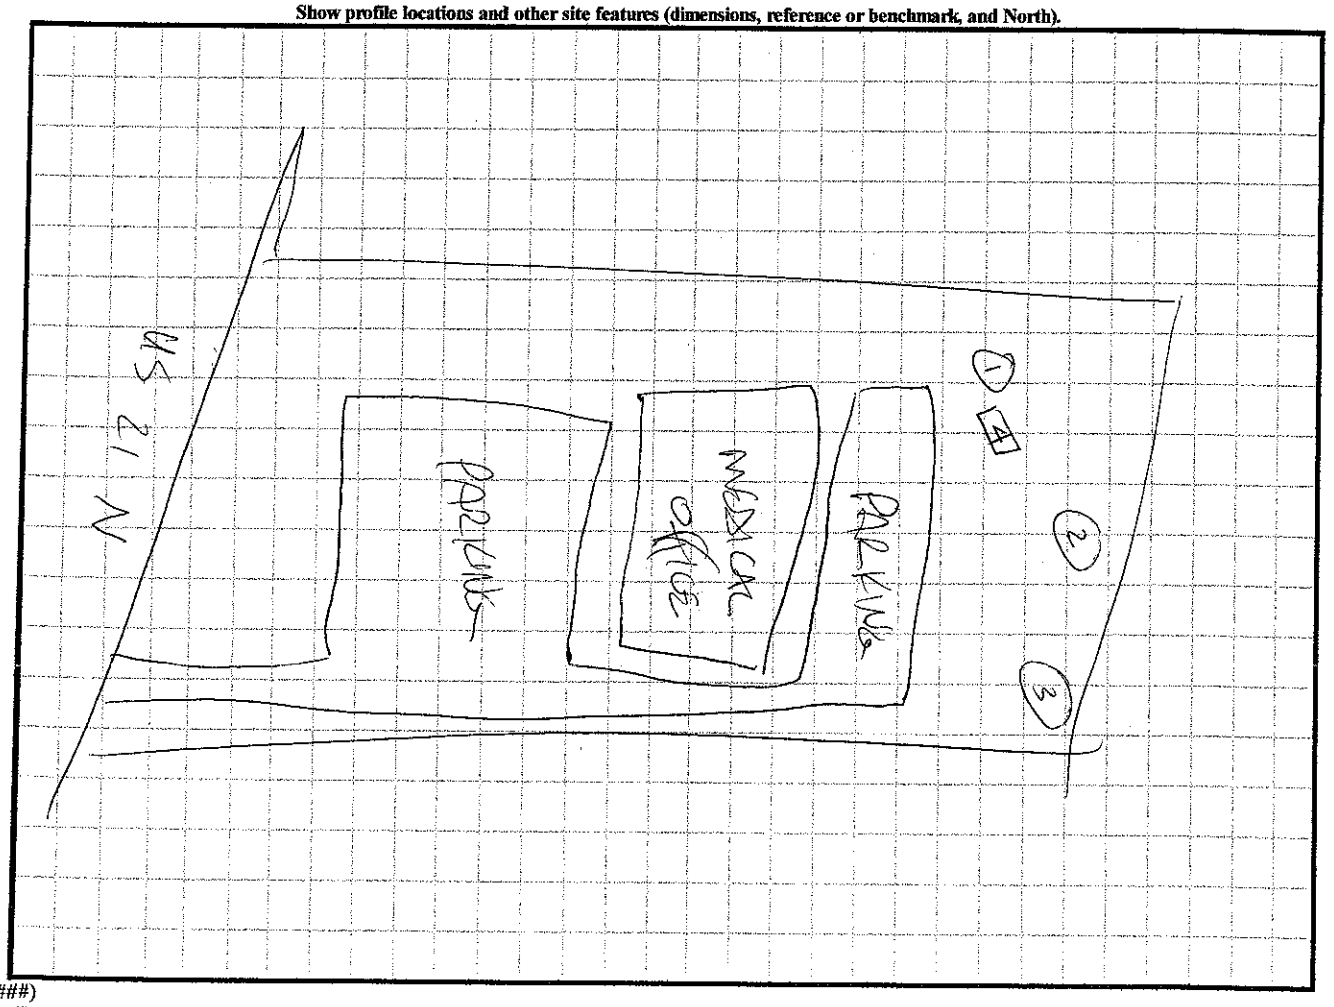

DENR (##-####)
Review (##-###)