RSD

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #: 4871657641
COUNTY: Moore
158340

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: JOHN BARTLETT
ADDRESS: 200 County Seat Rd Aberdeen NC 28314
PROPOSED FACILITY: 4B House
PROPOSED DESIGN FLOW (.1949): 420
LOCATION OF SITE: 200 County Seat Rd Aberdeen NC 28314
WATER SUPPLY: X Private • Public • X Well • Spring • Other
EVALUATION METHOD: X Auger Boring X Pit • Cut
TYPE OF WASTEWATER: X Sewage • Industrial Process • Mixed

APPLICATION DATE: 9/16/09
DATE EVALUATED: 10/7/09
PROPERTY SIZE: 1.78
PROPERTY RECORDED: YES

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	BT 4"; in 10 3.3% L	0-12"	scl wk gr	f nsp nvp	18"-40" 2.5Y 6/4	60"	N/A	N/A	PS .25
		12-24"	cl wk abk	f ss sp scp	2.5Y 7/8				
		24-36"	cmod abk	f sp slcp	F/Loss mottles	24"-60" *			
		36-60"	wk cmod sbk	f ss sp scp	fw sip inclusions 36-60"				
2	BT 4"; in 10' 3.3% L	0-10"	scl wk gr	f nsp nvp	36"-55" 2.5Y 7/8 2.5Y 6/4	55"	N/A	N/A	PS .25
		10-55"	cmod abk	f sp slcp					
3	Across 6"; in 10' 5% L	0-8"	scl wk gr	f nsp nvp	24-48" FEW 2.5Y 6/4	48"	N/A	N/A	PS .25
		8-48"	cmod abk	f sp scp					
4	BT 4"; in 10' 3.3% L	0-12"	scl wk gr	f nsp nvp	N/A	55"	N/A	N/A	PS .25
		12-55"	cmod abk	f sp slcp					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	YES	YES
System Type(s)	GRW 25%	GRW 25%
Site LTAR	.25	.25

OTHER FACTORS (.1946): NONE
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: L. Cook
OTHER(S) PRESENT: R. Wilson / Owner

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

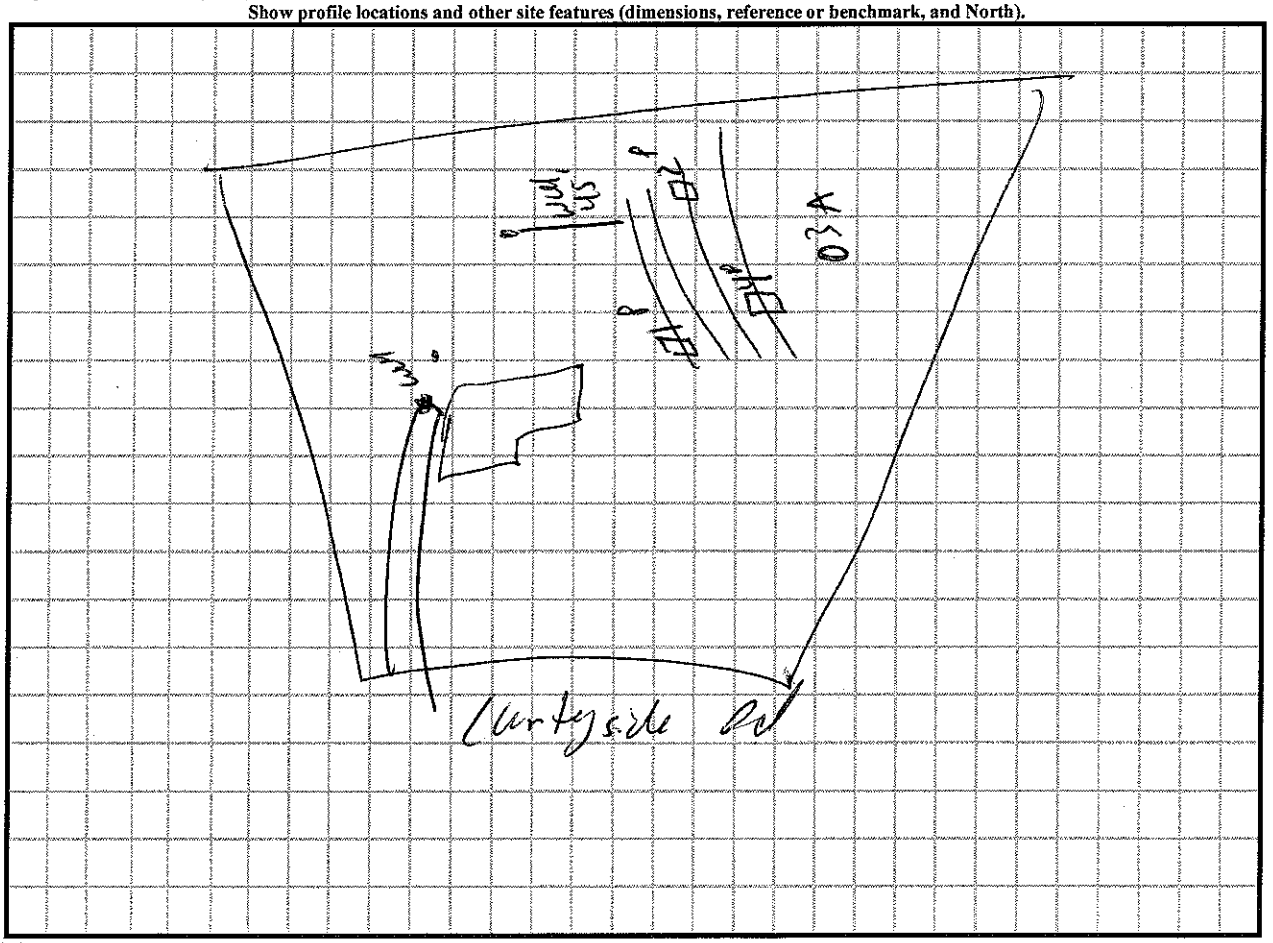

DENR (######)
Review (#####)