DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

4892 - 10 - 2878

Sheet 1 of ____
PROPERTY ID #: ____
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: WAYNE HOMES MID-ATLANTIC, LLC
ADDRESS: 130 VICTORY LN STATESVILLE, 28625
PROPOSED FACILITY: 4 BR
PROPOSED DESIGN FLOW (.1949): 480
LOCATION OF SITE: I-77 N TR HWY 901 TL HWY 21 TR POWELL BRIDGE TL ROCKY FORD TO END TR ABBEYDALE ON RT (538 ABBEY-DALE)
WATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

APPLICATION DATE 9-27-04
DATE EVALUATED: 10-12-04
PROPERTY SIZE: 4.97
PROPERTY RECORDED: YES

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L	0-2	wk gr sl	vfr ss/sp sexp	—	>48	—	—	PS .3
		2-24	mo sbk c	fr s/p sexp					
		24-48	mo sbk c+sap	fr s/p sexp					
2	L	0-6	wk gr sl	vfr ns/np sexp	—	6	—	—	UN N/A
		6+	sl ma ROCK	—					
3	L	0-6	wk gr sl	vfr ns/np sexp	—	>48	—	—	PS .3
		6-48	mo sbk c	fr s/p sexp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): ____
SITE CLASSIFICATION (.1948): ____
EVALUATED BY: ____
OTHER(S) PRESENT: ____

COMMENTS: ____

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

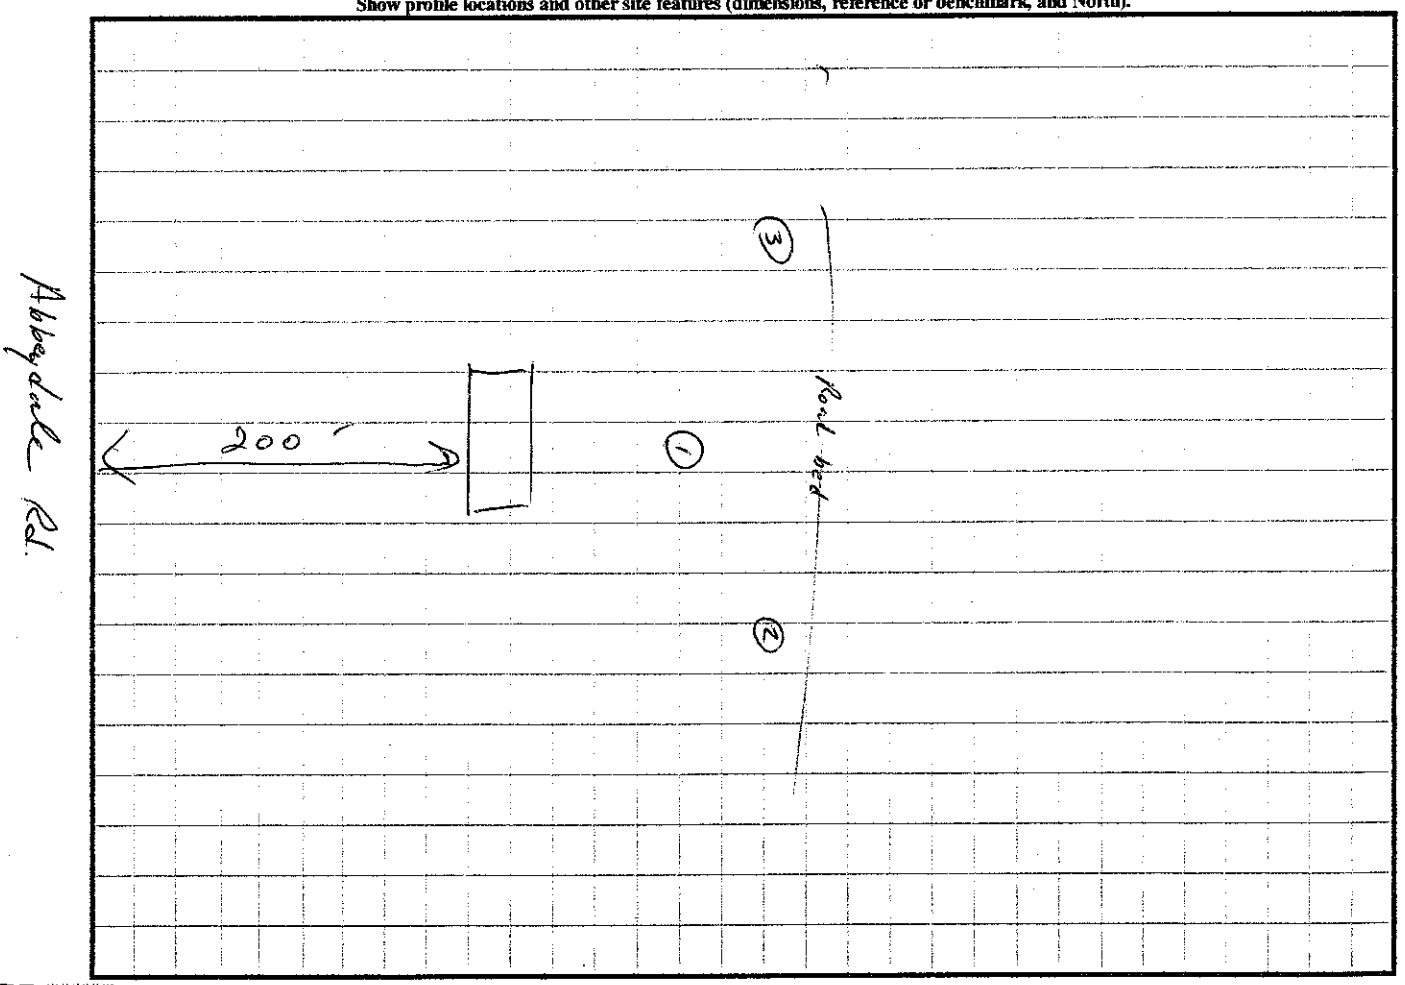

DENR (######)

Review (#####)

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

4892-10-2878

Sheet 2 of ___
PROPERTY ID #: ___
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: WAYNE Homes MID-ATLANTIC, LLC
ADDRESS: ___
PROPOSED FACILITY: 4 BR
PROPOSED DESIGN FLOW (.1949): 480
LOCATION OF SITE: ___

APPLICATION DATE 9-27-04
DATE EVALUATED: 10-27-04
PROPERTY SIZE: 4.97
PROPERTY RECORDED: YES

WATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L	0-3	wk sbk scl	vfr ~~SS~~/~~SP~~ sexp	—	>48"	—	—	PS
		3-30	mo sbk C	fr S/P sexp					0.3
		30-48	mo sbk C+Sap	fr S/P sexp					
2	L	0-18	wk gr sl	vfr NS/NP sexp	—	>48"	—	—	PS
		18-35	mo sbk C	fr S/P sexp					0.3
		35-48	mo sbk C+Sap	fr S/P sexp					
3	L	0-6	wk gr sl	vfr NS/NP sexp	—	>48"	—	—	PS
		6-36	mo sbk C	fr S/P sexp					0.3
		36-48	mo sbk C+Sap	fr S/P sexp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): ___
EVALUATED BY: ___
OTHER(S) PRESENT: ___

COMMENTS: ___